



Processes



Stick (SMAW) Welding



MIG (GMAW) Welding
Flux Cored (FCAW) Welding





Non-Critical TIG (GTAW)
Welding

Description



Engine Driven Welder/Generator

Trailblazer[®] 325 Diesel

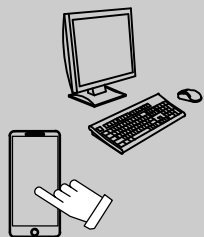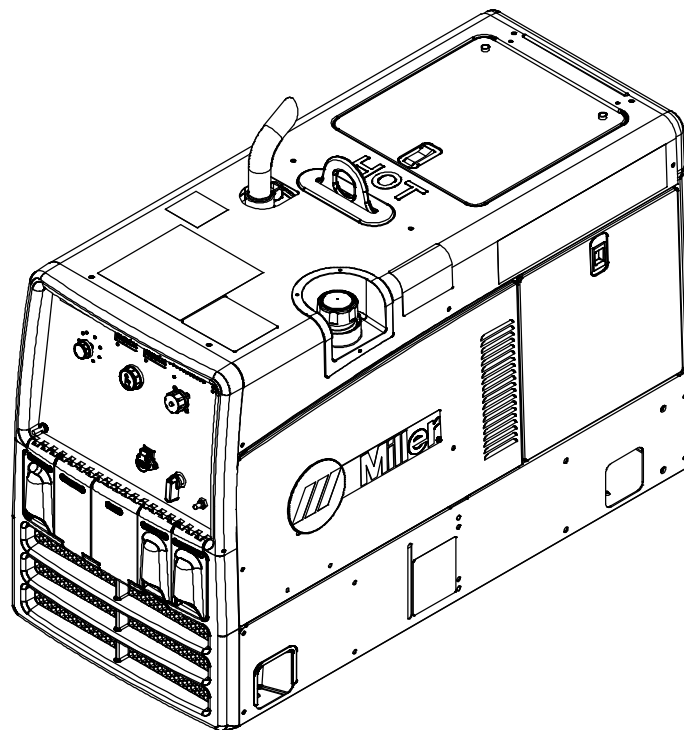

For product information,
Owner's Manual translations,
and more, visit

www.MillerWelds.com

OWNER'S MANUAL

File: Engine Drive



From Miller to You

Thank you and congratulations on choosing Miller. Now you can get the job done and get it done right. We know you don't have time to do it any other way.

That's why when Niels Miller first started building arc welders in 1929, he made sure his products offered long-lasting value and superior quality. Like you, his customers couldn't afford anything less. Miller products had to be more than the best they could be. They had to be the best you could buy.

Today, the people that build and sell Miller products continue the tradition. They're just as committed to providing equipment and service that meets the high standards of quality and value established in 1929.

This Owner's Manual is designed to help you get the most out of your Miller products. Please take time to read the Safety precautions. They will help you protect yourself against potential hazards on the worksite.



ISO 9001
Quality

Miller is the first welding equipment manufacturer in the U.S.A. to be registered to the ISO 9001 Quality System Standard.

We've made installation and operation quick and easy. With Miller you can count on years of reliable service with proper maintenance. And if for some reason the unit needs repair, there's a Troubleshooting section that will help you figure out what the problem is. The parts list will then help you to decide the exact part you may need to fix the problem. Warranty and service information for your particular model are also provided.



Miller Electric manufactures a full line of welders and welding related equipment. For information on other quality Miller products, contact your local Miller distributor to receive the latest full line catalog or individual specification sheets. **To locate your nearest distributor or service agency call 1-800-4-A-Miller, or visit us at www.MillerWelds.com on the web.**



Working as hard as you do – every power source from Miller is backed by the most hassle-free warranty in the business.



TABLE OF CONTENTS

SECTION 1 – SAFETY PRECAUTIONS – READ BEFORE USING	1
1-1. Symbol Usage	1
1-2. Arc Welding Hazards	1
1-3. Engine Hazards	3
1-4. Compressed Air Hazards	3
1-5. Additional Symbols For Installation, Operation, And Maintenance	4
1-6. California Proposition 65 Warnings	6
1-7. Principal Safety Standards	6
1-8. EMF Information	6
SECTION 2 – CONSIGNES DE SÉCURITÉ – LIRE AVANT UTILISATION	7
2-1. Signification des symboles	7
2-2. Dangers relatifs au soudage à l'arc	7
2-3. Dangers existant en relation avec le moteur	9
2-4. Dangers liés à l'air comprimé	10
2-5. Dangers supplémentaires en relation avec l'installation, le fonctionnement et la maintenance	11
2-6. Proposition californienne 65 Avertissements	13
2-7. Principales normes de sécurité	13
2-8. Informations relatives aux CEM	13
SECTION 3 – DEFINITIONS	15
3-1. Additional Safety Symbol Definition	15
3-2. Miscellaneous Symbol Definitions	15
SECTION 4 – SPECIFICATIONS	17
4-1. Serial Number And Rating Label Location	17
4-2. Weld, Power, and Engine Specifications	17
4-3. Environmental Specifications	17
4-4. Dimensions, Weights, And Operating Angles	18
4-5. Duty Cycle	19
4-6. Static Output Characteristics	19
4-7. Fuel Consumption Curves	20
4-8. Stick Volt-Ampere Curves	21
4-9. MIG Volt-Ampere Curves	22
4-10. TIG Volt-Ampere Curves	22
SECTION 5 – INSTALLATION	23
5-1. Installing Welder/Generator	23
5-2. Grounding Generator To Truck Or Trailer Frame	24
5-3. Installing Exhaust Pipe	24
5-4. Connecting the Battery	25
5-5. Overview And Engine Prestart Checks	26
5-6. Weld Output Terminals	28
5-7. Selecting Cable Sizes*	29
5-8. Connecting To Weld Output Terminals	29
5-9. Remote Receptacle Information	30
SECTION 6 – OPERATING WELDER/GENERATOR	32
6-1. Front Panel Controls (See Section 6-2)	32
6-2. Description Of Front Panel Controls (See Section 6-1)	33
6-3. Process/Contactor Switch	34
6-4. Engine Auto Speed	35
6-5. Service Menu	35
6-6. Arc Control Settings	36

TABLE OF CONTENTS

6-7. Stick Start Procedure – Scratch Start Technique	38
6-8. Lift-Arc™ TIG With Auto-Stop™ And Auto-Crater™	38
6-9. Remote Voltage/Amperage Control	39
6-10. Updating Software	40
6-11. Summary File	41
6-12. Fuel/Hour Gauge Descriptions	42
6-13. Associating ArcReach Devices (ArcReach Models Only)	43
SECTION 7 – OPERATING AUXILIARY EQUIPMENT	44
7-1. Generator Power Receptacles And Supplementary Protectors	44
7-2. GFCI Receptacle Information, Resetting And Testing	45
7-3. Optional Excel Power	46
7-4. Simultaneous Weld And Power	46
7-5. Wiring Instructions For Optional 240 Volt, Single-Phase Plug (NEMA 14-50P)	47
SECTION 8 – MAINTENANCE AND TROUBLESHOOTING	49
8-1. Routine Maintenance	49
8-2. Maintenance Label And Engine Maintenance Activities	50
8-3. Replacing Air Cleaner	52
8-4. Adjusting Engine Speed	53
8-5. Overload Protection	53
8-6. Voltmeter/Ammeter Error Displays	54
8-7. Troubleshooting Tables	55
SECTION 9 – PARTS LIST	57
9-1. Recommended Spare Parts	57
SECTION 10 – ELECTRICAL DIAGRAMS	58
SECTION 11 – GENERATOR POWER GUIDELINES	60
COMPLETE PARTS LIST – Available at www.MillerWelds.com	
WARRANTY	

SECTION 1 – SAFETY PRECAUTIONS – READ BEFORE USING

rom_2015-09

⚠ Protect yourself and others from injury — read, follow, and save these important safety precautions and operating instructions.

1-1. Symbol Usage



DANGER! – Indicates a hazardous situation which, if not avoided, will result in death or serious injury. The possible hazards are shown in the adjoining symbols or explained in the text.



Indicates a hazardous situation which, if not avoided, could result in death or serious injury. The possible hazards are shown in the adjoining symbols or explained in the text.

NOTICE – Indicates statements not related to personal injury.

Indicates special instructions.



This group of symbols means Warning! Watch Out! ELECTRIC SHOCK, MOVING PARTS, and HOT PARTS hazards. Consult symbols and related instructions below for necessary actions to avoid the hazards.

1-2. Arc Welding Hazards



The symbols shown below are used throughout this manual to call attention to and identify possible hazards. When you see the symbol, watch out, and follow the related instructions to avoid the hazard. The safety information given below is only a summary of the more complete safety information found in the Safety Standards listed in Section 1-7. Read and follow all Safety Standards.



Only qualified persons should install, operate, maintain, and repair this unit.



During operation, keep everybody, especially children, away.



ELECTRIC SHOCK can kill.

Touching live electrical parts can cause fatal shocks or severe burns. The electrode and work circuit is electrically live whenever the output is on. The input power circuit and machine internal circuits are also live when power is on. In semiautomatic or automatic wire welding, the wire, wire reel, drive roll housing, and all metal parts touching the welding wire are electrically live. Incorrectly installed or improperly grounded equipment is a hazard.

- Do not touch live electrical parts.
- Wear dry, hole-free insulating gloves and body protection.
- Insulate yourself from work and ground using dry insulating mats or covers big enough to prevent any physical contact with the work or ground.
- Do not use AC output in damp areas, if movement is confined, or if there is a danger of falling.
- Use AC output ONLY if required for the welding process.
- If AC output is required, use remote output control if present on unit.
- Additional safety precautions are required when any of the following electrically hazardous conditions are present: in damp locations or while wearing wet clothing; on metal structures such as floors, gratings, or scaffolds; when in cramped positions such as sitting, kneeling, or lying; or when there is a high risk of unavoidable or accidental contact with the workpiece or ground. For these conditions, use the following equipment in order presented: 1) a semiautomatic DC constant voltage (wire) welder, 2) a DC manual (stick) welder, or 3) an AC welder with reduced open-circuit voltage. In most situations, use of a DC, constant voltage wire welder is recommended. And, do not work alone!
- Disconnect input power or stop engine before installing or servicing this equipment. Lockout/tagout input power according to OSHA 29 CFR 1910.147 (see Safety Standards).
- Properly install, ground, and operate this equipment according to its Owner's Manual and national, state, and local codes.

- Always verify the supply ground — check and be sure that input power cord ground wire is properly connected to ground terminal in disconnect box or that cord plug is connected to a properly grounded receptacle outlet.
- When making input connections, attach proper grounding conductor first – double-check connections.
- Keep cords dry, free of oil and grease, and protected from hot metal and sparks.
- Frequently inspect input power cord and ground conductor for damage or bare wiring – replace immediately if damaged – bare wiring can kill.
- Turn off all equipment when not in use.
- Do not use worn, damaged, undersized, or repaired cables.
- Do not drape cables over your body.
- If earth grounding of the workpiece is required, ground it directly with a separate cable.
- Do not touch electrode if you are in contact with the work, ground, or another electrode from a different machine.
- Use only well-maintained equipment. Repair or replace damaged parts at once. Maintain unit according to manual.
- Do not touch electrode holders connected to two welding machines at the same time since double open-circuit voltage will be present.
- Wear a safety harness if working above floor level.
- Keep all panels and covers securely in place.
- Clamp work cable with good metal-to-metal contact to workpiece or worktable as near the weld as practical.
- Insulate work clamp when not connected to workpiece to prevent contact with any metal object.
- Do not connect more than one electrode or work cable to any single weld output terminal. Disconnect cable for process not in use.
- Use GFCI protection when operating auxiliary equipment. Do not test or reset GFCI receptacles at idle speed/low voltage or the GFCI will be damaged and not provide protection from electric shock caused by a ground fault.


SIGNIFICANT DC VOLTAGE exists in inverter power sources AFTER stopping engine.

- Stop engine on inverter and discharge input capacitors according to instructions in Maintenance Section before touching any parts.



HOT PARTS can burn.

- Do not touch hot parts bare handed.
- Allow cooling period before working on equipment.
- To handle hot parts, use proper tools and/or wear heavy, insulated welding gloves and clothing to prevent burns.

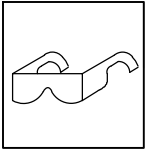

FLYING METAL or DIRT can injure eyes.

- Welding, chipping, wire brushing, and grinding cause sparks and flying metal. As welds cool, they can throw off slag.
- Wear approved safety glasses with side shields even under your welding helmet.



FUMES AND GASES can be hazardous.

Welding produces fumes and gases. Breathing these fumes and gases can be hazardous to your health.

- Keep your head out of the fumes. Do not breathe the fumes.
- If inside, ventilate the area and/or use local forced ventilation at the arc to remove welding fumes and gases. The recommended way to determine adequate ventilation is to sample for the composition and quantity of fumes and gases to which personnel are exposed.
- If ventilation is poor, wear an approved air-supplied respirator.
- Read and understand the Safety Data Sheets (SDSs) and the manufacturer's instructions for adhesives, coatings, cleaners, consumables, coolants, degreasers, fluxes, and metals.
- Work in a confined space only if it is well ventilated, or while wearing an air-supplied respirator. Always have a trained watch-person nearby. Welding fumes and gases can displace air and lower the oxygen level causing injury or death. Be sure the breathing air is safe.
- Do not weld in locations near degreasing, cleaning, or spraying operations. The heat and rays of the arc can react with vapors to form highly toxic and irritating gases.
- Do not weld on coated metals, such as galvanized, lead, or cadmium plated steel, unless the coating is removed from the weld area, the area is well ventilated, and while wearing an air-supplied respirator. The coatings and any metals containing these elements can give off toxic fumes if welded.



BUILDUP OF GAS can injure or kill.


- Shut off compressed gas supply when not in use.
- Always ventilate confined spaces or use approved air-supplied respirator.



ARC RAYS can burn eyes and skin.

Arc rays from the welding process produce intense visible and invisible (ultraviolet and infrared) rays that can burn eyes and skin. Sparks fly off from the weld.

- Wear an approved welding helmet fitted with a proper shade of filter lenses to protect your face and eyes from arc rays and sparks when welding or watching (see ANSI Z49.1 and Z87.1 listed in Safety Standards).
- Wear approved safety glasses with side shields under your helmet.
- Use protective screens or barriers to protect others from flash, glare, and sparks; warn others not to watch the arc.
- Wear body protection made from durable, flame-resistant material (leather, heavy cotton, wool). Body protection includes oil-free clothing such as leather gloves, heavy shirt, cuffless trousers, high shoes, and a cap.

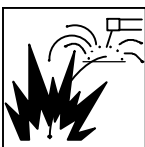


WELDING can cause fire or explosion.

Welding on closed containers, such as tanks, drums, or pipes, can cause them to blow up. Sparks can fly off from the welding arc. The flying sparks, hot workpiece, and hot equipment can cause fires and

burns. Accidental contact of electrode to metal objects can cause sparks, explosion, overheating, or fire. Check and be sure the area is safe before doing any welding.

- Remove all flammables within 35 ft (10.7 m) of the welding arc. If this is not possible, tightly cover them with approved covers.
- Do not weld where flying sparks can strike flammable material.
- Protect yourself and others from flying sparks and hot metal.


- Be alert that welding sparks and hot materials from welding can easily go through small cracks and openings to adjacent areas.
- Watch for fire, and keep a fire extinguisher nearby.
- Be aware that welding on a ceiling, floor, bulkhead, or partition can cause fire on the hidden side.
- Do not weld on containers that have held combustibles, or on closed containers such as tanks, drums, or pipes unless they are properly prepared according to AWS F4.1 and AWS A6.0 (see Safety Standards).
- Do not weld where the atmosphere can contain flammable dust, gas, or liquid vapors (such as gasoline).
- Connect work cable to the work as close to the welding area as practical to prevent welding current from traveling long, possibly unknown paths and causing electric shock, sparks, and fire hazards.
- Do not use welder to thaw frozen pipes.
- Remove stick electrode from holder or cut off welding wire at contact tip when not in use.
- Wear body protection made from durable, flame-resistant material (leather, heavy cotton, wool). Body protection includes oil-free clothing such as leather gloves, heavy shirt, cuffless trousers, high shoes, and a cap.
- Remove any combustibles, such as a butane lighter or matches, from your person before doing any welding.
- After completion of work, inspect area to ensure it is free of sparks, glowing embers, and flames.
- Use only correct fuses or circuit breakers. Do not oversize or bypass them.
- Follow requirements in OSHA 1910.252 (a) (2) (iv) and NFPA 51B for hot work and have a fire watcher and extinguisher nearby.
- Read and understand the Safety Data Sheets (SDSs) and the manufacturer's instructions for adhesives, coatings, cleaners, consumables, coolants, degreasers, fluxes, and metals.

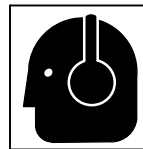

NOISE can damage hearing.


Noise from some processes or equipment can damage hearing.

- Wear approved ear protection if noise level is high.

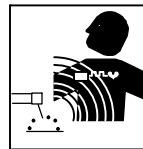

ELECTRIC AND MAGNETIC FIELDS (EMF) can affect Implanted Medical Devices.

- Wearers of Pacemakers and other Implanted Medical Devices should keep away.
- Implanted Medical Device wearers should consult their doctor and the device manufacturer before going near arc welding, spot welding, gouging, plasma arc cutting, or induction heating operations.

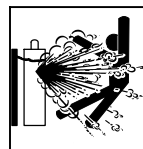

CYLINDERS can explode if damaged.

Compressed gas cylinders contain gas under high pressure. If damaged, a cylinder can explode. Since gas cylinders are normally part of the welding process, be sure to treat them carefully.

- Protect compressed gas cylinders from excessive heat, mechanical shocks, physical damage, slag, open flames, sparks, and arcs.
- Install cylinders in an upright position by securing to a stationary support or cylinder rack to prevent falling or tipping.
- Keep cylinders away from any welding or other electrical circuits.
- Never drape a welding torch over a gas cylinder.
- Never allow a welding electrode to touch any cylinder.
- Never weld on a pressurized cylinder — explosion will result.
- Use only correct compressed gas cylinders, regulators, hoses, and fittings designed for the specific application; maintain them and associated parts in good condition.
- Turn face away from valve outlet when opening cylinder valve. Do not stand in front of or behind the regulator when opening the valve.
- Keep protective cap in place over valve except when cylinder is in use or connected for use.
- Use the right equipment, correct procedures, and sufficient number of persons to lift and move cylinders.
- Read and follow instructions on compressed gas cylinders, associated equipment, and Compressed Gas Association (CGA) publication P-1 listed in Safety Standards.

1-3. Engine Hazards



BATTERY EXPLOSION can injure.

- Always wear a face shield, rubber gloves, and protective clothing when working on a battery.
- Stop engine before disconnecting or connecting battery cables, battery charging cables (if applicable), or servicing battery.
- Do not allow tools to cause sparks when working on a battery.
- Do not use welder to charge batteries or jump start vehicles unless the unit has a battery charging feature designed for this purpose.
- Observe correct polarity (+ and -) on batteries.
- Disconnect negative (-) cable first and connect it last.
- Keep sparks, flames, cigarettes, and other ignition sources away from batteries. Batteries produce explosive gases during normal operation and when being charged.
- Follow battery manufacturer's instructions when working on or near a battery.



FUEL can cause fire or explosion.

- Stop engine and let it cool off before checking or adding fuel.
- Do not add fuel while smoking or if unit is near any sparks or open flames.
- Do not overfill tank — allow room for fuel to expand.
- Do not spill fuel. If fuel is spilled, clean up before starting engine.
- Dispose of rags in a fireproof container.
- Always keep nozzle in contact with tank when fueling.



MOVING PARTS can injure.

- Keep away from moving parts such as fans, belts, and rotors.
- Keep all doors, panels, covers, and guards closed and securely in place.
- Stop engine before installing or connecting unit.
- Have only qualified persons remove doors, panels, covers, or guards for maintenance and troubleshooting as necessary.
- To prevent accidental starting during servicing, disconnect negative (-) battery cable from battery.
- Keep hands, hair, loose clothing, and tools away from moving parts.
- Reinstall doors, panels, covers, or guards when servicing is finished and before starting engine.
- Before working on generator, remove spark plugs or injectors to keep engine from kicking back or starting.
- Block flywheel so that it will not turn while working on generator components.




EXHAUST SPARKS can cause fire.

- Do not let engine exhaust sparks cause fire.
- Use approved engine exhaust spark arrestor in required areas — see applicable codes.




HOT PARTS can burn.

- Do not touch hot parts bare handed.
- Allow cooling period before working on equipment.
- To handle hot parts, use proper tools and/or wear heavy, insulated welding gloves and clothing to prevent burns.

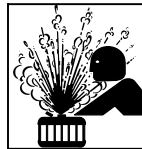

STEAM AND HOT COOLANT can burn.

- If possible, check coolant level when engine is cold to avoid scalding.
- Always check coolant level at overflow tank, if present on unit, instead of radiator (unless told otherwise in maintenance section or engine manual).
- If the engine is warm, checking is needed, and there is no overflow tank, follow the next two statements.
- Wear safety glasses and gloves and put a rag over radiator cap.
- Turn cap slightly and let pressure escape slowly before completely removing cap.

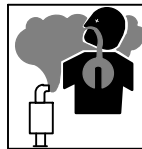

Using a generator indoors CAN KILL YOU IN MINUTES.

- Generator exhaust contains carbon monoxide. This is a poison you cannot see or smell.
- NEVER use inside a home or garage, EVEN IF doors and windows are open.
- Only use OUTSIDE and far away from windows, doors, and vents.



BATTERY ACID can BURN SKIN and EYES.

- Do not tip battery.
- Replace damaged battery.
- Flush eyes and skin immediately with water.



ENGINE HEAT can cause fire.

- Do not locate unit on, over, or near combustible surfaces or flammables.
- Keep exhaust and exhaust pipes way from flammables.

1-4. Compressed Air Hazards



COMPRESSED AIR EQUIPMENT can injure or kill.

- Incorrect installation or operation of this unit could result in equipment failure and personal injury. Only qualified persons should install, operate, and service this unit according to its Owner's Manual, industry standards, and national, state, and local codes.
- Do not exceed the rated output or capacity of the compressor or any equipment in the compressed air system. Design compressed air system so failure of any component will not put people or property at risk.
- Before working on compressed air system, turn off and lockout/tagout unit, release pressure, and be sure air pressure cannot be accidentally applied.
- Do not work on compressed air system with unit running unless you are a qualified person and following the manufacturer's instructions.
- Do not modify or alter compressor or manufacturer-supplied equipment. Do not disconnect, disable, or override any safety equipment in the compressed air system.
- Use only components and accessories approved by the manufacturer.
- Keep away from potential pinch points or crush points created by equipment connected to the compressed air system.
- Do not work under or around any equipment that is supported only by air pressure. Properly support equipment by mechanical means.




HOT METAL from air arc cutting and gouging can cause fire or explosion.

- Do not cut or gouge near flammables.
- Watch for fire; keep extinguisher nearby.



COMPRESSED AIR can injure or kill.

- Before working on compressed air system, turn off and lockout/tagout unit, release pressure, and be sure air pressure cannot be accidentally applied.
- Relieve pressure before disconnecting or connecting air lines.
- Check compressed air system components and all connections and hoses for damage, leaks, and wear before operating unit.

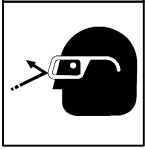

- Do not direct air stream toward self or others.
- Wear protective equipment such as safety glasses, hearing protection, leather gloves, heavy shirt and trousers, high shoes, and a cap when working on compressed air system.
- Use soapy water or an ultrasonic detector to search for leaks—never use bare hands. Do not use equipment if leaks are found.
- Reinstall doors, panels, covers, or guards when servicing is finished and before starting unit.
- If ANY air is injected into the skin or body seek medical help immediately.



BREATHING COMPRESSED AIR can injure or kill.

- Do not use compressed air for breathing.
- Use only for cutting, gouging, and tools.



TRAPPED AIR PRESSURE AND WHIPPING HOSES can injure.

- Release air pressure from tools and system before servicing, adding or changing attachments, or opening compressor oil drain or oil fill cap.



MOVING PARTS can injure.

- Keep away from moving parts such as fans, belts and rotors.
- Keep all doors, panels, covers, and guards closed and securely in place.


- Keep hands, hair, loose clothing, and tools away from moving parts.
- Before working on compressed air system, turn off and lockout/tagout unit, release pressure, and be sure air pressure cannot be accidentally applied.
- Have only qualified people remove guards or covers for maintenance and troubleshooting as necessary.
- Reinstall doors, panels, covers, or guards when servicing is finished and before starting engine.



HOT PARTS can burn.

- Do not touch hot compressor or air system parts.
- Allow cooling period before working on equipment.

- To handle hot parts, use proper tools and/or wear heavy, insulated welding gloves and clothing to prevent burns.

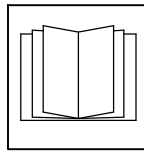

READ INSTRUCTIONS.

- Read and follow all labels and the Owner's Manual carefully before installing, operating, or servicing unit. Read the safety information at the beginning of the manual and in each section.


- Use only genuine replacement parts from the manufacturer.
- Perform installation, maintenance, and service according to the Owner's Manuals, industry standards, and national, state, and local codes.

1-5. Additional Symbols For Installation, Operation, And Maintenance



FIRE OR EXPLOSION hazard.

- Do not install or place unit on, over, or near combustible surfaces.
- Do not install unit near flammables.
- Do not overload building wiring – be sure power supply system is properly sized, rated, and protected to handle this unit.

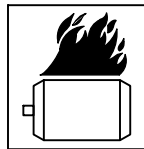


OVERHEATING can damage motors.

- Turn off or unplug equipment before starting or stopping engine.
- Do not let low voltage and frequency caused by low engine speed damage electric motors.
- Do not connect 50 or 60 Hertz motors to the 100 Hertz receptacle where applicable.




FALLING EQUIPMENT can injure.

- Use lifting eye to lift unit and properly installed accessories only, NOT gas cylinders. Do not exceed maximum lift eye weight rating (see Specifications).
- Use equipment of adequate capacity to lift and support unit.
- If using lift forks to move unit, be sure forks are long enough to extend beyond opposite side of unit.
- Keep equipment (cables and cords) away from moving vehicles when working from an aerial location.
- Follow the guidelines in the Applications Manual for the Revised NIOSH Lifting Equation (Publication No. 94-110) when manually lifting heavy parts or equipment.

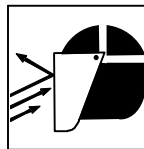

FLYING SPARKS can injure.

- Wear a face shield to protect eyes and face.
- Shape tungsten electrode only on grinder with proper guards in a safe location wearing proper face, hand, and body protection.
- Sparks can cause fires — keep flammables away.

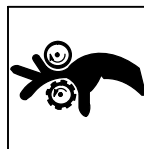

MOVING PARTS can injure.

- Keep away from moving parts.
- Keep away from pinch points such as drive rolls.



BATTERY CHARGING OUTPUT and BATTERY EXPLOSION can injure.

Battery charging not present on all models.

- Always wear a face shield, rubber gloves, and protective clothing when working on a battery.
- Stop engine before disconnecting or connecting battery cables, battery charging cables (if applicable), or servicing battery.
- Do not allow tools to cause sparks when working on a battery.
- Do not use welder to charge batteries or jump start vehicles unless it has a battery charging feature designed for this purpose.
- Observe correct polarity (+ and -) on batteries.
- Disconnect negative (-) cable first and connect it last.
- Keep sparks, flames, cigarettes, and other ignition sources away from batteries. Batteries produce explosive gases during normal operation and when being charged.
- Follow battery manufacturer's instructions when working on or near a battery.
- Have only qualified persons do battery charging work.
- If battery is being removed from a vehicle for charging, disconnect negative (-) cable first and connect it last. To prevent an arc, make sure all accessories are off.
- Charge lead-acid batteries only. Do not use battery charger to supply power to an extra-low-voltage electrical system or to charge dry cell batteries.
- Do not charge a frozen battery.
- Do not use damaged charging cables.
- Do not charge batteries in a closed area or where ventilation is restricted.
- Do not charge a battery that has loose terminals or one showing damage such as a cracked case or cover.
- Before charging battery, select correct charger voltage to match battery voltage.
- Set battery charging controls to the Off position before connecting to battery. Do not allow battery charging clips to touch each other.
- Keep charging cables away from vehicle hood, door, or moving parts.




HIGH PRESSURE FLUIDS can injure or kill.

- Engine fuel system components can be under high pressure.
- Before working on fuel system, turn off engine to release pressure.
- If any fluid is injected into the skin or body seek medical help immediately.




WELDING WIRE can injure.

- Do not press gun trigger until instructed to do so.
- Do not point gun toward any part of the body, other people, or any metal when threading welding wire.

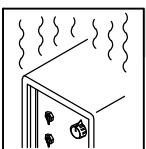

OVERUSE can cause OVERHEATING.

- Allow cooling period; follow rated duty cycle.
- Reduce current or reduce duty cycle before starting to weld again.
- Do not block or filter airflow to unit.

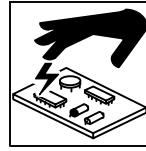


STATIC (ESD) can damage PC boards.

- Put on grounded wrist strap BEFORE handling boards or parts.
- Use proper static-proof bags and boxes to store, move, or ship PC boards.




TILTING OF TRAILER can injure.

- Use tongue jack or blocks to support weight.
- Properly install welding generator onto trailer according to instructions supplied with trailer.

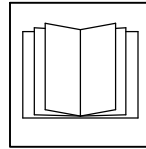


READ INSTRUCTIONS.

- Read and follow all labels and the Owner's Manual carefully before installing, operating, or servicing unit. Read the safety information at the beginning of the manual and in each section.
- Use only genuine replacement parts from the manufacturer.
- Perform installation, maintenance, and service according to the Owner's Manuals, industry standards, and national, state, and local codes.

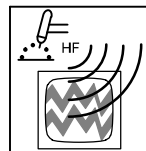

H.F. RADIATION can cause interference.

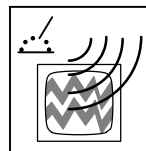


- High-frequency (H.F.) can interfere with radio navigation, safety services, computers, and communications equipment.
- Have only qualified persons familiar with electronic equipment perform this installation.
- The user is responsible for having a qualified electrician promptly correct any interference problem resulting from the installation.
- If notified by the FCC about interference, stop using the equipment at once.
- Have the installation regularly checked and maintained.
- Keep high-frequency source doors and panels tightly shut, keep spark gaps at correct setting, and use grounding and shielding to minimize the possibility of interference.




ARC WELDING can cause interference.

- Electromagnetic energy can interfere with sensitive electronic equipment such as micro-processors, computers, and computer-driven equipment such as robots.
- Be sure all equipment in the welding area is electromagnetically compatible.
- To reduce possible interference, keep weld cables as short as possible, close together, and down low, such as on the floor.
- Locate welding operation 100 meters from any sensitive electronic equipment.
- Be sure this welding machine is installed and grounded according to this manual.
- If interference still occurs, the user must take extra measures such as moving the welding machine, using shielded cables, using line filters, or shielding the work area.


1-6. California Proposition 65 Warnings

-  **Welding or cutting equipment produces fumes or gases which contain chemicals known to the State of California to cause birth defects and, in some cases, cancer. (California Health & Safety Code Section 25249.5 et seq.)**
-  **Battery posts, terminals and related accessories contain lead and lead compounds, chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. *Wash hands after handling.***
-  **This product contains chemicals, including lead, known to the state of California to cause cancer, birth defects, or other reproductive harm. *Wash hands after use.***

For Gasoline Engines:

-  **Engine exhaust contains chemicals known to the State of California to cause cancer, birth defects, or other reproductive harm.**

For Diesel Engines:

-  **Diesel engine exhaust and some of its constituents are known to the State of California to cause cancer, birth defects, and other reproductive harm.**

1-7. Principal Safety Standards

Safety in Welding, Cutting, and Allied Processes, ANSI Standard Z49.1, is available as a free download from the American Welding Society at <http://www.aws.org> or purchased from Global Engineering Documents (phone: 1-877-413-5184, website: www.global.ihs.com).

Safe Practices for the Preparation of Containers and Piping for Welding and Cutting, American Welding Society Standard AWS F4.1, from Global Engineering Documents (phone: 1-877-413-5184, website: www.global.ihs.com).

Safe Practices for Welding and Cutting Containers that have Held Combustibles, American Welding Society Standard AWS A6.0, from Global Engineering Documents (phone: 1-877-413-5184, website: www.global.ihs.com).

National Electrical Code, NFPA Standard 70, from National Fire Protection Association, Quincy, MA 02269 (phone: 1-800-344-3555, website: www.nfpa.org and www.sparky.org).

Safe Handling of Compressed Gases in Cylinders, CGA Pamphlet P-1, from Compressed Gas Association, 14501 George Carter Way, Suite 103, Chantilly, VA 20151 (phone: 703-788-2700, website: www.cganet.com).

Safety in Welding, Cutting, and Allied Processes, CSA Standard W117.2, from Canadian Standards Association, Standards Sales, 5060 Spectrum Way, Suite 100, Mississauga, Ontario, Canada L4W 5N5 (phone: 800-463-6727, website: www.csagroup.org).

Battery Chargers, CSA Standard C22.2 NO 107.2-01, from Canadian Standards Association, Standards Sales, 5060 Spectrum Way, Suite 100, Mississauga, Ontario, Canada L4W 5N5 (phone: 800-463-6727, website: www.csagroup.org).

Safe Practice For Occupational And Educational Eye And Face Protection, ANSI Standard Z87.1, from American National Standards Institute, 25 West 43rd Street, New York, NY 10036 (phone: 212-642-4900, website: www.ansi.org).

Standard for Fire Prevention During Welding, Cutting, and Other Hot Work, NFPA Standard 51B, from National Fire Protection Association, Quincy, MA 02269 (phone: 1-800-344-3555, website: www.nfpa.org).

OSHA, Occupational Safety and Health Standards for General Industry, Title 29, Code of Federal Regulations (CFR), Part 1910, Subpart Q, and Part 1926, Subpart J, from U.S. Government Printing Office, Superintendent of Documents, P.O. Box 371954, Pittsburgh, PA 15250-7954 (phone: 1-866-512-1800) (there are 10 OSHA Regional Offices—phone for Region 5, Chicago, is 312-353-2220, website: www.osha.gov).

Portable Generators Safety Alert, U.S. Consumer Product Safety Commission (CPSC), 4330 East West Highway, Bethesda, MD 20814 (phone: 301-504-7923, website: www.cpsc.gov).

Applications Manual for the Revised NIOSH Lifting Equation, The National Institute for Occupational Safety and Health (NIOSH), 1600 Clifton Rd, Atlanta, GA 30329-4027 (phone: 1-800-232-4636, website: www.cdc.gov/NIOSH).

1-8. EMF Information

Electric current flowing through any conductor causes localized electric and magnetic fields (EMF). The current from arc welding (and allied processes including spot welding, gouging, plasma arc cutting, and induction heating operations) creates an EMF field around the welding circuit. EMF fields can interfere with some medical implants, e.g. pacemakers. Protective measures for persons wearing medical implants have to be taken. For example, restrict access for passers-by or conduct individual risk assessment for welders. All welders should use the following procedures in order to minimize exposure to EMF fields from the welding circuit:

1. Keep cables close together by twisting or taping them, or using a cable cover.
2. Do not place your body between welding cables. Arrange cables to one side and away from the operator.
3. Do not coil or drape cables around your body.

4. Keep head and trunk as far away from the equipment in the welding circuit as possible.
5. Connect work clamp to workpiece as close to the weld as possible.
6. Do not work next to, sit or lean on the welding power source.
7. Do not weld whilst carrying the welding power source or wire feeder.

About Implanted Medical Devices:

Implanted Medical Device wearers should consult their doctor and the device manufacturer before performing or going near arc welding, spot welding, gouging, plasma arc cutting, or induction heating operations. If cleared by your doctor, then following the above procedures is recommended.

SECTION 2 – CONSIGNES DE SÉCURITÉ – LIRE AVANT UTILISATION

fre_rom_2015-09

! Pour écarter les risques de blessure pour vous-même et pour autrui — lire, appliquer et ranger en lieu sûr ces consignes relatives aux précautions de sécurité et au mode opératoire.

2-1. Signification des symboles



DANGER! – Indique une situation dangereuse qui si on l'évite pas peut donner la mort ou des blessures graves. Les dangers possibles sont montrés par les symboles joints ou sont expliqués dans le texte.



Indique une situation dangereuse qui si on l'évite pas peut donner la mort ou des blessures graves. Les dangers possibles sont montrés par les symboles joints ou sont expliqués dans le texte.

AVIS – Indique des déclarations pas en relation avec des blessures personnelles.

Indique des instructions spécifiques.



Ce groupe de symboles veut dire Avertissement! Attention! DANGER DE CHOC ELECTRIQUE, PIECES EN MOUVEMENT, et PIECES CHAUDES. Consulter les symboles et les instructions ci-dessous y afférant pour les actions nécessaires afin d'éviter le danger.

2-2. Dangers relatifs au soudage à l'arc



Les symboles présentés ci-après sont utilisés tout au long du présent manuel pour attirer votre attention et identifier les risques de danger. Lorsque vous voyez un symbole, soyez vigilant et suivez les directives mentionnées afin d'éviter tout danger. Les consignes de sécurité présentées ci-après ne font que résumer l'information contenue dans les normes de sécurité énumérées à la section 2-7. Veuillez lire et respecter toutes ces normes de sécurité.



L'installation, l'utilisation, l'entretien et les réparations ne doivent être confiés qu'à des personnes qualifiées.



Au cours de l'utilisation, tenir toute personne à l'écart et plus particulièrement les enfants.



UN CHOC ÉLECTRIQUE peut tuer.

Un simple contact avec des pièces électriques peut provoquer une électrocution ou des blessures graves. L'électrode et le circuit de soudage sont sous tension dès que l'appareil est sur ON. Le circuit d'entrée et les circuits internes de l'appareil sont également sous tension à ce moment-là. En soudage semi-automatique ou automatique, le fil, le dévidoir, le logement des galets d'entraînement et les pièces métalliques en contact avec le fil de soudage sont sous tension. Des matériels mal installés ou mal mis à la terre présentent un danger.

- Ne jamais toucher les pièces électriques sous tension.
- Porter des gants et des vêtements de protection secs ne comportant pas de trous.
- S'isoler de la pièce et de la terre au moyen de tapis ou d'autres moyens isolants suffisamment grands pour empêcher le contact physique éventuel avec la pièce ou la terre.
- Ne pas se servir de source électrique à courant électrique dans les zones humides, dans les endroits confinés ou là où on risque de tomber.
- Se servir d'une source électrique à courant électrique UNIQUEMENT si le procédé de soudage le demande.
- Si l'utilisation d'une source électrique à courant électrique s'avère nécessaire, se servir de la fonction de télécommande si l'appareil en est équipé.
- Des précautions de sécurité supplémentaires sont requises dans des environnements à risque comme: les endroits humides ou lorsque l'on porte des vêtements mouillés; sur des structures métalliques au sol, grillages et échafaudages; dans des positions assises, à genoux et allongées; ou quand il y a un risque important de contact accidentel avec la pièce ou le sol. Dans ces cas utiliser les appareils suivants dans l'ordre de préférence: 1) un poste à souder DC semi-automatique de type CV (MIG/MAG), 2) un poste à souder manuel (électrode enrobée) DC, 3) un poste à souder manuel AC avec tension à vide réduite. Dans la plupart des cas, un poste courant continu de type CV est recommandé. Et, ne pas travailler seul!
- Couper l'alimentation ou arrêter le moteur avant de procéder à l'installation, à la réparation ou à l'entretien de l'appareil. Déverrouiller l'alimentation selon la norme OSHA 29 CFR 1910.147 (voir normes de sécurité).
- Installer et mettre à la terre correctement cet appareil conformément à son manuel d'utilisation et aux codes nationaux, provinciaux et municipaux.
- Toujours vérifier la terre du cordon d'alimentation – Vérifier et s'assurer que le fil de terre du cordon d'alimentation est bien raccordé à la borne de terre du sectionneur ou que la fiche du cordon est raccordée à une prise correctement mise à la terre.
- En effectuant les raccordements d'entrée fixer d'abord le conducteur de mise à la terre approprié et contre-vérifier les connexions.
- Les câbles doivent être exempts d'humidité, d'huile et de graisse; protégez-les contre les étincelles et les pièces métalliques chaudes.
- Vérifier fréquemment le cordon d'alimentation et le conducteur de mise à la terre afin de s'assurer qu'il n'est pas altéré ou dénudé –, le remplacer immédiatement s'il l'est –. Un fil dénudé peut entraîner la mort.
- Mettre l'appareil hors tension quand on ne l'utilise pas.
- Ne pas utiliser des câbles usés, endommagés, sous dimensionnés ou réparés.
- Ne pas enrouler les câbles autour du corps.
- Si la pièce soudée doit être mise à la terre, le faire directement avec un câble distinct – ne pas utiliser le connecteur de pièce ou le câble de retour.
- Ne pas toucher l'électrode quand on est en contact avec la pièce, la terre ou une électrode provenant d'une autre machine.
- Ne pas toucher des porte électrodes connectés à deux machines en même temps à cause de la présence d'une tension à vide doublée.
- N'utiliser qu'un matériel en bon état. Réparer ou remplacer sur-le-champ les pièces endommagées. Entretien l'appareil conformément à ce manuel.
- Ne pas toucher aux portes-électrodes qui sont raccordés à deux machines à souder en même temps, car cela entraîne la présence d'une tension de circuit-ouvert double.
- Porter un harnais de sécurité quand on travaille en hauteur.
- Maintenir solidement en place tous les panneaux et capots.
- Fixer le câble de retour de façon à obtenir un bon contact métal-métal avec la pièce à souder ou la table de travail, le plus près possible de la soudure.
- Isoler la pince de masse quand pas mis à la pièce pour éviter le contact avec tout objet métallique.
- Ne pas raccorder plus d'une électrode ou plus d'un câble de masse à une même borne de sortie de soudage. Débrancher le câble pour le procédé non utilisé.

- Utiliser une protection différentielle lors de l'utilisation d'un équipement auxiliaire. Ne pas tester ni réarmer les prises femelles avec différentiel au régime de ralenti/en basse tension: cela endommagerait le disjoncteur différentiel, qui ne remplirait plus son rôle de protection contre une électrocution causée par un défaut de masse.


Il reste une TENSION DC NON NÉGLIGEABLE dans les sources de soudage onduleur UNE FOIS le moteur coupé.

- Couper l'alimentation du poste et décharger les condensateurs d'entrée comme indiqué dans la Section Maintenance avant de toucher des composants.



LES PIÈCES CHAUDES peuvent provoquer des brûlures.

- Ne pas toucher à mains nues les parties chaudes.
- Prévoir une période de refroidissement avant de travailler à l'équipement.
- Ne pas toucher aux pièces chaudes, utiliser les outils recommandés et porter des gants de soudage et des vêtements épais pour éviter les brûlures.

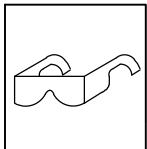

DES PIÈCES DE METAL ou DES SALETES peuvent provoquer des blessures dans les yeux.

- Le soudage, l'écaillage, le passage de la pièce à la brosse en fil de fer, et le meulage génèrent des étincelles et des particules métalliques volantes. Pendant la période de refroidissement des soudures, elles risquent de projeter du laitier.
- Porter des lunettes de sécurité avec écrans latéraux ou un écran facial.



LES FUMÉES ET LES GAZ peuvent être dangereux.


Le soudage génère des fumées et des gaz. Leur inhalation peut être dangereux pour votre santé.

- Eloigner votre tête des fumées. Ne pas respirer les fumées.
- À l'intérieur, ventiler la zone et/ou utiliser une ventilation forcée au niveau de l'arc pour l'évacuation des fumées et des gaz de soudage. Pour déterminer la bonne ventilation, il est recommandé de procéder à un prélèvement pour la composition et la quantité de fumées et de gaz auxquels est exposé le personnel.
- Si la ventilation est médiocre, porter un respirateur anti-vapeurs approuvé.
- Lire et comprendre les fiches de données de sécurité et les instructions du fabricant concernant les adhésifs, les revêtements, les nettoyants, les consommables, les produits de refroidissement, les dégraissages, les flux et les métaux.
- Travailler dans un espace fermé seulement s'il est bien ventilé ou en portant un respirateur à alimentation d'air. Demander toujours à un surveillant dûment formé de se tenir à proximité. Des fumées et des gaz de soudage peuvent déplacer l'air et abaisser le niveau d'oxygène provoquant des blessures ou des accidents mortels. S'assurer que l'air de respiration ne présente aucun danger.
- Ne pas souder dans des endroits situés à proximité d'opérations de dégraissage, de nettoyage ou de pulvérisation. La chaleur et les rayons de l'arc peuvent réagir en présence de vapeurs et former des gaz hautement toxiques et irritants.
- Ne pas souder des métaux munis d'un revêtement, tels que l'acier galvanisé, plaqué en plomb ou au cadmium à moins que le revêtement n'ait été enlevé dans la zone de soudure, que l'endroit soit bien ventilé, et en portant un respirateur à alimentation d'air. Les revêtements et tous les métaux renfermant ces éléments peuvent dégager des fumées toxiques en cas de soudage.



LES ACCUMULATIONS DE GAZ risquent de provoquer des blessures ou même la mort.

- Fermer l'alimentation du gaz comprimé en cas de non utilisation.
- Veiller toujours à bien aérer les espaces confinés ou se servir d'un respirateur d'adduction d'air homologué.

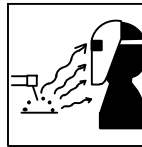

LES RAYONS DE L'ARC peuvent provoquer des brûlures dans les yeux et sur la peau.

Le rayonnement de l'arc du procédé de soudage génère des rayons visibles et invisibles intenses (ultraviolets et infrarouges) susceptibles de provoquer des brûlures dans les yeux et sur la peau. Des étincelles sont projetées pendant le soudage.

- Porter un casque de soudage approuvé muni de verres filtrants appropriés pour protéger visage et yeux pour protéger votre visage et vos yeux pendant le soudage ou pour regarder (voir ANSI Z49.1 et Z87.1 énuméré dans les normes de sécurité).
- Porter des lunettes de sécurité avec écrans latéraux même sous votre casque.
- Avoir recours à des écrans protecteurs ou à des rideaux pour protéger les autres contre les rayonnements les éblouissements et les étincelles ; prévenir toute personne sur les lieux de ne pas regarder l'arc.
- Porter un équipement de protection pour le corps fait d'un matériau résistant et ignifuge (cuir, coton robuste, laine). La protection du corps comporte des vêtements sans huile comme par ex. des gants de cuir, une chemise solide, des pantalons sans revers, des chaussures hautes et une casquette.



LE SOUDAGE peut provoquer un incendie ou une explosion.

Le soudage effectué sur des conteneurs fermés tels que des réservoirs, tambours ou des conduites peut provoquer leur éclatement. Des étincelles peuvent être projetées de l'arc de soudure. La projection d'étincelles, des pièces chaudes et des équipements chauds peut provoquer des incendies et des brûlures. Le contact accidentel de l'électrode avec des objets métalliques peut provoquer des étincelles, une explosion, un surchauffement ou un incendie. Avant de commencer le soudage, vérifier et s'assurer que l'endroit ne présente pas de danger.

- Déplacer toutes les substances inflammables à une distance de 10,7 m de l'arc de soudage. En cas d'impossibilité les recouvrir soigneusement avec des protections homologués.
- Ne pas souder dans un endroit où des étincelles peuvent tomber sur des substances inflammables.
- Se protéger et d'autres personnes de la projection d'étincelles et de métal chaud.
- Des étincelles et des matériaux chauds du soudage peuvent facilement passer dans d'autres zones en traversant de petites fissures et des ouvertures.
- Surveiller tout déclenchement d'incendie et tenir un extincteur à proximité.
- Le soudage effectué sur un plafond, plancher, paroi ou séparation peut déclencher un incendie de l'autre côté.
- Ne pas effectuer le soudage sur des conteneurs fermés tels que des réservoirs, tambours, ou conduites, à moins qu'ils n'aient été préparés correctement conformément à AWS F4.1 et AWS A6.0 (voir les Normes de Sécurité).
- Ne pas souder là où l'air ambiant pourrait contenir des poussières, gaz ou émanations inflammables (vapeur d'essence, par exemple).
- Brancher le câble de masse sur la pièce la plus près possible de la zone de soudage pour éviter le transport du courant sur une longue distance par des chemins inconnus éventuels en provoquant des risques d'électrocution, d'étincelles et d'incendie.
- Ne pas utiliser le poste de soudage pour dégeler des conduites gelées.
- En cas de non utilisation, enlever la baguette d'électrode du porte-électrode ou couper le fil à la pointe de contact.

- Porter un équipement de protection pour le corps fait d'un matériau résistant et ignifuge (cuir, coton robuste, laine). La protection du corps comporte des vêtements sans huile comme par ex. des gants de cuir, une chemise solide, des pantalons sans revers, des chaussures hautes et une casquette.
- Avant de souder, retirer toute substance combustible de vos poches telles qu'un allumeur au butane ou des allumettes.
- Une fois le travail achevé, assurez-vous qu'il ne reste aucune trace d'étincelles incandescentes ni de flammes.
- Utiliser exclusivement des fusibles ou coupe-circuits appropriés. Ne pas augmenter leur puissance; ne pas les ponter.
- Suivre les recommandations dans OSHA 1910.252(a)(2)(iv) et NFPA 51B pour les travaux à chaud et avoir de la surveillance et un extincteur à proximité.
- Lire et comprendre les fiches de données de sécurité et les instructions du fabricant concernant les adhésifs, les revêtements, les nettoyeurs, les consommables, les produits de refroidissement, les dégraisseurs, les flux et les métaux.



LE BRUIT peut affecter l'ouïe.


Le bruit des processus et des équipements peut affecter l'ouïe.

- Porter des protections approuvés pour les oreilles si le niveau sonore est trop élevé.



Les CHAMPS ÉLECTROMAGNÉTIQUES (CEM) peuvent affecter les implants médicaux.

- Les porteurs de stimulateurs cardiaques et autres implants médicaux doivent rester à distance.
- Les porteurs d'implants médicaux doivent consulter leur médecin et le fabricant du dispositif avant de s'approcher de la zone où se déroule du soudage à l'arc, du soudage par points, du gougeage, de la découpe plasma ou une opération de chauffage par induction.

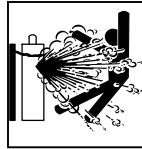


Si des BOUTEILLES sont endommagées, elles pourront exploser.

Des bouteilles de gaz comprimé protecteur contiennent du gaz sous haute pression. Si une bouteille est endommagée, elle peut exploser. Du fait que les

bouteilles de gaz font normalement partie du procédé de soudage, les manipuler avec précaution.

- Protéger les bouteilles de gaz comprimé d'une chaleur excessive, des chocs mécaniques, des dommages physiques, du laitier, des flammes ouvertes, des étincelles et des arcs.
- Placer les bouteilles debout en les fixant dans un support stationnaire ou dans un porte-bouteilles pour les empêcher de tomber ou de se renverser.
- Tenir les bouteilles éloignées des circuits de soudage ou autres circuits électriques.
- Ne jamais placer une torche de soudage sur une bouteille à gaz.
- Une électrode de soudage ne doit jamais entrer en contact avec une bouteille.
- Ne jamais souder une bouteille pressurisée – risque d'explosion.
- Utiliser seulement des bouteilles de gaz comprimé, régulateurs, tuyaux et raccords convenables pour cette application spécifique; les maintenir ainsi que les éléments associés en bon état.
- Tourner le dos à la sortie de vanne lors de l'ouverture de la vanne de la bouteille. Ne pas se tenir devant ou derrière le régulateur lors de l'ouverture de la vanne.
- Maintenir le chapeau de protection sur la soupape, sauf en cas d'utilisation ou de branchement de la bouteille.
- Utiliser les équipements corrects, les bonnes procédures et suffisamment de personnes pour soulever et déplacer les bouteilles.
- Lire et suivre les instructions sur les bouteilles de gaz comprimé, l'équipement connexe et le dépliant P-1 de la CGA (Compressed Gas Association) mentionné dans les principales normes de sécurité.

2-3. Dangers existant en relation avec le moteur

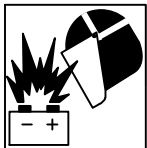

L'EXPLOSION DE LA BATTERIE peut provoquer des blessures.

- Toujours porter une protection faciale, des gants en caoutchouc et vêtements de protection lors d'une intervention sur la batterie.
- Arrêter le moteur avant de débrancher ou de brancher des câbles de batterie, des câbles de chargeur de batterie (le cas échéant) ou de batterie d'entretien.
- Éviter de provoquer des étincelles avec les outils en travaillant sur la batterie.
- Ne pas utiliser l'appareil de soudage pour charger des batteries ou faire démarrer des véhicules à l'aide de câbles de démarrage, sauf si l'appareil dispose d'une fonctionnalité de charge de batterie destinée à cet usage.
- Observer la polarité correcte (+ et -) sur les batteries.
- Débrancher le câble négatif (-) en premier lieu. Le rebrancher en dernier lieu.
- Les sources d'étincelles, flammes nues, cigarettes et autres sources d'inflammation doivent être maintenues à l'écart des batteries. Ces dernières produisent des gaz explosifs en fonctionnement normal et en cours de charge.
- Respecter les consignes du fabricant de la batterie pour travailler sur une batterie ou à proximité.



LE CARBURANT MOTEUR peut provoquer un incendie ou une explosion.

- Arrêter le moteur avant de vérifier le niveau de carburant ou de faire le plein.
- Ne pas faire le plein en fumant ou proche d'une source d'étincelles ou d'une flamme nue.
- Ne pas faire le plein de carburant à ras bord; prévoir de l'espace pour son expansion.
- Faire attention de ne pas renverser de carburant. Nettoyer tout carburant renversé avant de faire démarrer le moteur.
- Jeter les chiffons dans un récipient ignifuge.
- Toujours garder le pistolet en contact avec le réservoir lors du remplissage.



Les PIÈCES MOBILES peuvent causer des blessures.

- S'abstenir de toucher des parties mobiles telles que des ventilateurs, courroies et rotors.
- Maintenir fermés et verrouillés les portes, panneaux, recouvrements et dispositifs de protection.
- Arrêter le moteur avant d'installer ou brancher l'appareil.
- Lorsque cela est nécessaire pour des travaux d'entretien et de dépannage, faire retirer les portes, panneaux, recouvrements ou dispositifs de protection uniquement par du personnel qualifié.

- Pour empêcher tout démarrage accidentel pendant les travaux d'entretien, débrancher le câble négatif (-) de batterie de la borne.
- Ne pas approcher les mains, cheveux, vêtements lâches et outils des organes mobiles.
- Remettre en place les portes, panneaux, recouvrements ou dispositifs de protection à la fin des travaux d'entretien et avant de mettre le moteur en marche.
- Avant d'intervenir, déposer les bougies ou injecteurs pour éviter la mise en route accidentelle du moteur.
- Bloquer le volant moteur pour éviter sa rotation lors d'une intervention sur le générateur.



LES ÉTINCELLES À L'ÉCHAPPEMENT peuvent provoquer un incendie.

- Empêcher les étincelles d'échappement du moteur de provoquer un incendie.
- Utiliser uniquement un pare-étincelles approuvé – voir codes en vigueur.



LES PIÈCES CHAUDES peuvent provoquer des brûlures.

- Ne pas toucher des parties chaudes à mains nues.
- Prévoir une période de refroidissement avant de travailler à l'équipement.
- Ne pas toucher aux pièces chaudes, utiliser les outils recommandés et porter des gants de soudage et des vêtements épais pour éviter les brûlures.



LA VAPEUR ET LE LIQUIDE DE REFROIDISSEMENT CHAUD peuvent provoquer des brûlures.

- Il est préférable de vérifier le liquide de refroidissement une fois le moteur refroidi pour éviter de se brûler.


2-4. Dangers liés à l'air comprimé



Un ÉQUIPEMENT PNEUMATIQUE risque de provoquer des blessures ou même la mort.

- Une installation ou une utilisation incorrecte de cet appareil pourrait conduire à des dégâts matériels ou corporels. Seul un personnel qualifié est autorisé à installer, utiliser et entretenir cet appareil conformément à son manuel d'utilisation, aux normes industrielles et aux codes nationaux, d'état ou locaux.
- Ne pas dépasser le débit nominal ou la capacité du compresseur ou de tout équipement du circuit d'air comprimé. Concevoir le circuit d'air comprimé de telle sorte que la défaillance d'un composant ne risque pas de provoquer un accident matériel ou corporel.
- Avant d'intervenir sur le circuit d'air comprimé, couper l'alimentation électrique, verrouiller et étiqueter l'appareil, détendre la pression et s'assurer que le circuit d'air ne peut être mis sous pression par inadvertance.
- Ne pas intervenir sur le circuit d'air comprimé lorsque l'appareil fonctionne. Seul un personnel qualifié est autorisé, et appliquant les consignes du fabricant.
- Ne pas modifier ou altérer le compresseur ou les équipements fournis par le fabricant. Ne pas débrancher, désactiver ou neutraliser les équipements de sécurité du circuit d'air comprimé.
- Utiliser uniquement des composants et accessoires homologués par le fabricant.
- Se tenir à l'écart de tout point présentant un danger de pincement ou d'écrasement créé par l'équipement raccordé au circuit d'air comprimé.

- Toujours vérifier le niveau de liquide de refroidissement dans le vase d'expansion (si présent), et non dans le radiateur (sauf si précisé autrement dans la section maintenance du manuel du moteur).
- Si le moteur est chaud et que le liquide doit être vérifié, opérer comme suivant.
- Mettre des lunettes de sécurité et des gants, placer un torchon sur le bouchon du radiateur.
- Dévisser le bouchon légèrement et laisser la vapeur s'échapper avant d'enlever le bouchon.

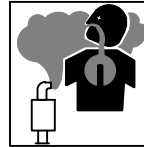

L'utilisation d'un groupe autonome à l'intérieur PEUT VOUS TUER EN QUELQUES MINUTES.

- Les fumées d'un groupe autonome contiennent du monoxyde de carbone. C'est un poison invisible et inodore.
- JAMAIS utiliser dans une maison ou garage, même avec les portes et fenêtres ouvertes.
- Uniquement utiliser à l'EXTÉRIEUR, loin des portes, fenêtres et bouches aération.



L'ACIDE DE LA BATTERIE peut provoquer des brûlures dans les YEUX et sur la PEAU.

- Ne pas renverser la batterie.
- Remplacer une batterie endommagée.
- Rincer immédiatement les yeux et la peau à l'eau.




LA CHALEUR DU MOTEUR peut provoquer un incendie.

- Ne pas placer l'appareil sur, au-dessus ou à proximité de surfaces inflammables.
- Tenir à distance les produits inflammables de l'échappement.




MÉTAL CHAUD provenant du découpage ou du gougeage à l'arc risque de provoquer un incendie ou une explosion.

- Ne pas découper ou gouger à proximité de produits inflammables.
- Attention aux risques d'incendie: tenir un extincteur à proximité.

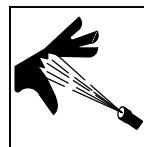

L'AIR COMPRIMÉ risque de provoquer des blessures ou même la mort.

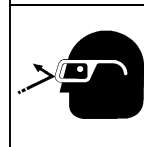

- Avant d'intervenir sur le circuit d'air comprimé, couper l'alimentation électrique, verrouiller et étiqueter l'appareil, détendre la pression et s'assurer que le circuit d'air ne peut être mis sous pression par inadvertance.
- Détendre la pression avant de débrancher ou de brancher des canalisations d'air.
- Avant d'utiliser l'appareil, contrôler les composants du circuit d'air comprimé, les branchements et les flexibles en recherchant tout signe de détérioration, de fuite et d'usure.
- Ne pas diriger un jet d'air vers soi-même ou vers autrui.
- Pour intervenir sur un circuit d'air comprimé, porter un équipement de protection tel que des lunettes de sécurité, des gants de cuir, une chemise et un pantalon en tissu résistant, des chaussures montantes et une coiffe.

- Pour rechercher des fuites, utiliser de l'eau savonneuse ou un détecteur à ultrasons, jamais les mains nues. En cas de détection de fuite, ne pas utiliser l'équipement.
- Remettre les portes, panneaux, recouvrements ou dispositifs de protection quand l'entretien est terminé et avant de mettre en marche l'appareil.
- En cas d'injection d'air dans la peau ou le corps, demander immédiatement une assistance médicale.



L'INHALATION D'AIR COMPRIMÉ risque de provoquer des blessures ou même la mort.

- Ne pas inhaler d'air comprimé.
- Utiliser l'air comprimé uniquement pour découper ou gouger ainsi que pour l'outillage pneumatique.



Une PRESSION D'AIR RÉSIDUELLE ET DES FLEXIBLES QUI FOUETTENT risquent de provoquer des blessures.


- Détendre la pression pneumatique des outils et circuits avant d'entretenir, ajouter ou changer des accessoires et avant d'ouvrir le bouchon de vidange ou de remplissage d'huile du compresseur.



Les PIÈCES MOBILES peuvent causer des blessures.


- S'abstenir de toucher des parties mobiles telles que des ventilateurs, courroies et rotors.
- Maintenir fermés et verrouillés les portes, panneaux, recouvrements et dispositifs de protection.

- Ne pas approcher les mains, cheveux, vêtements lâches et outils des organes mobiles.
- Avant d'intervenir sur le circuit d'air comprimé, couper l'alimentation électrique, verrouiller et étiqueter l'appareil, détendre la pression et s'assurer que le circuit d'air ne peut être mis sous pression par inadvertance.
- Demander seulement à un personnel qualifié d'enlever les dispositifs de sécurité ou les recouvrements pour effectuer, s'il y a lieu, des travaux d'entretien et de dépannage.
- Remettre en place les portes, panneaux, recouvrements ou dispositifs de protection à la fin des travaux d'entretien et avant de mettre le moteur en marche.

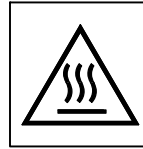

DES PIÈCES CHAUDES peuvent provoquer des brûlures graves.

- Ne pas toucher de pièces chaudes du compresseur ou du circuit d'air.
- Prévoir une période de refroidissement avant d'intervenir sur l'équipement.
- Ne pas toucher aux pièces chaudes, utiliser les outils recommandés et porter des gants de soudage et des vêtements épais pour éviter les brûlures.

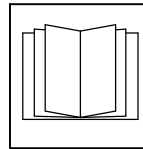

LIRE LES INSTRUCTIONS.


- Lire et appliquer les instructions sur les étiquettes et le Mode d'emploi avant l'installation, l'utilisation ou l'entretien de l'appareil. Lire les informations de sécurité au début du manuel et dans chaque section.
- N'utiliser que les pièces de rechange recommandées par le constructeur.
- Effectuer l'installation, l'entretien et toute intervention selon les manuels d'utilisateurs, les normes nationales, provinciales et de l'industrie, ainsi que les codes municipaux.

2-5. Dangers supplémentaires en relation avec l'installation, le fonctionnement et la maintenance



Risque D'INCENDIE OU D'EXPLOSION.

- Ne pas placer l'appareil sur, au-dessus ou à proximité de surfaces inflammables.
- Ne pas installer l'appareil à proximité de produits inflammables.
- Ne pas surcharger l'installation électrique – s'assurer que l'alimentation est correctement dimensionnée et protégée avant de mettre l'appareil en service.

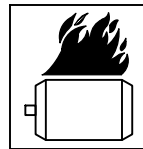


LE SURCHAUFFEMENT peut endommager le moteur électrique.

- Arrêter ou déconnecter l'équipement avant de démarrer ou d'arrêter le moteur.
- Ne pas laisser tourner le moteur trop lentement sous risque d'endommager le moteur électrique à cause d'une tension et d'une fréquence trop faibles.
- Ne pas brancher de moteur de 50 ou de 60 Hz à la prise de 100 Hz, s'il y a lieu.




LA CHUTE DE L'ÉQUIPEMENT peut provoquer des blessures.

- Utiliser l'anneau de levage pour lever l'appareil et les accessoires correctement installés seuls, PAS les bouteilles de gaz. Ne pas dépasser le poids nominal maximal de l'œilleton (voir les spécifications).
- Utiliser un équipement de levage de capacité suffisante pour lever l'appareil.
- En utilisant des fourches de levage pour déplacer l'unité, s'assurer que les fourches sont suffisamment longues pour dépasser du côté opposé de l'appareil.
- Tenir l'équipement (câbles et cordons) à distance des véhicules mobiles lors de toute opération en hauteur.
- Suivre les consignes du Manuel des applications pour l'équation de levage NIOSH révisée (Publication N°94-110) lors du levage manuel de pièces ou équipements lourds.

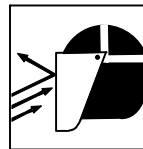

LES ÉTINCELLES PROJÉTÉES peuvent provoquer des blessures.

- Porter un écran facial pour protéger le visage et les yeux.
- Affûter l'électrode au tungstène uniquement à la meuleuse dotée de protecteurs. Cette manœuvre est à exécuter dans un endroit sûr lorsque l'on porte l'équipement homologué de protection du visage, des mains et du corps.
- Les étincelles risquent de causer un incendie – éloigner toute substance inflammable.

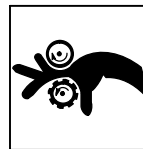

Les PIÈCES MOBILES peuvent causer des blessures.

- Ne pas s'approcher des organes mobiles.
- Ne pas s'approcher des points de coincement tels que des rouleaux de commande.



LA SORTIE DE RECHARGE et L'EXPLOSION DE LA BATTERIE peuvent provoquer des blessures.

La recharge de batterie n'existe pas sur tous les modèles.

- Toujours porter une protection faciale, des gants en caoutchouc et vêtements de protection lors d'une intervention sur la batterie.
- Arrêter le moteur avant de débrancher ou de brancher des câbles de batterie, des câbles de chargeur de batterie (le cas échéant) ou de batterie d'entretien.
- Eviter de provoquer des étincelles avec les outils en travaillant sur la batterie.
- Ne pas utiliser l'appareil de soudage pour charger des batteries ou faire démarrer des véhicules à l'aide de câbles de démarrage, sauf si l'appareil dispose d'une fonctionnalité de charge de batterie destinée à cet usage.
- Observer la polarité correcte (+ et -) sur les batteries.
- Débrancher le câble négatif (-) en premier lieu. Le rebrancher en dernier lieu.
- Les sources d'étincelles, flammes nues, cigarettes et autres sources d'inflammation doivent être maintenues à l'écart des batteries. Ces dernières produisent des gaz explosifs en fonctionnement normal et en cours de charge.
- Respecter les consignes du fabricant de la batterie pour travailler sur une batterie ou à proximité.
- Les opérations de charge de batterie ne doivent être effectuées que par des personnes qualifiées.
- Pour enlever la batterie d'un véhicule pour la recharge, débrancher tout d'abord le câble négatif (-) et le rebrancher en dernier lieu. Pour éviter un arc, s'assurer que tous les accessoires sont débranchés.
- Ne charger que des batteries plomb-acide. Ne pas utiliser le chargeur de batterie pour alimenter un autre circuit électrique basse tension ou pour charger des batteries sèches.
- Ne pas charger une batterie gelée.
- Ne pas utiliser de câbles de charge endommagés.
- Ne pas charger des batteries dans un espace fermé ou en l'absence d'une ventilation.
- Ne pas charger une batterie dont les bornes sont desserrées ou présentant une détérioration comme par exemple un boîtier ou un couvercle fissuré.
- Avant de charger une batterie, sélectionner la tension de charge correspondant à la tension de la batterie.
- Régler les commandes de charge de batterie sur la position d'arrêt avant de brancher la batterie. Veiller à ce que les pinces de charge ne se touchent pas.
- Ranger les câbles de charge à distance du capot, des portes et des pièces mobiles du véhicule.




LES LIQUIDES PRESSURISÉS peuvent blesser ou tuer.

- Les composants du système d'alimentation peuvent contenir du carburant sous pression élevée.
- Avant d'intervenir sur le système d'alimentation de carburant, arrêter le moteur pour dépressuriser le système.
- En cas d'injection de tout liquide sous la peau ou dans le corps, solliciter une aide médicale sur le champ.



LES FILS DE SOUDAGE peuvent provoquer des blessures.


- Ne pas appuyer sur la gâchette avant d'en avoir reçu l'instruction.
- Ne pas diriger le pistolet vers soi, d'autres personnes ou toute pièce mécanique en engageant le fil de soudage.

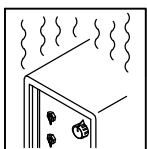

L'EMPLOI EXCESSIF peut SURCHAUFFER L'ÉQUIPEMENT.


- Laisser l'équipement refroidir ; respecter le facteur de marche nominal.

- Réduire le courant ou le facteur de marche avant de poursuivre le soudage.
- Ne pas obstruer les passages d'air du poste.

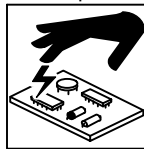


LES CHARGES ÉLECTROSTATIQUES peuvent endommager les circuits imprimés.

- Établir la connexion avec la barrette de terre avant de manipuler des cartes ou des pièces.
- Utiliser des pochettes et des boîtes antistatiques pour stocker, déplacer ou expédier des cartes de circuits imprimés.

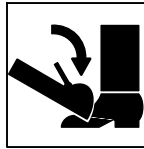


UNE REMORQUE QUI BASCULE peut provoquer des blessures.

- Utiliser les supports de la remorque ou des blocs pour soutenir le poids.
- Installer convenablement le poste sur la remorque comme indiqué dans le manuel s'y rapportant.

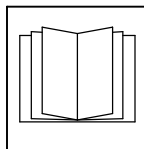


LIRE LES INSTRUCTIONS.

- Lire et appliquer les instructions sur les étiquettes et le Mode d'emploi avant l'installation, l'utilisation ou l'entretien de l'appareil. Lire les informations de sécurité au début du manuel et dans chaque section.
- N'utiliser que les pièces de rechange recommandées par le constructeur.
- Effectuer l'installation, l'entretien et toute intervention selon les manuels d'utilisateurs, les normes nationales, provinciales et de l'industrie, ainsi que les codes municipaux.

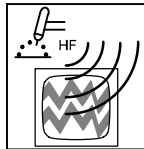

LE RAYONNEMENT HAUTE FRÉQUENCE (H.F.) risque de provoquer des interférences.

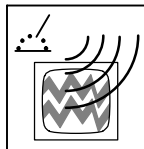


- Le rayonnement haute fréquence (H.F.) peut provoquer des interférences avec les équipements de radio-navigation et de communication, les services de sécurité et les ordinateurs.
- Demander seulement à des personnes qualifiées familiarisées avec des équipements électroniques de faire fonctionner l'installation.
- L'utilisateur est tenu de faire corriger rapidement par un électricien qualifié les interférences résultant de l'installation.
- Si le FCC signale des interférences, arrêter immédiatement l'appareil.
- Effectuer régulièrement le contrôle et l'entretien de l'installation.
- Maintenir soigneusement fermés les portes et les panneaux des sources de haute fréquence, maintenir les éclateurs à une distance correcte et utiliser une terre et un blindage pour réduire les interférences éventuelles.




LE SOUDAGE À L'ARC risque de provoquer des interférences.

- L'énergie électromagnétique risque de provoquer des interférences pour l'équipement électronique sensible tel que les ordinateurs et l'équipement commandé par ordinateur tel que les robots.
- Veiller à ce que tout l'équipement de la zone de soudage soit compatible électromagnétiquement.
- Pour réduire la possibilité d'interférence, maintenir les câbles de soudage aussi courts que possible, les grouper, et les poser aussi bas que possible (ex. par terre).
- Veiller à souder à une distance de 100 mètres de tout équipement électronique sensible.
- Veiller à ce que ce poste de soudage soit posé et mis à la terre conformément à ce mode d'emploi.
- En cas d'interférences après avoir pris les mesures précédentes, il incombe à l'utilisateur de prendre des mesures supplémentaires telles que le déplacement du poste, l'utilisation de câbles blindés, l'utilisation de filtres de ligne ou la pose de protecteurs dans la zone de travail.


2-6. Proposition californienne 65 Avertissements

-  Les équipements de soudage et de coupage produisent des fumées et des gaz qui contiennent des produits chimiques dont l'État de Californie reconnaît qu'ils provoquent des malformations congénitales et, dans certains cas, des cancers. (Code de santé et de sécurité de Californie, chapitre 25249.5 et suivants)
-  Les batteries, les bornes et autres accessoires contiennent du plomb et des composés à base de plomb, produits chimiques dont l'État de Californie reconnaît qu'ils provoquent des cancers et des malformations congénitales ou autres problèmes de procréation. *Se laver les mains après manipulation.*
-  Ce produit contient des produits chimiques, notamment du plomb, dont l'État de Californie reconnaît qu'ils provoquent des cancers, des malformations congénitales ou d'autres problèmes de procréation. *Se laver les mains après utilisation.*

Pour les moteurs à essence :

-  Les gaz d'échappement des moteurs contiennent des produits chimiques dont l'État de Californie reconnaît qu'ils provoquent des cancers et des malformations congénitales ou autres problèmes de procréation.

Pour les moteurs diesel :

-  Les gaz d'échappement des moteurs diesel et certains de leurs composants sont reconnus par l'État de Californie comme provoquant des cancers et des malformations congénitales ou autres problèmes de procréation.

2-7. Principales normes de sécurité

Safety in Welding, Cutting, and Allied Processes, ANSI Standard Z49.1, is available as a free download from the American Welding Society at <http://www.aws.org> or purchased from Global Engineering Documents (phone: 1-877-413-5184, website: www.global.ihs.com).

Safe Practices for the Preparation of Containers and Piping for Welding and Cutting, American Welding Society Standard AWS F4.1, from Global Engineering Documents (phone: 1-877-413-5184, website: www.global.ihs.com).

Safe Practices for Welding and Cutting Containers that have Held Combustibles, American Welding Society Standard AWS A6.0, from Global Engineering Documents (phone: 1-877-413-5184, website: www.global.ihs.com).

National Electrical Code, NFPA Standard 70, from National Fire Protection Association, Quincy, MA 02269 (phone: 1-800-344-3555, website: www.nfpa.org and www.sparky.org).

Safe Handling of Compressed Gases in Cylinders, CGA Pamphlet P-1, from Compressed Gas Association, 14501 George Carter Way, Suite 103, Chantilly, VA 20151 (phone: 703-788-2700, website: www.cganet.com).

Safety in Welding, Cutting, and Allied Processes, CSA Standard W117.2, from Canadian Standards Association, Standards Sales, 5060 Spectrum Way, Suite 100, Mississauga, Ontario, Canada L4W 5N5 (phone: 800-463-6727, website: www.csagroup.org).

Battery Chargers, CSA Standard C22.2 NO 107.2-01, from Canadian Standards Association, Standards Sales, 5060 Spectrum Way, Suite 100, Mississauga, Ontario, Canada L4W 5N5 (phone: 800-463-6727, website: www.csagroup.org).

Safe Practice For Occupational And Educational Eye And Face Protection, ANSI Standard Z87.1, from American National Standards Institute, 25 West 43rd Street, New York, NY 10036 (phone: 212-642-4900, website: www.ansi.org).

Standard for Fire Prevention During Welding, Cutting, and Other Hot Work, NFPA Standard 51B, from National Fire Protection Association, Quincy, MA 02269 (phone: 1-800-344-3555, website: www.nfpa.org).

OSHA, Occupational Safety and Health Standards for General Industry, Title 29, Code of Federal Regulations (CFR), Part 1910, Subpart Q, and Part 1926, Subpart J, from U.S. Government Printing Office, Superintendent of Documents, P.O. Box 371954, Pittsburgh, PA 15250-7954 (phone: 1-866-512-1800) (there are 10 OSHA Regional Offices—phone for Region 5, Chicago, is 312-353-2220, website: www.osha.gov).

Portable Generators Safety Alert, U.S. Consumer Product Safety Commission (CPSC), 4330 East West Highway, Bethesda, MD 20814 (phone: 301-504-7923, website: www.cpsc.gov).

Applications Manual for the Revised NIOSH Lifting Equation, The National Institute for Occupational Safety and Health (NIOSH), 1600 Clifton Rd, Atlanta, GA 30329-4027 (phone: 1-800-232-4636, website: www.cdc.gov/NIOSH).

2-8. Informations relatives aux CEM

Le courant électrique qui traverse tout conducteur génère des champs électromagnétiques (CEM) à certains endroits. Le courant issu d'un soudage à l'arc (et de procédés connexes, y compris le soudage par points, le gougeage, le découpage plasma et les opérations de chauffage par induction) crée un champ électromagnétique (CEM) autour du circuit de soudage. Les champs électromagnétiques produits peuvent causer interférence à certains implants médicaux, p. ex. les stimulateurs cardiaques. Des mesures de protection pour les porteurs d'implants médicaux doivent être prises: par exemple, des restrictions d'accès pour les passants ou une évaluation individuelle des risques pour les soudeurs. Tous les soudeurs doivent appliquer les procédures suivantes pour minimiser l'exposition aux CEM provenant du circuit de soudage:

1. Rassembler les câbles en les torsadant ou en les attachant avec du ruban adhésif ou avec une housse.
2. Ne pas se tenir au milieu des câbles de soudage. Disposer les câbles d'un côté et à distance de l'opérateur.


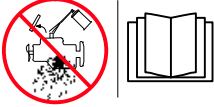

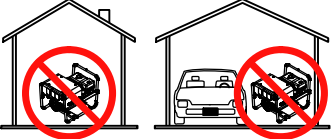
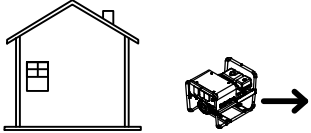
3. Ne pas courber et ne pas entourer les câbles autour de votre corps.
4. Maintenir la tête et le torse aussi loin que possible du matériel du circuit de soudage.
5. Connecter la pince sur la pièce aussi près que possible de la soudure.
6. Ne pas travailler à proximité d'une source de soudage, ni s'asseoir ou se pencher dessus.
7. Ne pas souder tout en portant la source de soudage ou le dévidoir.

En ce qui concerne les implants médicaux :

Les porteurs d'implants doivent d'abord consulter leur médecin avant de s'approcher des opérations de soudage à l'arc, de soudage par points, de gougeage, du découpage plasma ou de chauffage par induction. Si le médecin approuve, il est recommandé de suivre les procédures précédentes.

SECTION 3 – DEFINITIONS








3-1. Additional Safety Symbol Definition

	<p>Warning! Watch Out! There are possible hazards as shown by the symbols.</p> <p style="text-align: right;">Safe1 2012-05</p>
	<p>Do not use ether or other starting fluids. Using starting fluids voids warranty. See engine Owner's Manual.</p> <p style="text-align: right;">Safe89 2017-04</p>
	<p>Moving parts can injure.</p> <p style="text-align: right;">Safe100 2012-08</p>
	<p>Never use generator inside a home or garage, even if doors and windows are open.</p> <p style="text-align: right;">Safe87 2012-07</p>
	<p>Only use generator outside and far away from windows, doors, and vents.</p> <p style="text-align: right;">Safe88 2012-07</p>

3-2. Miscellaneous Symbol Definitions

A	Amperage
V	Voltage
Hz	Hertz
X	Duty Cycle
h	Hours
s	Seconds
U₀	Rated No-Load Voltage (OCV)
U₂	Conventional Load Voltage
I₂	Rated Welding Current

—	Negative
+	Positive
≡	Direct Current (DC)
~	Alternating Current (AC)
⊥	Protective Earth (Ground)
⊔	Circuit Breaker Supplementary Protector
⊙	Output
📖	Read Operator's Manual

	Shielded Metal Arc Welding (SMAW)
	Gas Metal Arc Welding (GMAW)
	Flux Cored Arc Welding (FCAW)
	Gas Tungsten Arc Welding (GTAW) / Tungsten Inert Gas (TIG) Welding
	Touch Start (GTAW)
	Clock, Time Switch
	Engine Oil

SECTION 4 – SPECIFICATIONS

4-1. Serial Number And Rating Label Location

The serial number and rating information for this product is located on the front. Use rating label to determine input power requirements and/or rated output. For future reference, write serial number in space provided on back cover of this manual.

4-2. Weld, Power, and Engine Specifications

☞ This equipment will deliver rated output at an ambient air temperature up to 104 °F (40 °C).

Welding Mode	Rated Welding Output	Maximum Open-Circuit Voltage	Weld Output Range	Generator Power Rating	Fuel Capacity	Engine
CC/DC	325 A, 33 V, 100% Duty Cycle	100	10 – 325 A	Continuous: 10.5 kVA/ kW, 88/44 A, 120/240 V AC, 60 Hz, Single-Phase, Peak: 12 kVA/kW	12 gal (45 L) Tank	Kubota D902 Water-Cooled, Three-Cylinder, Four-Cycle, 24.8 HP Diesel Engine
CV/DC	325 A, 33 V, 100% Duty Cycle	100	13 – 35 V, 10–325 A			


4-3. Environmental Specifications

A. Temperature Specifications



Operating Temperature Range*	Storage/Transportation Temperature Range
–20 to 104°F (–29 to 40°C)	–40 to 131°F (–40 to 55°C)
*Output is derated at temperatures above 104°F (40°C).	Temp_2016-07

Notes


4-4. Dimensions, Weights, And Operating Angles

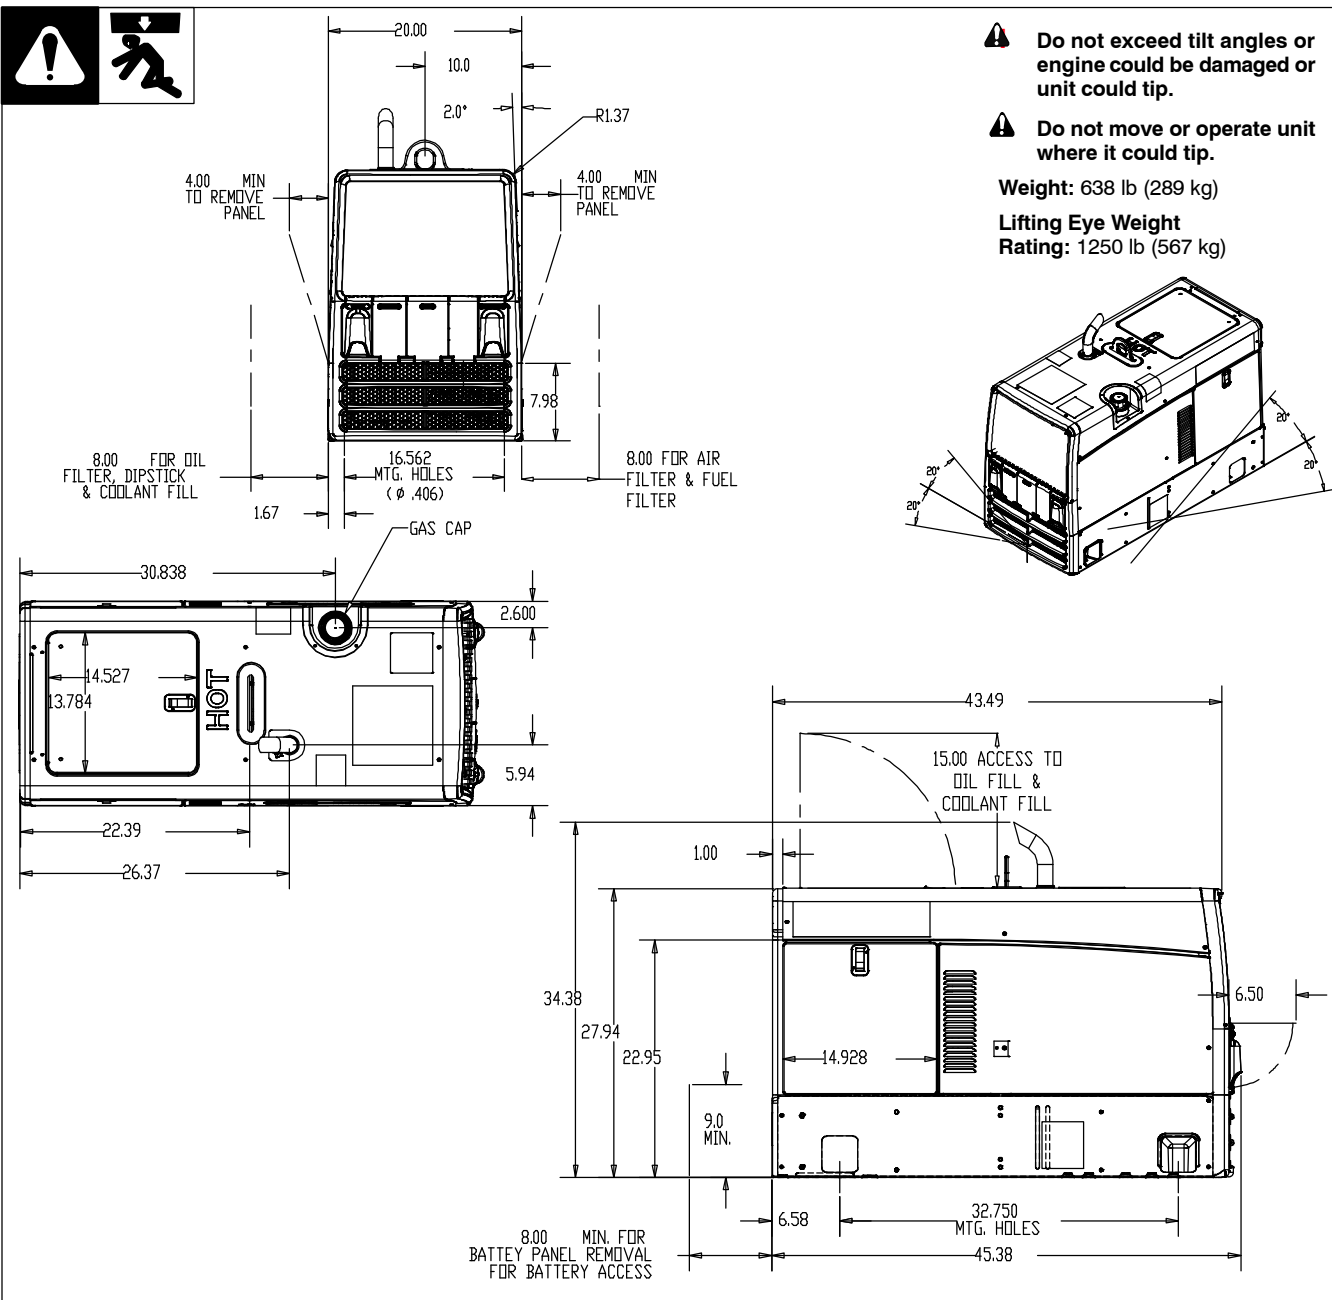

Support Assembly Dimensions

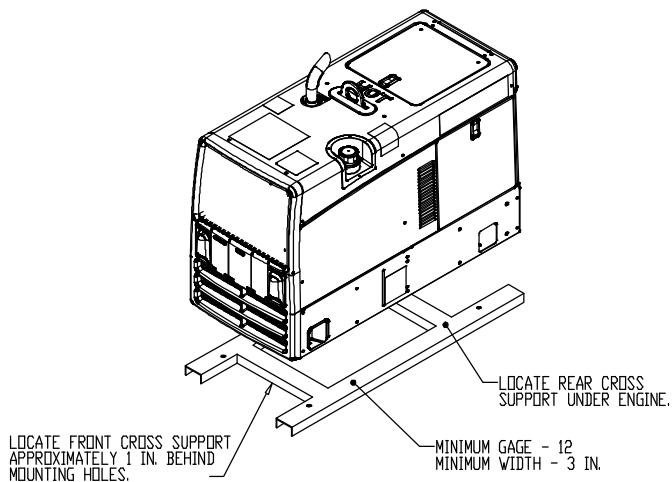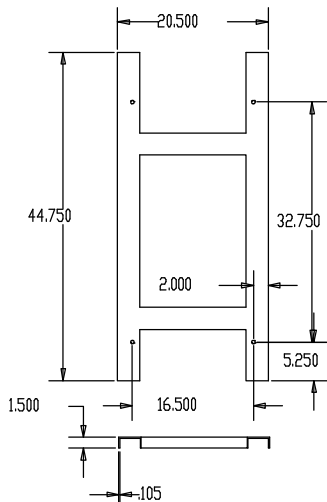

4-5. Duty Cycle

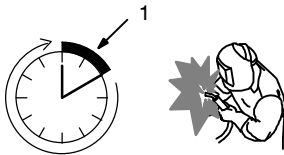


1 100% Duty Cycle

Duty cycle is the percentage of 10 minutes that unit can weld at rated load without overheating.

This unit is rated at 325 amperes DC for continuous welding.

NOTICE – Exceeding duty cycle can damage unit and void warranty.

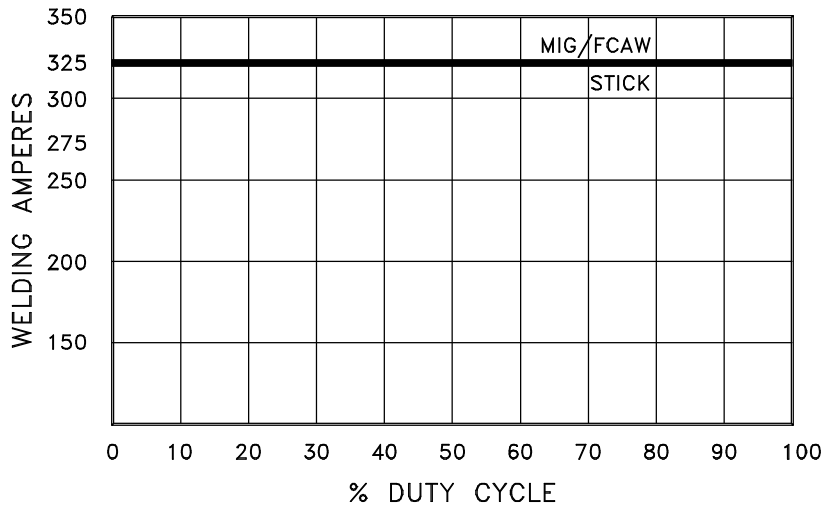

260 048-A

4-6. Static Output Characteristics

The static output characteristics (voltage with respect to amperage) of the welding power source can be described as *flat* during the GMAW process and *drooping* during the SMAW and GTAW processes. Static characteristics are also affected by control settings (including software), electrode, shielding gas, weldment material, and other factors. Contact the factory for specific information on the static characteristics of the welder/generator.

Miller recommends

It's the tie that binds



Finding the right filler metal solution for your welding needs is critical in an industry that is about getting the job done right. Filler metals are more than just a component of welding — they are **the tie that binds science and people**. The right solutions. Solutions to make our world more secure. More dynamic. More of what you need.

Every day, every project, every weld is another opportunity for Hobart to earn and secure your trust by helping you find the right filler metal solution.

That kind of help and finding your welding solutions is our passion.

Visit HobartBrothers.com for more information.



SCIENCE + PEOPLE

Find Your Solution. Today.

4-7. Fuel Consumption Curves



On a typical job using 1/8 in 7018 electrodes (125 amps, 20% duty cycle), expect about 24 hours of operation.

Welding at 150 amps at 40% duty cycle uses approximately 1/2 gallon per hour, or about 22 hours of operation.

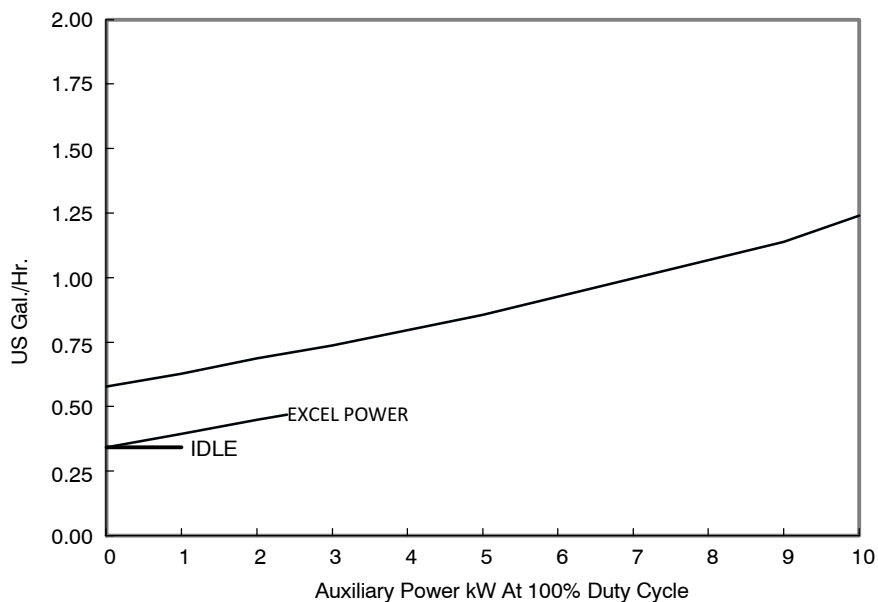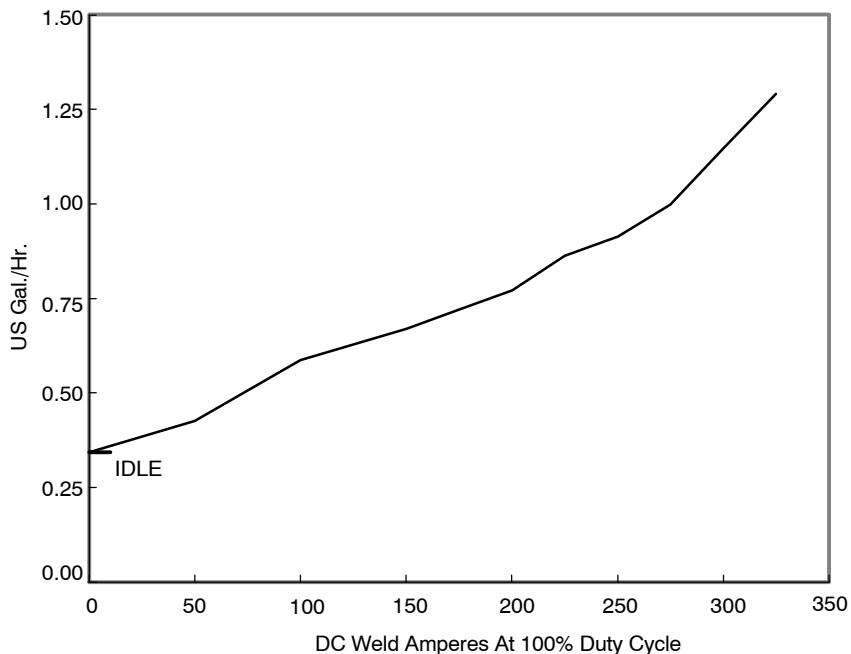


4-8. Stick Volt-Ampere Curves

The volt-ampere curves show the minimum and maximum voltage and amperage output capabilities of the welding generator.

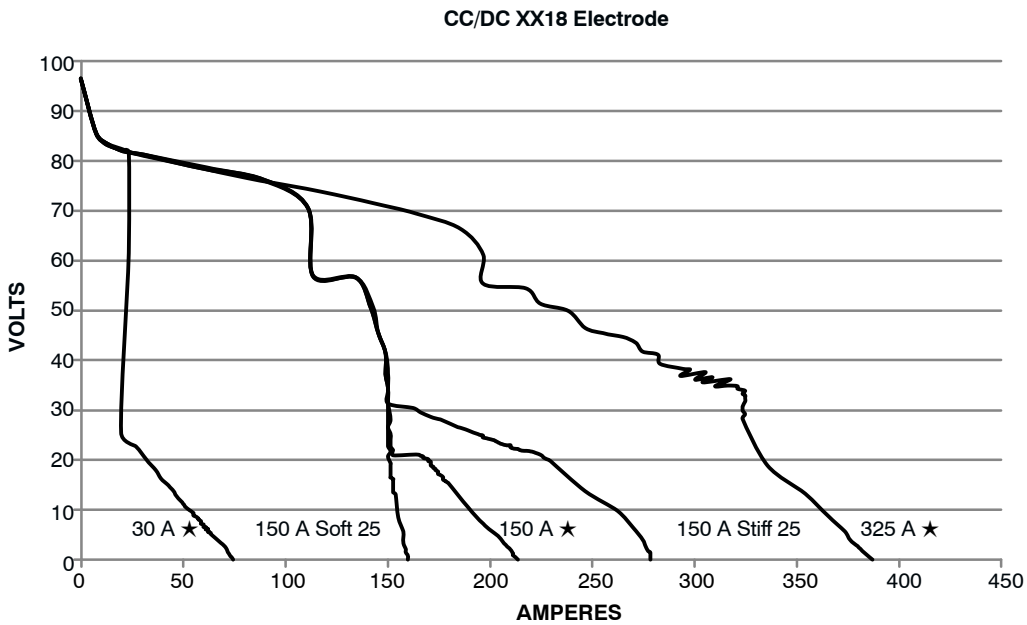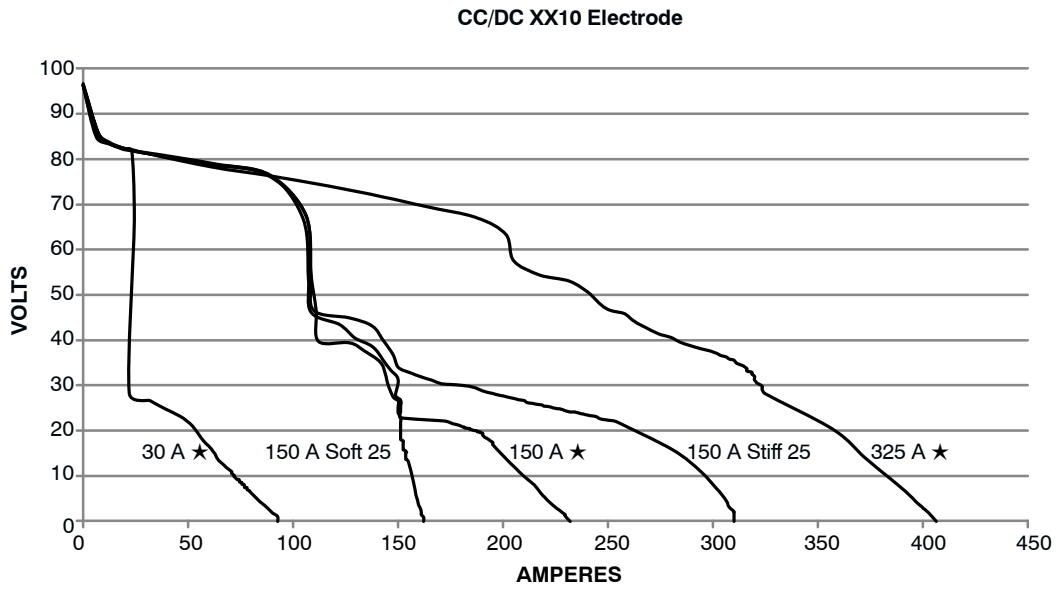

4-9. MIG Volt-Ampere Curves


The volt-ampere curves show the minimum and maximum voltage and amperage output capabilities of the welder/generator.

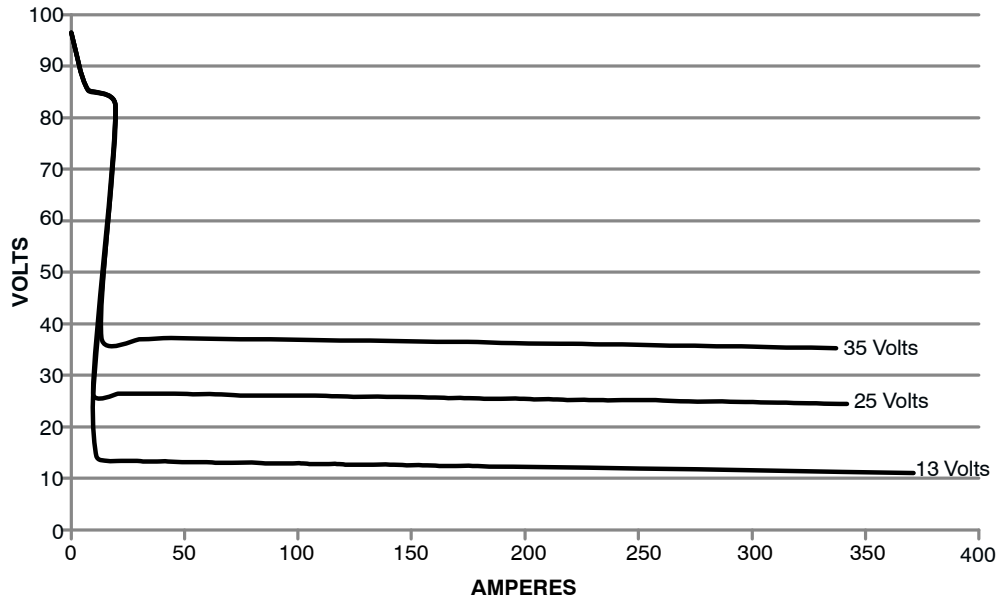

257 137

4-10. TIG Volt-Ampere Curves

The volt-ampere curves show the minimum and maximum voltage and amperage output capabilities of the welder/generator.

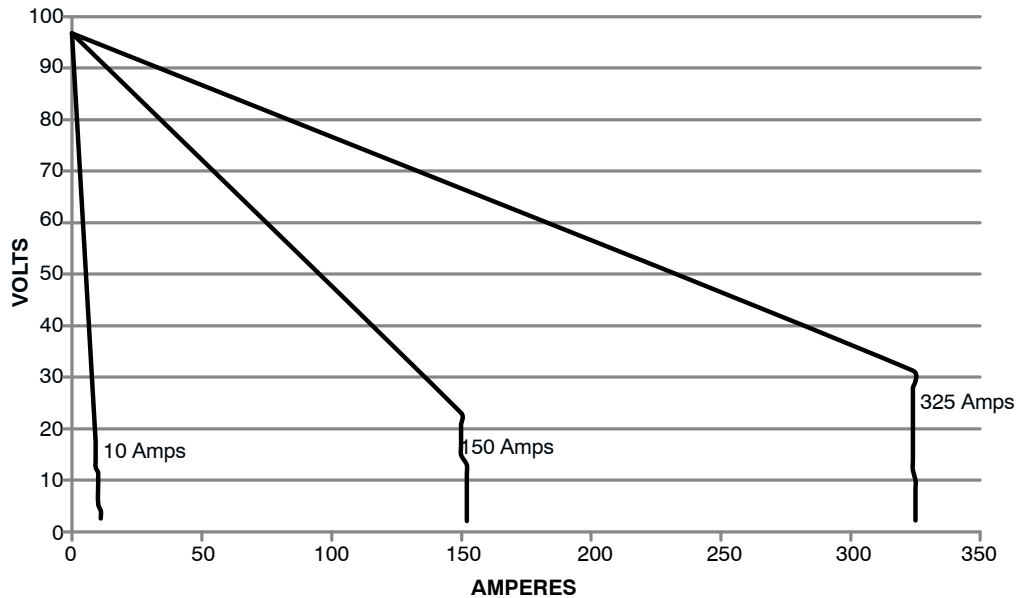


257 137

SECTION 5 – INSTALLATION


5-1. Installing Welder/Generator



Movement

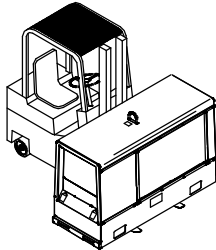

OR

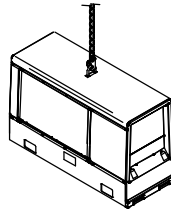


- Do not move or operate unit where it could tip.
- Do not lift unit from end.
- Do not weld on base. Welding on base can cause fuel tank fire or explosion. Bolt unit down using holes provided in base.
- Always securely fasten welder/generator onto transport vehicle or trailer and comply with all DOT and other applicable codes.


NOTICE – Do not install unit where air flow is restricted or engine may over-heat.

See Section 4-4 for lifting eye rating.




Location / Airflow Clearance

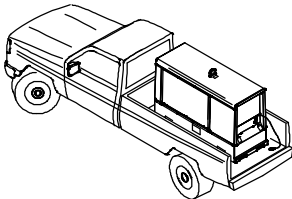

OR

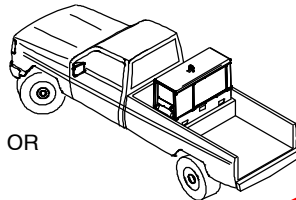

OR

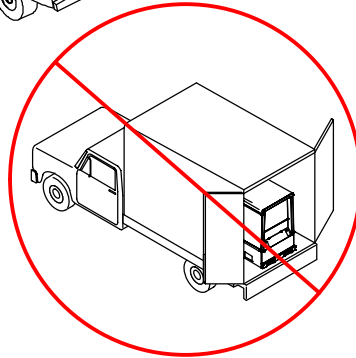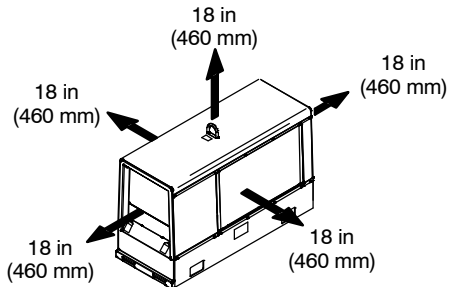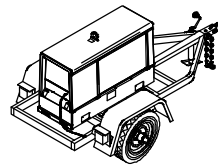

Mounting:



- Do not mount unit by supporting the base only at the four mounting holes. Do not use flexible mounts. Use cross-supports to adequately support unit and prevent damage to base.

1 Cross-Supports


Mount unit on flat surface or use cross-supports to support base.

Go to MillerWelds.com for more information on truck installations.

Mounting

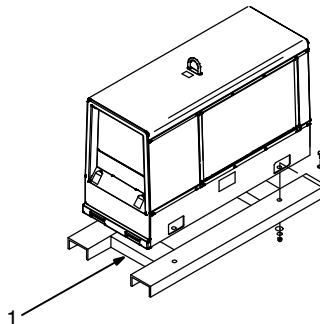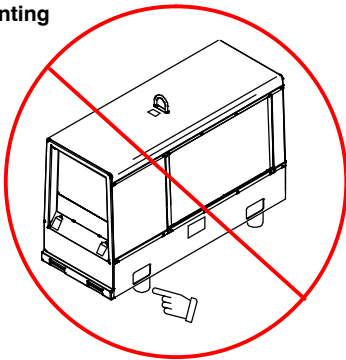

5-2. Grounding Generator To Truck Or Trailer Frame

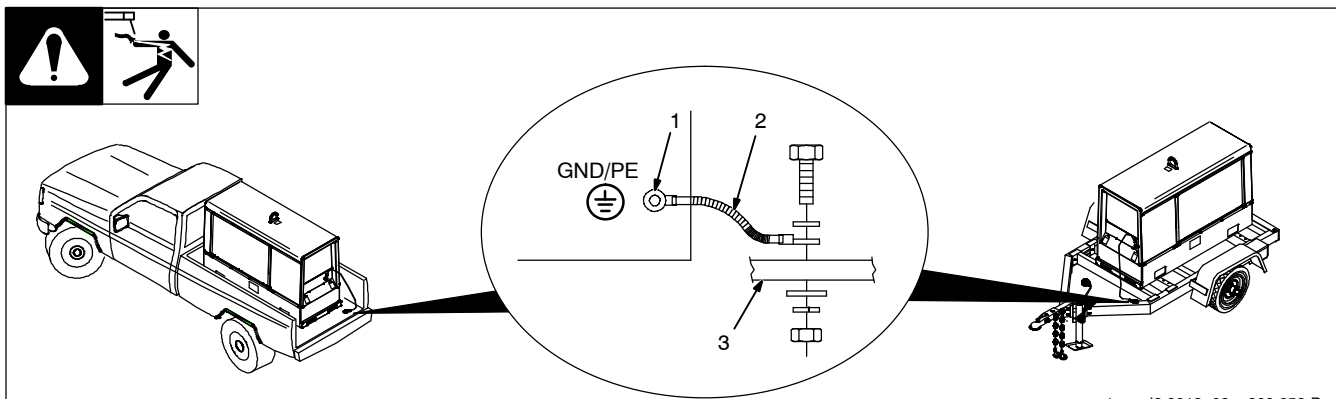

rot_grnd2 2012-03 - 800 652-D

⚠ Always ground generator frame to vehicle frame to prevent electric shock and static electricity hazards.

⚠ Also see AWS Safety & Health Fact Sheet No. 29, Grounding of Portable And Vehicle Mounted Welding Generators.

⚠ Bed liners, shipping skids, and some running gear insulate the welder/generator from the vehicle

frame. Always connect a ground wire from the generator equipment grounding terminal to bare metal on the vehicle frame as shown.

⚠ Use GFCI protection when operating auxiliary equipment. If unit does not have GFCI receptacles, use GFCI-protected extension cord. Do not use GFCI receptacles to power life support equipment.

- 1 Equipment Grounding Terminal (On Front Panel)
- 2 Grounding Cable (Not Supplied)
- 3 Metal Vehicle Frame

Connect cable from equipment ground terminal to metal vehicle frame. Use #8 AWG or larger insulated copper wire.




⚠ Electrically bond generator frame to vehicle frame by metal-to-metal contact.

5-3. Installing Exhaust Pipe



Tools Needed:

9/16 in. Or 14 mm

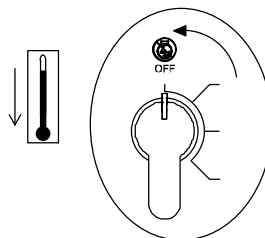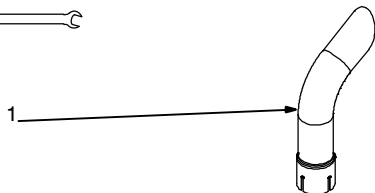


⚠ Stop engine and let cool.

⚠ Do not blow exhaust toward right side of unit where air inlet is or air cleaner may need to be replaced more often. Point exhaust pipe in desired direction but always away from front panel and direction of travel.


- 1 Exhaust Pipe
- 2 Exhaust Pipe Clamp

Slide clamp over muffler pipe. Slide exhaust pipe onto muffler pipe and rotate exhaust pipe to desired position. Secure exhaust pipe with clamp.

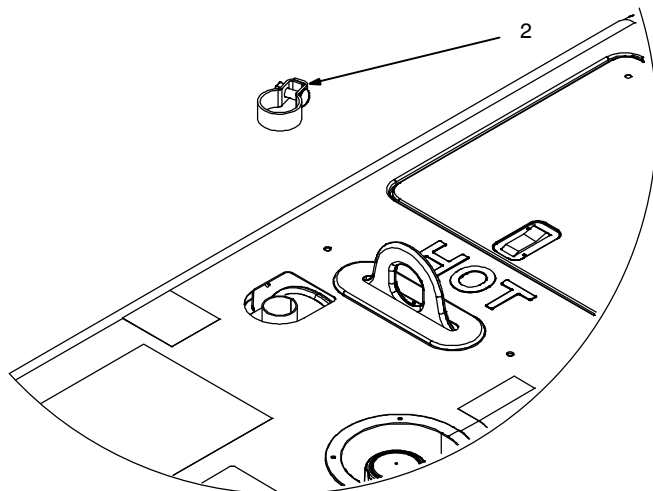



259 703

5-5. Overview And Engine Prestart Checks

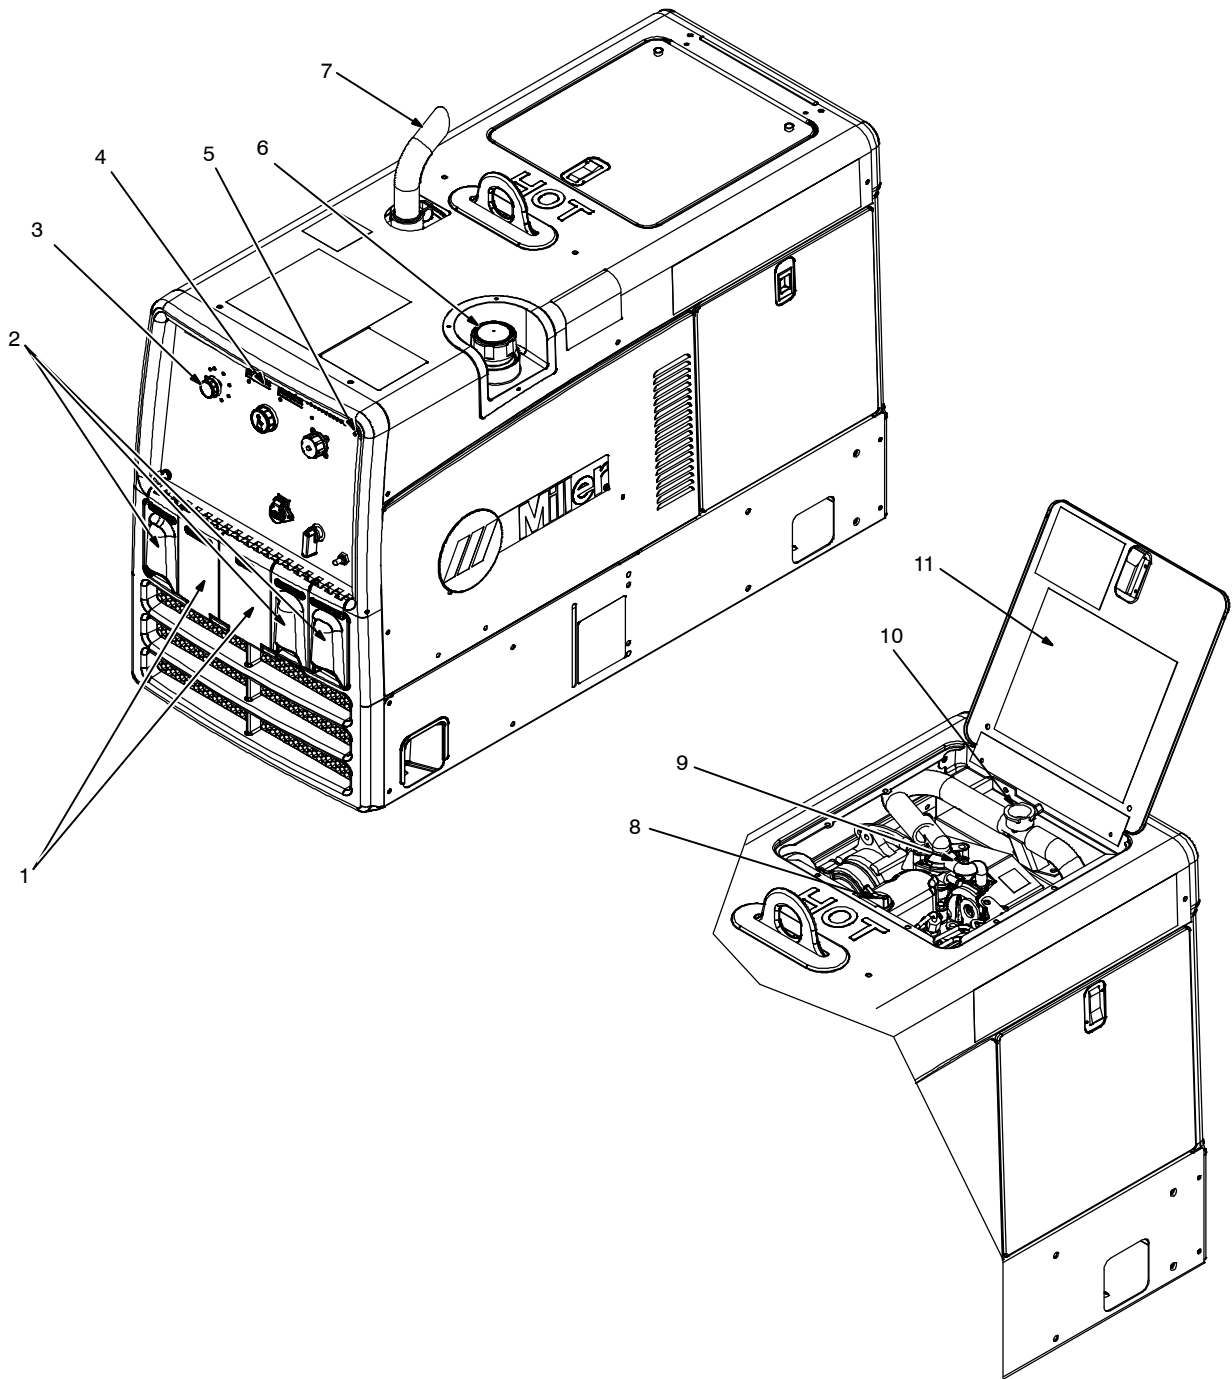

- | | | |
|-------------------------------------------------|-----------------------------|----------------------------|
| 1 Generator Power Receptacles (see Section 7-1) | 7 Exhaust Pipe | 13 Coolant Overflow Bottle |
| 2 Weld Output Terminals (see Section 5-6) | 8 Oil Fill Cap | 14 Oil Filter |
| 3 Operator Controls (see Section 6) | 9 Water Bypass Hose | 15 Oil Dipstick |
| 4 Voltmeter And Ammeter Displays | 10 Radiator Cap | 16 Air Filter |
| 5 Fuel Level Indicators | 11 Engine Maintenance Label | 17 Inline Fuel Filter |
| 6 Fuel Filler Cap | 12 Oil Drain Location | 18 Fuel Filter |

Engine Left Side

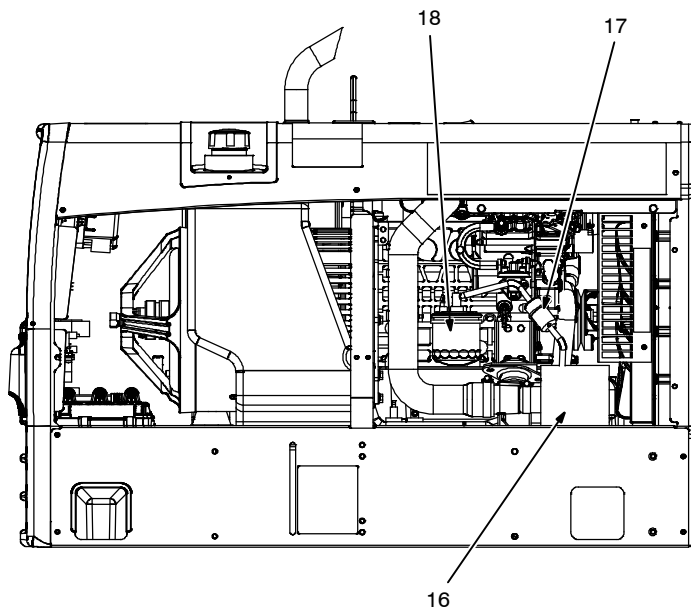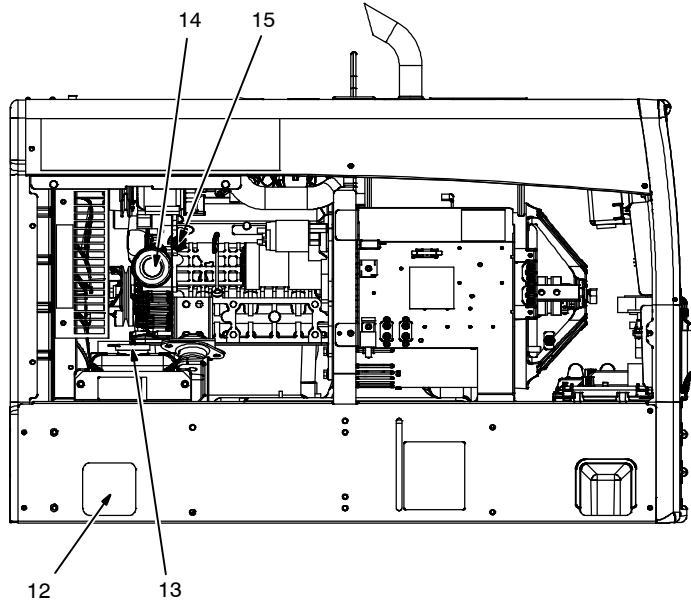

Engine Right Side

⚠ Engine shown with doors removed. Doors must be in place when engine is running.

Engine must be cold and on a level surface. See maintenance label (Section 8-2) for fluid specifications.

Starting engine for the first time:

Add fresh fuel to bottom of filler neck.

If coolant level is not visible in the filler tee, add coolant to overflow bottle.

Daily pre-start checks:

Add fresh fuel to bottom of filler neck.

Check oil. If oil is not up to full mark on dipstick, add oil. Unit is shipped with 10W30 engine oil.

Check coolant level in overflow bottle. If coolant is below Low level, add coolant until level in tank is between Low and Full levels. If overflow bottle coolant level was low, check coolant level in radiator (see Section 8-2).

Engine damage can result from:

- Low oil level
- High engine temperature
- Incorrect coolant mixture
- Running out of fuel (air in fuel lines)
- Using gasoline
- Using ether or other starting fluids to start engine

Engine stops if oil pressure is low, engine coolant temperature is high, or fuel level is low. Some conditions may cause engine damage before the engine shuts down.

Oil: Check oil level often and do not use the oil pressure shutdown system to monitor oil level.

Engine Temperature: Incorrect engine temperature can damage engine. Do not run engine without a properly working thermostat and radiator cap.

Keep radiator and air intake clean.

Coolant: A solution of 50% ethylene glycol base antifreeze and 50% water must be used in this engine. Do not use 100% antifreeze or severe damage will occur.

Fuel: Engine will shut down if fuel level is low. Air in the fuel system causes starting problems.

Do not use gasoline. Using ether or other starting fluids voids warranty.




☞ To improve cold weather starting:

Keep battery in good condition. Store battery in warm area.

Use fuel formulated for cold weather (diesel fuel can gel in cold weather). Contact local fuel supplier for fuel information.

Use correct grade oil for cold weather.

5-6. Weld Output Terminals

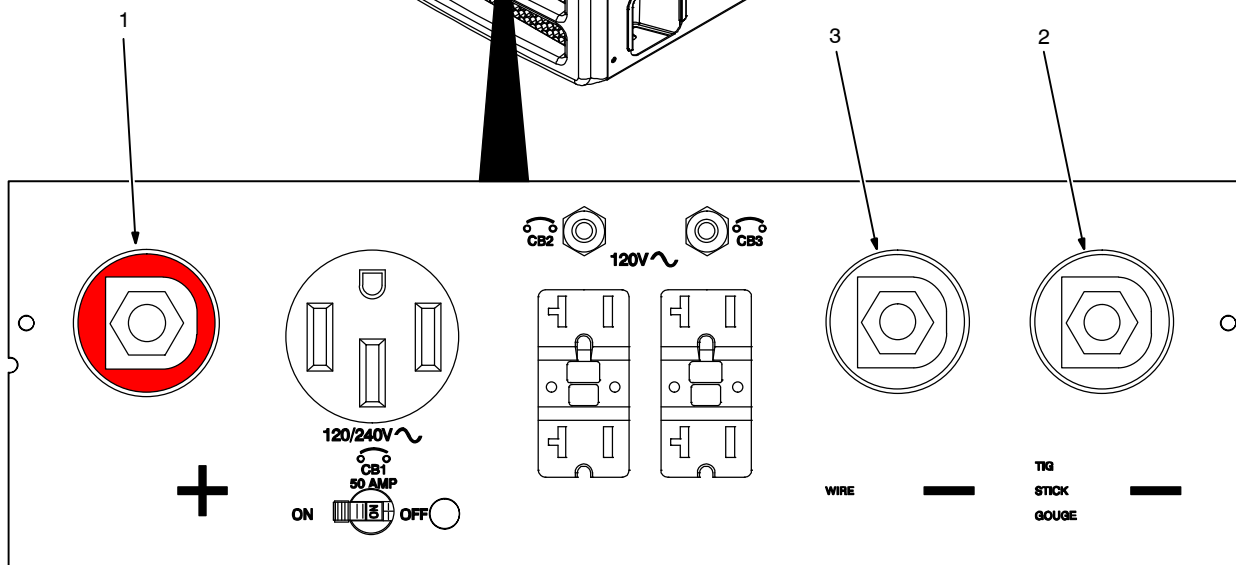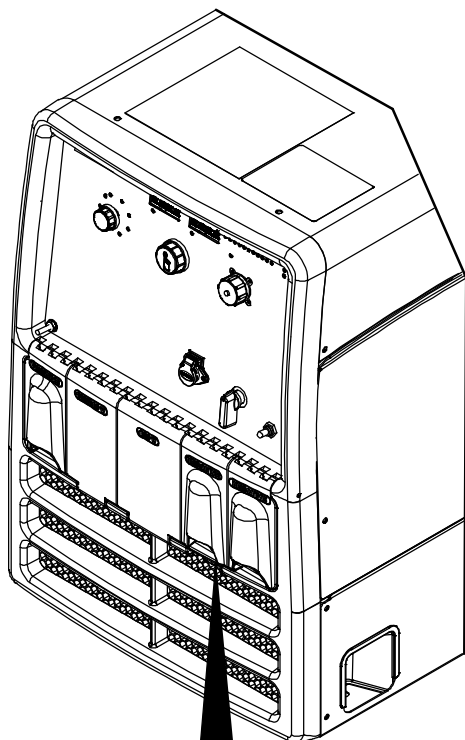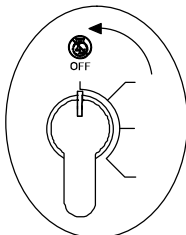

- Stop engine.**
- Turn off power before connecting to weld output terminals.**
- Do not use worn, damaged, undersized, or repaired cables.**

- 1 Positive (+) Weld Output Terminal
- 2 Stick/TIG/Gouge Negative (-) Weld Output Terminal
- 3 Wire Negative (-) Weld Output Terminal

For MIG welding, connect work cable to Negative (-) terminal and wire feeder cable to Positive (+) terminal.

For Stick welding, connect work cable to Negative (-) terminal and electrode holder cable to Positive (+) terminal.

For TIG welding, connect work cable to Positive (+) terminal and electrode holder cable to Negative (-) terminal.

5-7. Selecting Cable Sizes*

NOTICE – The Total Cable Length in Weld Circuit (see table below) is the combined length of both weld cables. For example, if the power source is 100 ft (30 m) from the workpiece, the total cable length in the weld circuit is 200 ft (2 cables x 100 ft). Use the 200 ft (60 m) column to determine cable size.

Welding Amperes	Weld Cable Size** and Total Cable (Copper) Length in Weld Circuit Not Exceeding***							
	100 ft (30 m) or Less		150 ft (45 m)	200 ft (60 m)	250 ft (70 m)	300 ft (90 m)	350 ft (105 m)	400 ft (120 m)
	10 – 60% Duty Cycle AWG (mm ²)	60 – 100% Duty Cycle AWG (mm ²)	10 – 100% Duty Cycle AWG (mm ²)					
100	4 (20)	4 (20)	4 (20)	3 (30)	2 (35)	1 (50)	1/0 (60)	1/0 (60)
150	3 (30)	3 (30)	2 (35)	1 (50)	1/0 (60)	2/0 (70)	3/0 (95)	3/0 (95)
200	3 (30)	2 (35)	1 (50)	1/0 (60)	2/0 (70)	3/0 (95)	4/0 (120)	4/0 (120)
250	2 (35)	1 (50)	1/0 (60)	2/0 (70)	3/0 (95)	4/0 (120)	2x2/0 (2x70)	2x2/0 (2x70)
300	1 (50)	1/0 (60)	2/0 (70)	3/0 (95)	4/0 (120)	2x2/0 (2x70)	2x3/0 (2x95)	2x3/0 (2x95)
350	1/0 (60)	2/0 (70)	3/0 (95)	4/0 (120)	2x2/0 (2x70)	2x3/0 (2x95)	2x3/0 (2x95)	2x4/0 (2x120)
400	1/0 (60)	2/0 (70)	3/0 (95)	4/0 (120)	2x2/0 (2x70)	2x3/0 (2x95)	2x4/0 (2x120)	2x4/0 (2x120)


* This chart is a general guideline and may not suit all applications. If cable overheats, use next size larger cable.


**Weld cable size (AWG) is based on either a 4 volts or less drop or a current density of at least 300 circular mils per ampere. () = mm² for metric use

***For distances longer than those shown in this guide, call a factory applications rep. at 920-735-4505 (Miller) or 1-800-332-3281 (Hobart).


Ref. S-0007-L 2015-02

5-8. Connecting To Weld Output Terminals





Tools Needed:
 3/4 in.

1

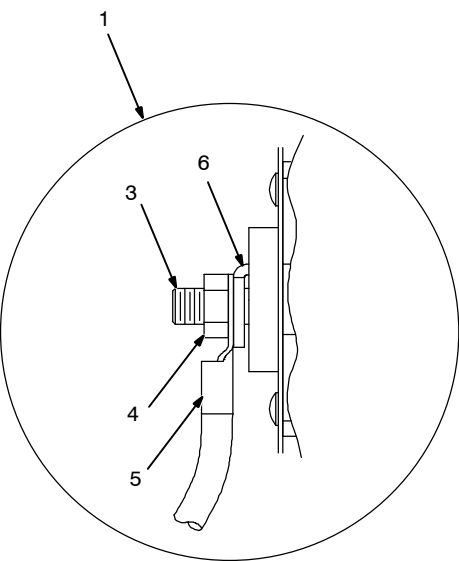

2

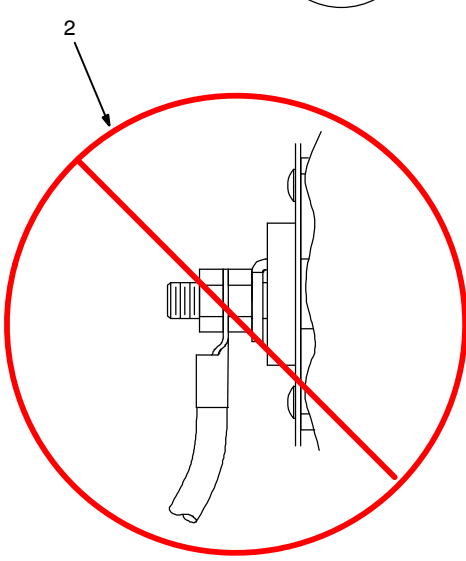

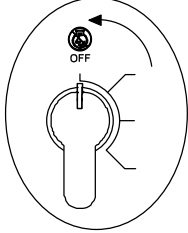

⚠ Stop engine.

⚠ Failure to properly connect weld cables may cause excessive heat and start a fire, or damage your machine.


📄 Do not place anything between weld cable terminal and copper bar. Make sure that the surfaces of the weld cable terminal and copper bar are clean.

- 1 Correct Weld Cable Connection
- 2 Incorrect Weld Cable Connection
- 3 Weld Output Terminal
- 4 Supplied Weld Output Terminal Nut
- 5 Weld Cable Terminal
- 6 Copper Bar

Remove supplied nut from weld output terminal. Slide weld cable terminal onto weld output terminal and secure with nut so that weld cable terminal is tight against copper bar.

803 778-B

5-9. Remote Receptacle Information

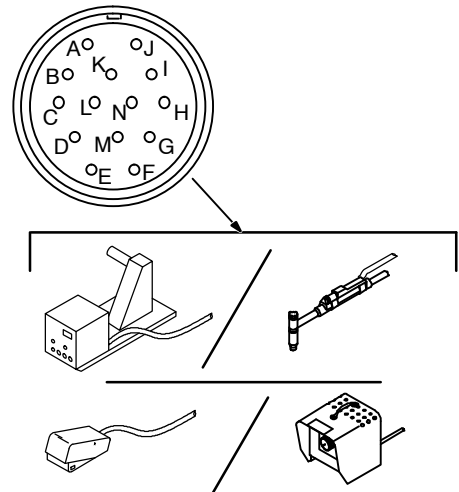 <p>*The remaining sockets are not used.</p>	REMOTE 14	Socket*	Socket Information
	24 VOLTS AC OUTPUT (CONTACTOR)	A	24 volts AC. Protected by supplementary protector CB4.
		B	Contact closure to A completes 24 volt AC contactor control circuit and keeps engine at Run speed in all Wire modes.
	REMOTE OUTPUT CONTROL	C	+10 volts DC output to remote control.
		D	Remote control circuit common.
		E	0 to +10 volts DC input command signal from remote control.
	A/V AMPERAGE VOLTAGE	F	Current feedback: 1 volt per 100 amperes.
H		Voltage feedback: 1 volt per 10 arc volts.	
GND	G	Circuit common for 24 volts AC circuits.	
	K	Chassis common.	


Notes

SECTION 6 – OPERATING WELDER/GENERATOR

6-1. Front Panel Controls (See Section 6-2)

MAINTENANCE DISPLAYS

- **ENGINE RPM's:** With engine running and the Process Selector switch in any Stick HOT position, cycle Engine Control switch from the AUTO-SPEED to RUN position 3 times and meters will display Engine RPM's. Use to check and set both idle and run speed RPM's. Accuracy is ± 16 RPM's. Turn machine off to reset display.

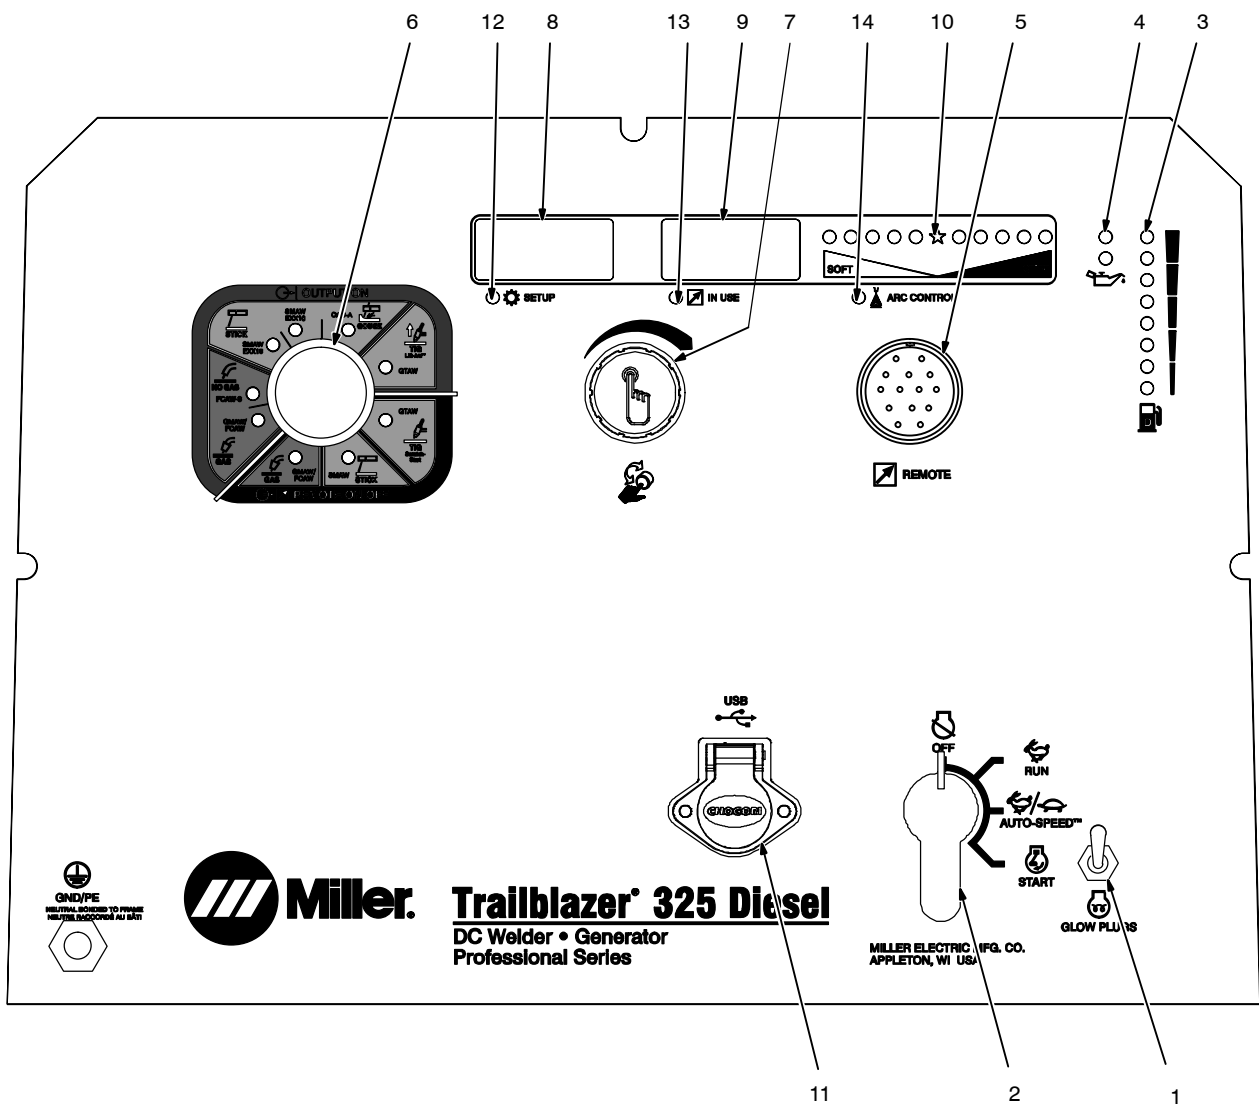

6-2. Description Of Front Panel Controls (See Section 6-1)



Engine Starting Controls

1 Preheat Switch

Use switch to energize starting aid for cold weather starting (see starting instructions following).

2 Engine Control Switch

Use switch to start engine, select engine speed, and stop engine.

In Run position, engine runs at weld/power speed. In Auto-Speed position, engine runs at idle speed at no load and weld speed with load applied.

To check engine hours when engine is not running, turn Engine Control switch to Run position. To check remaining oil change hours when engine is not running, turn Engine Control switch to Auto-Speed position.

For best performance when welding above 300 amperes, place Engine Control switch in Run position.

NOTICE – Diesel engines in Miller equipment are meant to operate optimally at moderate to rated load. Using light or no load for extended periods of time may cause wetstacking or engine damage.

To Start:

NOTICE – Do not use ether or other starting fluids. Using starting fluids voids warranty.

If engine does not start, let engine come to a complete stop before attempting re-start.

Above 32°F (0°C): turn Engine Control switch to Start. Release Engine Control switch when engine starts.

Below 32°F (0°C): turn engine control switch to Run position. Push Preheat switch up for 6 seconds. Turn Engine Control switch to Start. Release Engine Control switch and Preheat switch when engine starts.

Do not operate Preheat switch for more than 20 seconds at a time.

To Stop: turn Engine Control switch to Off position.

Engine Gauges, Meters, And Lights

See Section 6-12 for complete fuel, hour, and engine shutdown information.

3 Fuel Gauge

Use gauge to check fuel level.

4 Engine Service Indicator Lights

Notifies user that engine oil service is due. Upper LED illuminates when engine oil change hours are between 49–1. Lower LED illuminates when oil change hours are 0 or less.

Weld Controls

5 Remote Control Receptacle

Use receptacle to connect remote controls, wire feeders, and tools requiring 24 VAC.

When a remote control is connected to the Remote receptacle, the Auto Remote Sense (ARS) feature automatically switches voltage/amperage control to the remote control (see Section 6-9).

With remote control connected, weld output is determined by a combination of front panel and remote control voltage/amperage settings.

If no remote control is connected to the Remote receptacle, the front panel Voltage/Amperage control adjusts voltage and amperage.

If a remote device connected to Remote Receptacle is faulty or is disconnected during operation, the meters display CHEK REMT (see Section 8-6). Clear fault by stopping and restarting the unit or by turning Process/Contactor switch to another position.

6 Process/Contactor Switch

See Section 6-4 for Process/Contactor switch information.

7 Adjust Control/Select Button

Adjust Control

With Process/Contactor Switch in any SMAW or GTAW process, turn Adjust control to adjust preset amperage. With Process/Contactor switch in any FCAW or GMAW process, turn Adjust control to adjust preset voltage.

Select Button

Push the control to use as Select button.

To access Arc Control setting, push and hold Adjust control for 1 second, then release. Rotate counterclockwise to set softer arc control. Rotate clockwise to set stiffer arc control. Push Adjust control in and release to save Arc Control setting. Arc Control setting will time out after 5 seconds of inactivity.

To access Service Menu, push and hold Adjust control for 5 seconds, then release. See Section 6-5 for Service Menu operation. Service Menu will time out after 5 seconds of inactivity.

Weld Meters

Weld meters also work in combination to display troubleshooting error codes (see Section 8-6).

8 DC Voltmeter

Voltmeter displays preset voltage (GMAW/FCAW welding) with contactor off, and actual output voltage with the contactor on. Voltmeter displays voltage at the weld output terminals, but not necessarily the welding arc due to resistance of cable and connections.

To set voltage, turn Process/Contactor switch to GMAW or FCAW position. Turn V/A control until desired voltage is displayed on Voltmeter. When welding is finished, voltmeter displays average weld voltage and then defaults to preset voltage.

9 DC Ammeter

Ammeter displays preset amperage (Stick and TIG only) when not welding, and actual output amperage when welding.

To set amperage, turn Process/Contactor switch to Stick or TIG position. Turn V/A control until desired amperage is displayed on Ammeter. When welding is finished, ammeter displays average weld amperage and then defaults to preset amperage.

10 Arc Control Meter

Displays current Arc Control setting. Default value for all processes is 0. Arc Control settings adjust: DIG for SMAW processes, Auto Stop for GTAW processes, and inductance for FCAW and GMAW processes. For softer settings, the LEDs to the left of the star illuminate. For stiffer settings, the LEDs to the right of the star illuminate. No Arc Control settings are accessible for GTAW Remote and CAC-A processes. See Section 6-6.

Other Receptacles

11 USB Receptacle

Allows software updates from a USB drive (see Section 6-10). A summary file of recorded data from the unit will be saved to a USB drive that is inserted (see Section 6-11).

Indicator Lights

12 Setup Light

Illuminates when in the Service Menu.

13 In Use Light

Illuminates when connected to an ArcReach accessory.

14 Arc Control Light

Illuminates when in the Arc Control settings.

Glow Plug Time	
Above 68°F (20°C)	0 seconds
68 to 32°F (20 to 0°C)	5 seconds
Below 32°F (0°C)	10 seconds
<p>Do not use glow plugs longer than 20 seconds. Do not use ether or other starting fluids to start engine. Using starting fluids voids warranty.</p>	

6-3. Process/Contactor Switch

1 Process/Contactor Switch

⚠ Weld output terminals are energized when Process/Contactor switch is in an Electrode Hot position and the engine is running.

Use switch to select weld process and weld output on/off control (see table below).

Place switch in Remote On/Off Switch Required positions to turn weld output on and off with a device connected to the Remote receptacle.

Place switch in Electrode Hot positions for weld output to be on whenever the engine is running.

Use the Lift-Arc TIG mode for TIG (GTAW) welding using the Lift-Arc TIG starting procedure (see Section 6-8).

Process/Contactor switch must be set to Output On for ArcReach accessories to bind.

Ref. 277091-A / 280016

	Process/Contactor Switch Setting	Typical Process Applications (DC Only)
OUTPUT ON	Output On – GMAW/FCAW (MIG)	MIG solid wire and dual shield flux core use a voltage sensing (VS) feeder that does not require a control cable back to the welder/generator.
	Output On – FCAW-S (Electrode Negative)	FCAW (Flux Cored Arc Welding – self shielded) uses a voltage sensing (VS) feeder that does not require a control cable back to the welder/generator.
	Output On – SMAW (STICK XX18 and STICK XX10)	Stick welding with or without a remote amperage control. Strike an arc to start welding.
	Output On – GTAW (Lift-Arc TIG)	Lift-Arc TIG: touch tungsten to work and lift to start welding. Uses circuitry internal to the welder/generator to aid arc start. Can be used with or without a remote control. Auto Crater option can be enabled/disabled using the Service Menu (see Section 6-5).
	Output On – CAC-A (Air Carbon Arc Gouging)	Gouging with or without a remote amperage control. Strike an arc to start gouging.
REMOTE ON/OFF REQUIRED	Remote ON/OFF Required - GTAW (Remote TIG)	High Frequency TIG or Scratch Start TIG welding. High frequency TIG starting with remote control allows remote On/Off and Amperage control. Another typical application is a simple TIG rig with a remote control device.
	Remote ON/OFF Required - SMAW (Remote Stick)	Stick welding with RHC-14 control allows remote On/Off and Amperage control. This can help eliminate accidental arc strikes.
	Remote ON/OFF Required - GMAW/FCAW (Remote MIG)	MIG solid wire and dual shield flux core using a constant speed feeder. Use feeders with 14-pin remote voltage control, or use a Spoolmatic 30A with WC24 control.

6-4. Engine Auto Speed



Engine Auto Speed

When Engine Control switch is in Auto Speed position, the engine speed varies depending on the welding load and Process/Contactor switch position.

For Gouge, the engine runs at 3600 rpm and will return to idle about 9 seconds after the arc is broken.

For Stick, based on preset, unit goes to the next highest speed upon arc initiation and transitions down one speed if power is appropriate for load.

For TIG, based on preset, unit goes to speed appropriate for load at arc initiation.

Approximate Amperage/RPM Steps:

0 – 150 A = 2400 RPM
 151 – 210 A = 2800 RPM
 211 – 260 A = 3200 RPM
 261 – 325 A = 3600 RPM

Engine returns to idle about 3 seconds after the arc is broken if running at less than 2800RPM. If running at more than 3200 RPM, return to idle time is about 9 seconds.

For Solid Wire, unit goes to 3200 rpm upon arc initiation and transitions down to appropriate speed for load.


Amperage/RPM Steps and return to idle are the same as Stick/TIG.

For Flux-Core Wire, unit goes to 3600 rpm upon arc initiation and transitions down to appropriate speed for load.

Amperage/RPM Steps and return to idle are the same as Stick/TIG.

Miller recommends Hobart filler metals.

6-5. Service Menu

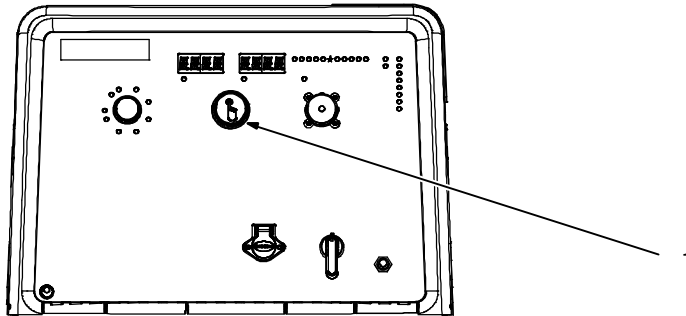

1 Adjust Control/Select Button

Press and hold control for 5 seconds, then release to access the Service Menu. Rotate the knob to scroll through the menu items. Press and release the control to access the options and information within each menu item.

Rotate the control counterclockwise to decrease the value or select NO/OFF. Rotate the control clockwise to increase the value or select YES/ON.

Press and release control to save selection. After 5 seconds of inactivity, the menu will time out and the selection will not be saved.

Ref. 907755





Menu Item	Selectable Item Option(s)	Description
HOT STRT (Only accessible in SMAW processes)	LIMIT OFF	Disables Hot Start option.
	LIMIT 1.25	Sets Hot Start current limit, selectable between 1.25 and 2.0 (0.25 increments) in SMAW XX10 and SMAW Remote.
	LIMIT 1.50	Sets Hot Start current limit, selectable between 1.5 and 3.0 (0.5 increments) in SMAW XX18.
AUTO CRTR (Only accessible in GTAW processes)	ATCR ON	Enables Auto Crater option.
	ATCR OFF	Disables Auto Crater option.
HOUR MTR	--	Displays engine hours.
OIL HOUR	--	Displays remaining oil change hours before service is due.
OIL SET	50 HRS	Sets the starting hours for oil change period. Selectable from 50–1500 hours in 50 hour increments.
OIL RSET	RSET YES	Resets oil change period to selected value. Unit is set to factory recommended period per engine manufacturer.
	RSET NO	Oil change remaining hours do not reset.
VRD	VRD ON	Enables VRD (Voltage Reducing Device) option, lowering open-circuit voltage.
	VRD OFF	Disables VRD (Voltage Reducing Device) option.
SOFT WARE	--	Displays the current revision of firmware installed.
FACT RSET	RSET YES	Resets all settings to factory defaults.
	RSET NO	All settings remain at previous settings.





6-6. Arc Control Settings

Arc Control is not active when the Process/Contactor switch is in the following positions:


- Electrode Hot – CAC-A (Air Carbon Arc Gouging)
- Remote ON/OFF GTAW (Remote TIG)

Miller recommends Hobart filler metals.

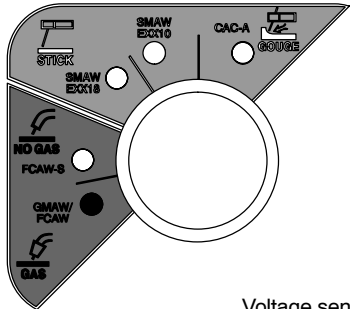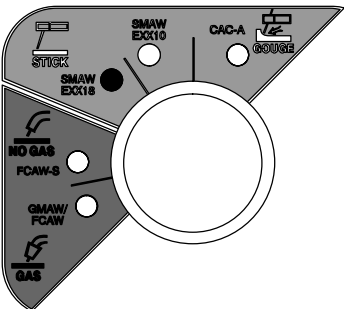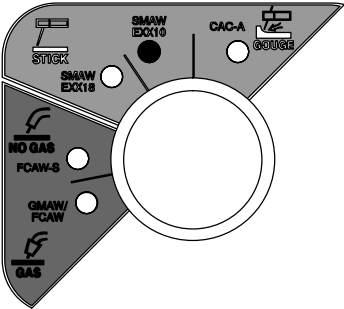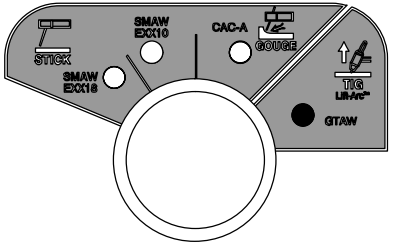Process/Contactor Switch	Arc Control	
 <p>Voltage sensing feeder</p>	<p>SOFT (-25 to -1)</p> <p>★ (0)</p> <p>STIFF (1 to 25)</p>	<p>Starting point for stainless steel wire (high inductance)</p> <p>SOFT -12</p> <p>Starting point for mild steel wire</p> <p>Starting point for aluminum wire (low inductance)</p> <p>STIF 12</p>
	<p>SOFT (-25 to -1)</p> <p>★ (0)</p> <p>STIFF (1 to 25)</p>	<p>Flat or horizontal welds with XX18 electrode with short weld cables</p> <p>Starting point for XX18, XX13, XX14, XX24, and XX22 electrodes</p> <p>Minimizes stickiness with XX18, XX14, XX22, XX24, and XX13 electrodes. Also for pipe welding with XX10 and XX18 electrodes</p>
	<p>SOFT (-25 to -1)</p> <p>★ (0)</p> <p>STIFF (1 to 25)</p>	<p>Softer, more slowly responding arc</p> <p>Starting point for XX10 electrode/open root vertical down joint</p> <p>Stiffer, more rapidly responding arc</p>
	<p>STOP (-5 to -1)</p> <p>★ (0)</p> <p>STOP (1 to 5)</p>	<p>Auto-Crater off (see Section 6-5). More sensitive Auto-Stop</p> <p>Starting point.</p> <p>Less sensitive Auto-Stop</p> <p>Lift-Arc start. No Auto Crater allows full control on pipe welds with short or long arc length. Auto Stop feature allows arc to be broken without loss of shielding gas.</p>

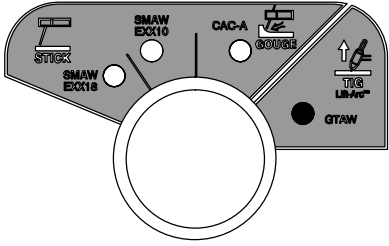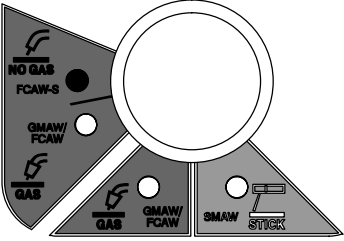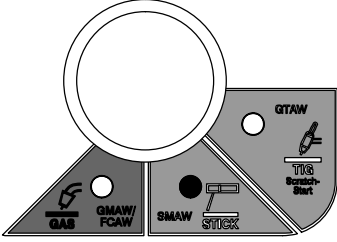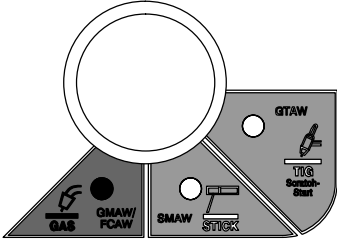Process/Contactor Switch	Arc Control	
	<p>STOP (-5 to -1)</p> <p>★ (0)</p> <p>STOP (1 to 5)</p>	<p>Auto Crater on (see Section 6-5). More sensitive Auto-Crater initiation</p> <p>Starting point</p> <p>Less sensitive Auto-Crater initiation</p>
	<p>SOFT (-25 to -1)</p> <p>★ (0)</p> <p>STIFF (1 to 25)</p>	<p>Starting point</p>
	<p>SOFT (-25 to -1)</p> <p>★ (0)</p> <p>STIFF (1 to 25)</p>	<p>Flat or horizontal welds with XX18 electrode with short weld cables</p> <div style="border: 1px solid black; padding: 2px; display: inline-block; margin-right: 10px;">SOFT</div> <div style="border: 1px solid black; padding: 2px; display: inline-block; margin-right: 10px;">-22</div> <p>Starting point for XX10, XX11, XX13, XX14, XX24, and XX22 electrodes</p>
 <p>Wire feeder connects to Remote receptacle</p>	<p>SOFT (-25 to -1)</p> <p>★ (0)</p> <p>STIFF (1 to 25)</p>	<p>Starting point for stainless steel wire (high inductance)</p> <div style="border: 1px solid black; padding: 2px; display: inline-block; margin-right: 10px;">SOFT</div> <div style="border: 1px solid black; padding: 2px; display: inline-block; margin-right: 10px;">-12</div> <p>Starting point for mild steel wire</p> <p>Starting point for aluminum wire (low inductance).</p> <div style="border: 1px solid black; padding: 2px; display: inline-block; margin-right: 10px;">STIF</div> <div style="border: 1px solid black; padding: 2px; display: inline-block; margin-right: 10px;">12</div> <p>Starting point for dual shield flux core, vertical overhead</p> <div style="border: 1px solid black; padding: 2px; display: inline-block; margin-right: 10px;">STIF</div> <div style="border: 1px solid black; padding: 2px; display: inline-block;">25</div>

6-7. Stick Start Procedure – Scratch Start Technique

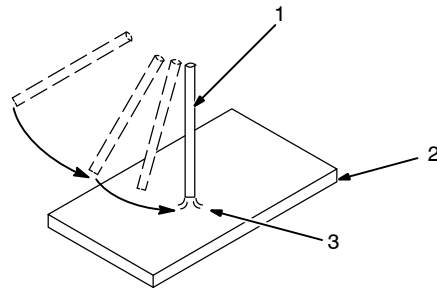

With Stick selected, start arc as follows:

- 1 Electrode
- 2 Workpiece
- 3 Arc


Drag electrode across workpiece like striking a match; lift electrode slightly after touching work. If arc goes out electrode was lifted too high. If electrode sticks to workpiece, use a quick twist to free it.

☞ Miller recommends Hobart filler metals.


6-8. Lift-Arc™ TIG With Auto-Stop™ And Auto-Crater™



Arc Start With Lift-Arc

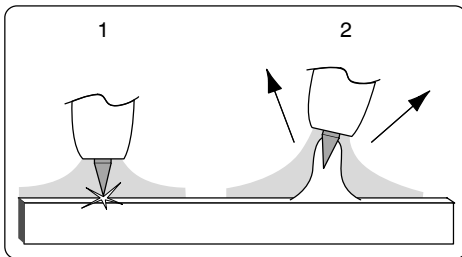


Arc End With Auto-Stop

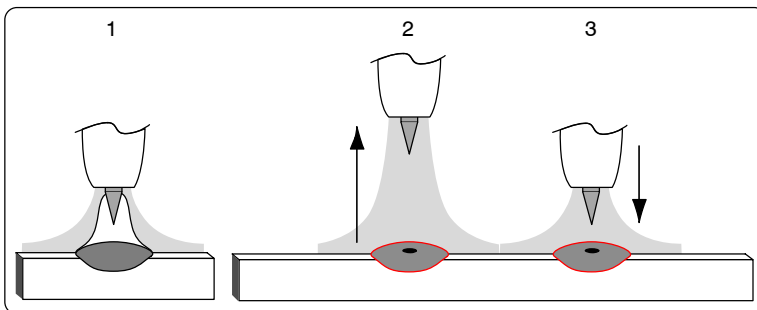

OR

Arc End With Auto-Crater

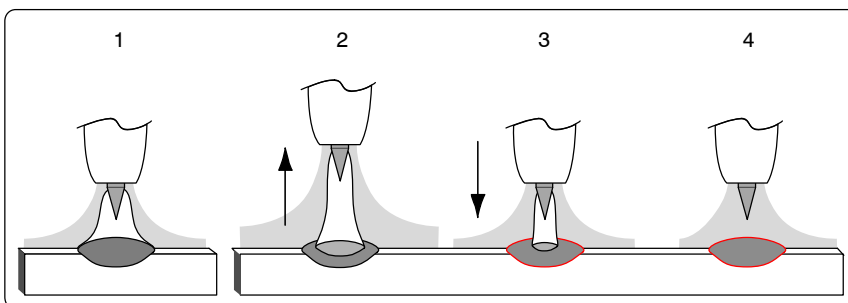

Arc Start With Lift-Arc TIG

Lift-Arc is used for the DCEN GTAW process when HF Start method is not permitted.

Select Lift-Arc at Process/Contact switch.

Turn gas on.

- 1 Touch or scratch.
- 2 Lift at any angle.

Touch tungsten electrode to workpiece at weld start point. Slowly lift electrode. Arc is started when electrode is lifted.

Maintain shielding gas coverage and eliminate tungsten and workpiece contamination by using Auto-Crater or Auto-Stop to end the arc.

☞ See Section 6-5 to adjust Auto-Stop and Auto-Crater.

Arc End With Auto-Stop:

- 1 While welding.
- 2 Lift torch to start Auto-Stop. Arc stops.
- 3 Move torch back down to maintain gas coverage and prevent contamination.

Arc End With Auto-Crater:

☞ Remote control is not needed when using Auto-Crater.

- 1 While welding.
- 2 Lift torch slightly to start Auto-Crater end (current is reduced).
- 3 Lower torch. Weld current ramps down.
- 4 Shielding gas continues until shut off.


☞ Miller recommends Hobart filler metals.

6-9. Remote Voltage/Amperage Control




1 Remote Receptacle RC4
Connect optional remote voltage/ amperage (V/A) control to RC4 (see Section 5-9).

2 Process/Contactor Switch
With remote control connected, weld output in Stick or TIG is determined by a combination of front panel and remote control voltage/ amperage settings. In Wire, weld output is controlled through remote control only.

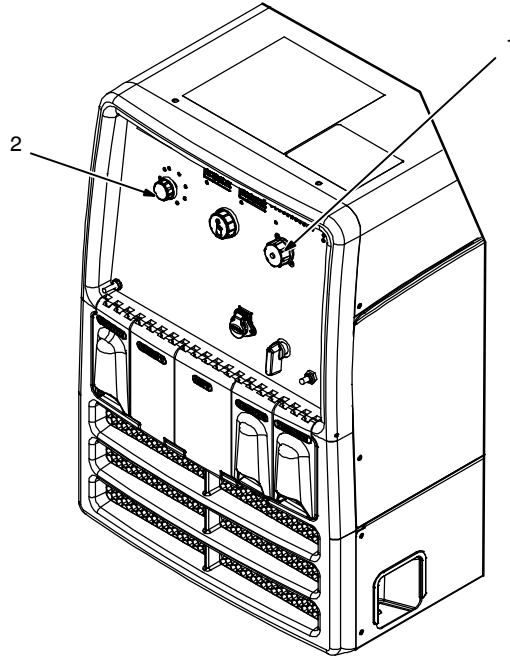

In Example:
Process = Stick (Using Remote On/Off)
Min = 30 A CC/DC
Max = 160 A CC/DC

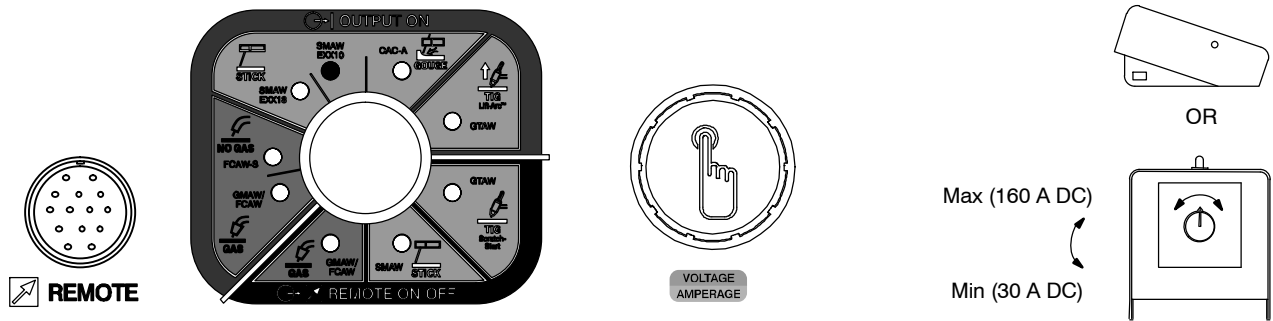

Connect Remote V/A Control To Remote Receptacle RC4



Set Process





Set V/A Control (Mid-Range: About 160 A)



Adjust Remote V/A Control (Stick Welding Only)

6-10. Updating Software

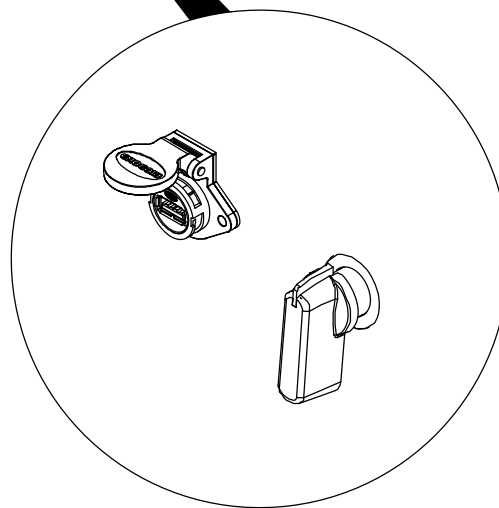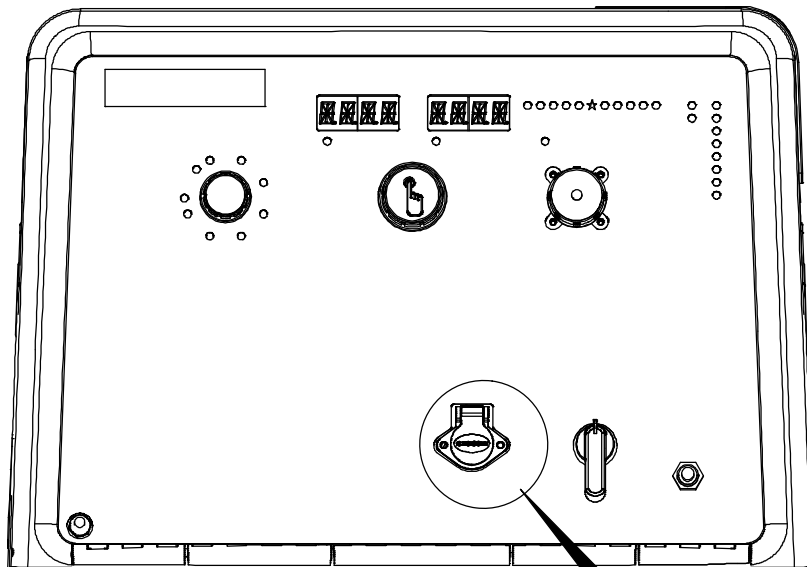

Obtain the latest firmware to be loaded from MillerWelds.com.

Copy the desired firmware to an approved USB flash drive (see Section 9-1).

With the machine turned off, insert the flash drive into the USB receptacle on the front of the machine. Turn the Engine Control switch to the Run or Auto-Speed position.

☞ *Do not start the engine.*

When the machine has powered up, if valid files exist on the flash drive, the user is prompted to confirm the start of the download. The Voltmeter/Ammeter display reads: ALL? NO.

Confirm by rotating the Adjust Control/Select button clockwise to select YES. Then press the Select button.

☞ *After the update has started, do not power down or remove the flash drive until the update is complete.*

During the download, the left meter display indicates the active download with ALLC or ALLW. The right meter display indicates the percentage of the download completed with a number from 0 to 100.

The Voltmeter/Ammeter display reads: AL ? NO. Confirm the start of the next down-

load by rotating the Adjust Control/Select button clockwise to select YES. Then press the Select button.

During the final download, the left meter display indicates AL C or AL W. The right meter display indicates the percentage of the download completed with a number from 0 to 100.

When the update has completed successfully, the machine restarts.

Failures are indicated on the meter display. Correction of failed updates depends on what type of failure occurred.

6-11. Summary File

1 Summary File

Each time a USB stick is inserted in the USB receptacle, a summary file is saved to the USB stick as SummaryFile.txt.

“USB ACC” will display as the file is written. File is complete when display no longer shows “USB ACC.”

The summary file provides diagnostic and weld information.



Status Summary

** Firmware Revisions **

```
Master Comm Processor
App Rev .....: 276588A
App Loader Rev.: 276587A
Launcher Rev...: 276586A
Perforce Changelist - App.....: 36878
Perforce Changelist - App Loader: 36755
Perforce Changelist - Launcher..: 36755
```

Master Weld Processor

```
App Rev .....: 276589A
App Loader Rev.: 276591A
Launcher Rev...: 276590A
Perforce Changelist - App.....: 36855
Perforce Changelist - App Loader: 36855
Perforce Changelist - Launcher..: 36855
```

** Usage **

```
Engine On Time ....: 348h 26m 57s
```

Process	Arc Count	Arc Time
Carbon Arc Gouge	2	0h 2m 12s
Lift-Arc TIG	10	2h 16m 6s
TIG Remote	1	0h 2m 31s
Stick Remote	19	8h 51m 41s
MIG Remote Solid	0	0h 0m 0s
MIG Solid	102	107h 41m 28s
MIG Flux-Core	0	0h 0m 0s
Stick XX18	81	96h 8m 4s
Stick XX10	3	0h 49m 37s
TIG AutoCrater	0	0h 0m 0s
Totals	218	215h 51m 39s

** Temperatures **

```
IGBT1 Module .....: 61°C
IGBT2 Module .....: 61°C
```


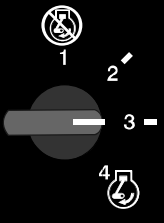





Error Code Log

Most Recent Errors:

```
S/W BLD
IGBT2OPN
S/W ERR
```

Error List	Count
MAX POWR	0
CHEKREMT	0
IGBT1SHT	0
IGBT1OPN	15
IGBT2SHT	0
IGBT2OPN	15
IGBTTEMP	0
OIL PRES	0
H2O TEMP	0
LOW FUEL	20
S/W ERR	5
S/W BLD	5

6-12. Fuel/Hour Gauge Descriptions

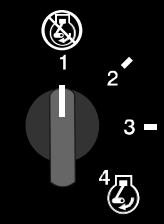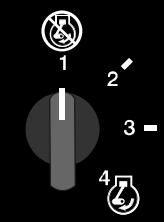Fuel, Hour, and Engine Shutdown Descriptions		
LH Display HOUR	RH Display 0000	ENGINE HOURS: To display engine hours while the engine is off, place Engine Control switch in position "2". 
LH Display OIL	RH Display 0499	OIL CHANGE INTERVAL: To display hours remaining before oil change is due, place Engine Control switch in position "3" (with engine off). 
Service Indicator Lights  Remaining Hrs. <50  Remaining Hrs. ≤0		OIL CHANGE DUE: Top Service Indicator light will illuminate (49 – 1 hours). Lower Service Indicator light will illuminate (0 hours or less). To Reset: Use "OIL RSET" in menu. See Section 6.4 in Owner's Manual.
Fuel Gauge 		LOW FUEL PREWARNING: Last LED in fuel gauge is illuminated steady. LOW FUEL: Fuel level low when last LED in fuel gauge blinks. To Reset: Refuel.
LH Display LOW	RH Display FUEL	NO FUEL: Engine shuts down before fuel runs out. Display shows "LOW FUEL." To Reset: Refuel.
LH Display OIL	RH Display PRES	LOW OIL PRESSURE: Engine shuts down when oil pressure is low. Display shows "OIL PRES." To Reset: Place Engine Control switch in OFF position. 
LH Display H2O	RH Display TEMP	HIGH COOLANT TEMP: Engine shuts down when coolant temperature is high. Display shows "H2O TEMP." To Reset: Place Engine Control switch in OFF position. 
Note: Switch positions are numbered to illustrate that there are four switch positions. Actual graphics on front panel will vary.		

278439-A

6-13. Associating ArcReach Devices (ArcReach Models Only)



⚠ Stop engine.

NOTICE – Do not exceed machine duty cycle.

Associating ArcReach Device To Engine Driven Welder/Generator

Make connections between welder/generator and ArcReach device. See Owner's Manual for ArcReach device for typical connection diagrams.


The welder/generator has the ability to associate automatically with an ArcReach device at power up. The Process/Contactor switch must be set to an Output ON mode to associate with an ArcReach device.

See the ArcReach device Owner's Manual to associate the device to the welder/generator.

When the association process is complete, the In Use light will be illuminated. Depending on the capabilities of the ArcReach device, the Process/Contactor switch, Adjust Control/Select button, and Arc Control adjustment may be overridden.

The following ArcReach accessories are compatible with this welder/generator:

**ArcReach Stick/TIG Remote
For Stick Or TIG Welding**

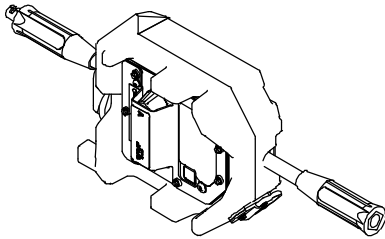


When welder/generator is associated with Stick/TIG Remote:

SMAW processes: Amperage, Electrode Type, and Arc Control settings are adjusted on the remote.


GTAW and CAC-A processes: Amperage settings are adjusted on the remote.

**ArcReach SuitCase Feeders
For MIG Or FCAW Welding**

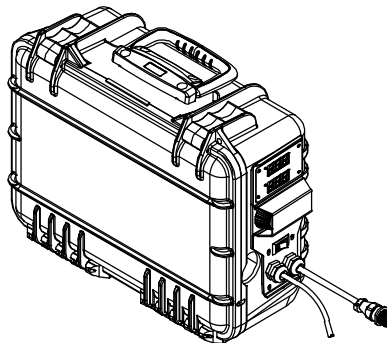

When welder/generator is associated with Suitcase X-TREME ArcReach feeder, voltage and wire feed settings are adjusted on the feeder.

**ArcReach Smart Feeder
For Advanced Wire Processes**

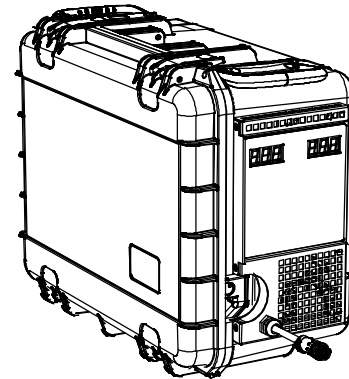


When welder/generator is associated with Smart Feeder, all controls switch to the feeder, and the display reads SMRT FEDR.

☞ When using an ArcReach device, engine speed is always weld/power speed.

SECTION 7 – OPERATING AUXILIARY EQUIPMENT

7-1. Generator Power Receptacles And Supplementary Protectors

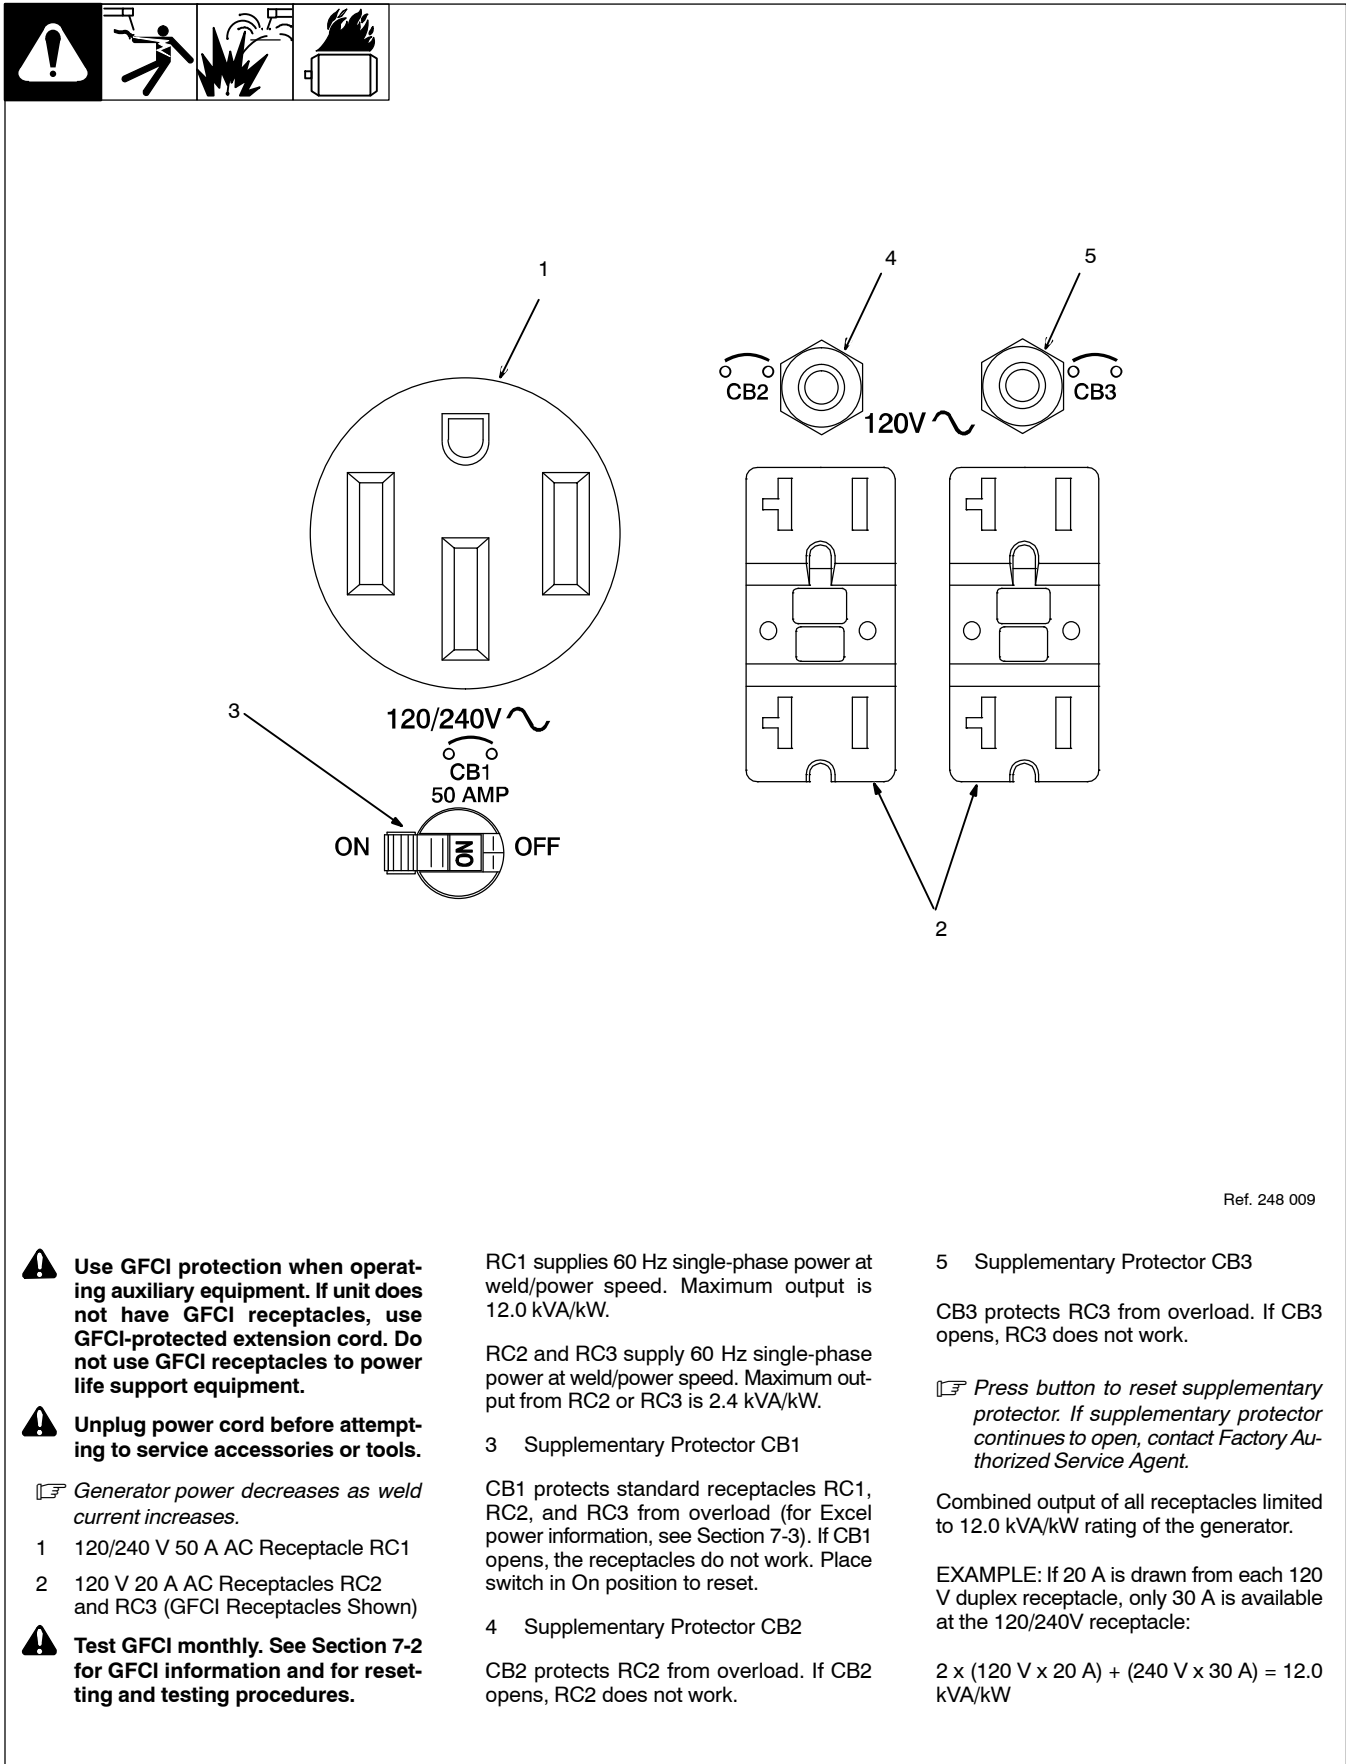

Ref. 248 009

- ⚠ Use GFCI protection when operating auxiliary equipment. If unit does not have GFCI receptacles, use GFCI-protected extension cord. Do not use GFCI receptacles to power life support equipment.**
- ⚠ Unplug power cord before attempting to service accessories or tools.**

Generator power decreases as weld current increases.

- 1 120/240 V 50 A AC Receptacle RC1
- 2 120 V 20 A AC Receptacles RC2 and RC3 (GFCI Receptacles Shown)

- ⚠ Test GFCI monthly. See Section 7-2 for GFCI information and for resetting and testing procedures.**

RC1 supplies 60 Hz single-phase power at weld/power speed. Maximum output is 12.0 kVA/kW.

RC2 and RC3 supply 60 Hz single-phase power at weld/power speed. Maximum output from RC2 or RC3 is 2.4 kVA/kW.

3 Supplementary Protector CB1

CB1 protects standard receptacles RC1, RC2, and RC3 from overload (for Excel power information, see Section 7-3). If CB1 opens, the receptacles do not work. Place switch in On position to reset.

4 Supplementary Protector CB2

CB2 protects RC2 from overload. If CB2 opens, RC2 does not work.

5 Supplementary Protector CB3

CB3 protects RC3 from overload. If CB3 opens, RC3 does not work.


Press button to reset supplementary protector. If supplementary protector continues to open, contact Factory Authorized Service Agent.

Combined output of all receptacles limited to 12.0 kVA/kW rating of the generator.

EXAMPLE: If 20 A is drawn from each 120 V duplex receptacle, only 30 A is available at the 120/240V receptacle:

$$2 \times (120 \text{ V} \times 20 \text{ A}) + (240 \text{ V} \times 30 \text{ A}) = 12.0 \text{ kVA/kW}$$

7-2. GFCI Receptacle Information, Resetting And Testing

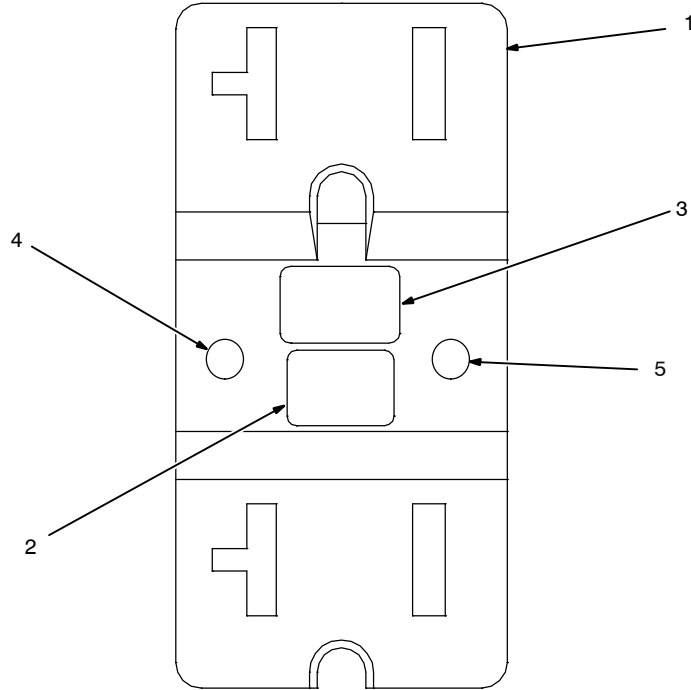

RotGFCI1 2016-12

⚠ Use GFCI protection when operating auxiliary equipment. If unit does not have GFCI receptacles, use GFCI-protected extension cord. Do not use GFCI receptacle to power life support equipment.

⚠ Unplug power cord before attempting to service accessories or tools.

- 1 120 V 20 A AC GFCI Receptacle
- 2 GFCI Receptacle Test Button
- 3 GFCI Receptacle Reset Button
- 4 Red GFCI Indicator Light (LED)
- 5 Green GFCI Indicator Light (LED)

GFCI Receptacles

GFCI receptacles protect the user from electric shock if a ground fault occurs in equipment connected to the receptacle. A ground fault occurs when electrical current takes the shortest path to ground (which could be through a person) rather than follow its intended safe path.

If a ground fault is detected, the GFCI Reset button pops out, and the circuit opens to disconnect power to the faulty equipment. A GFCI receptacle does not protect against circuit overloads, short circuits, or shocks not related to ground faults. Reset and test GFCI receptacle according to the following procedures.

A solid green LED indicates power to the GFCI. A solid red LED indicates that the GFCI has been tripped.

Resetting/Testing GFCI Receptacle

- ⚠ Test GFCI monthly.**
- ⚠ If Red LED blinks, stop using GFCI receptacle and have it replaced by a Factory Authorized Service Agent.**
- ⚠ Extension cords with bad insulation or of extended length can allow enough leakage current to trip the GFCI circuit. Reset and test as follows.**

Resetting GFCI Receptacles

If a GFCI fault occurs, stop engine and disconnect equipment from GFCI receptacle. Check for damaged or wet tools, cords, plugs, etc. connected to the receptacle. Start engine and press GFCI Reset button. Reconnect equipment to GFCI receptacle. If GFCI Reset button pops out again, check the equipment and repair or replace if faulty.


Testing GFCI Receptacles

Start engine and press the GFCI Test button. The GFCI Reset button should pop out.

Press the GFCI Reset button.

Have GFCI replaced by a Factory Authorized Service Agent if any of the following occur:
GFCI does not trip when tested
Red LED blinks
GFCI does not reset.

7-3. Optional Excel Power

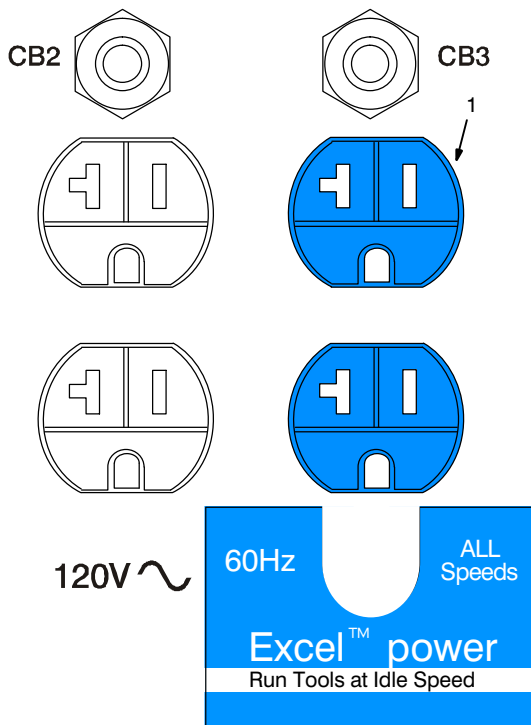

Excel power option provides generator power at idle speed and while welding. This allows most job site tools to operate properly at engine idle speed.

⚠ Use GFCI protection when operating auxiliary equipment. If unit does not have GFCI receptacles, use GFCI-protected extension cord. Do not use GFCI receptacles to power life support equipment.

- 1 120 V 20 A AC Excel Power Receptacle

This receptacle supplies 2.4 kVA/ kW of pure 120 V, 60 Hz sine wave power at ALL engine speeds.

Circuit protection is provided by CB3 only; CB1 does not provide protection to Excel power.

Combined output of all receptacles limited to peak rating of the generator.

Ref. 248 009 / 250 717-C

7-4. Simultaneous Weld And Power

Weld Current in Amperes	Total Power in Watts	120 V Full kVA Receptacle Amperes	240 V Full kVA Receptacle Amperes
250	2200	18	9
180	3500	29	14
125	5200	43	21
90	8000	66	33
0	12,000 (Peak)	88	44

7-5. Wiring Instructions For Optional 240 Volt, Single-Phase Plug (NEMA 14-50P)



Current Available in Amperes	
240 V Receptacle*	Each 120 V Duplex Receptacle
42	0
37	5
32	10
27	15
22	20

V x A = Watts
*One 240 V load or two 120 V loads.

The plug can be wired for a 240 V, 2-wire load or a 120/240V, 3-wire load. See circuit diagram.

1 Plug Wired for 120/240 V, 3-Wire Load

When wired for 120 V loads, each duplex receptacle shares a load with one half of 240 V receptacle.

2 Plug Wired for 240 V, 2-Wire Load


3 Neutral (Silver) Terminal

4 Load 1 (Brass) Terminal



5 Load 2 (Brass) Terminal

6 Ground (Green) Terminal

7 Amperes Available using 120/240 V Plug

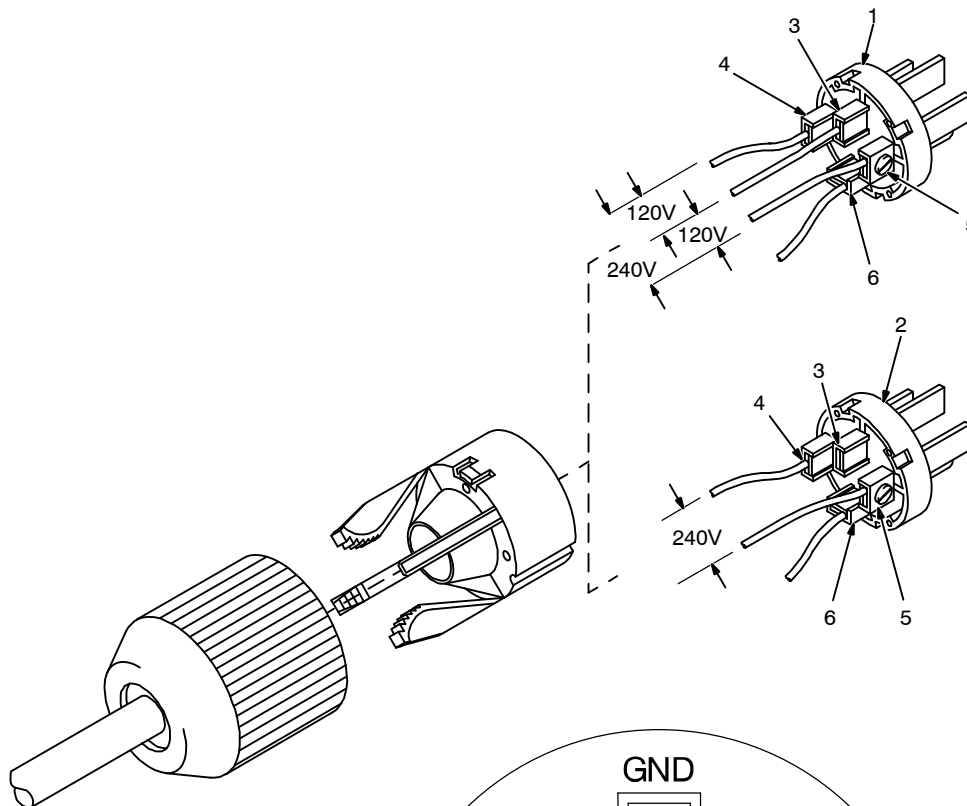

Tools Needed:

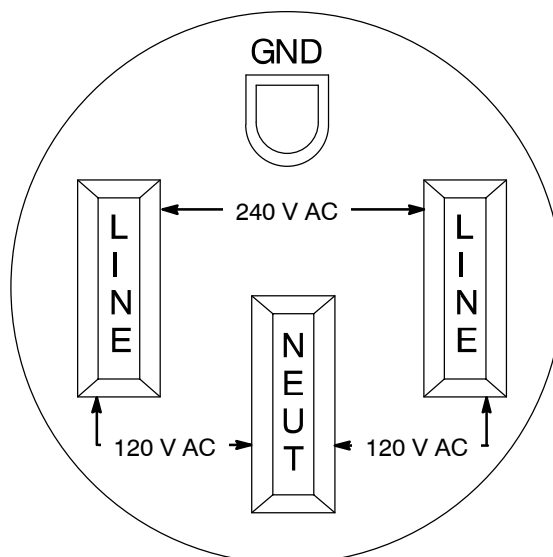


SECTION 8 – MAINTENANCE AND TROUBLESHOOTING

8-1. Routine Maintenance

						Recycle engine fluids.	Stop engine before maintaining. See Engine Manual and Maintenance Label for important start-up, service, and storage information. Service engine more often if used in severe conditions.

	✔ = Check	◇ = Change	● = Clean	☆ = Replace	Reference	
Every 8 Hours	 ✔ Coolant Level	 ✔ Fuel Level		 ✔ Oil Level	 ● Oil, Fuel Spills	Section 5-5
Every 200 Hours	 ✔ Fuel Connections	 ◇ Oil		 ◇ Oil Filter	 ☆ Air Cleaner	
	 ● Battery Terminals	 ☆ Unreadable Labels		 ● Weld Terminals		Section 8-2, 8-3, Engine Manual
Every 400 Hours	 ◇ Fuel Filters	 ✔ Belt Tension		 ✔ ☆ Weld Cables		
Every 1000 Hours	 ✔ Fan Belt	 ● Flush Radiator		 ✔ Radiator Hoses	 ✔ Air Cleaner Hoses	Engine Manual, Section 8-4
* To be done by Factory Authorized Service Agent	Every 800 Hours ✔ Valve Clearance*	Every 1000 Hours ✔ Slip Rings* ✔ ☆ Brushes*				Section 8-2
Every 2000 Hours	 ✔ ☆ Fuel Hoses	 ✔ ☆ Coolant & Hoses				Engine Manual, Section 8-2

8-2. Maintenance Label And Engine Maintenance Activities

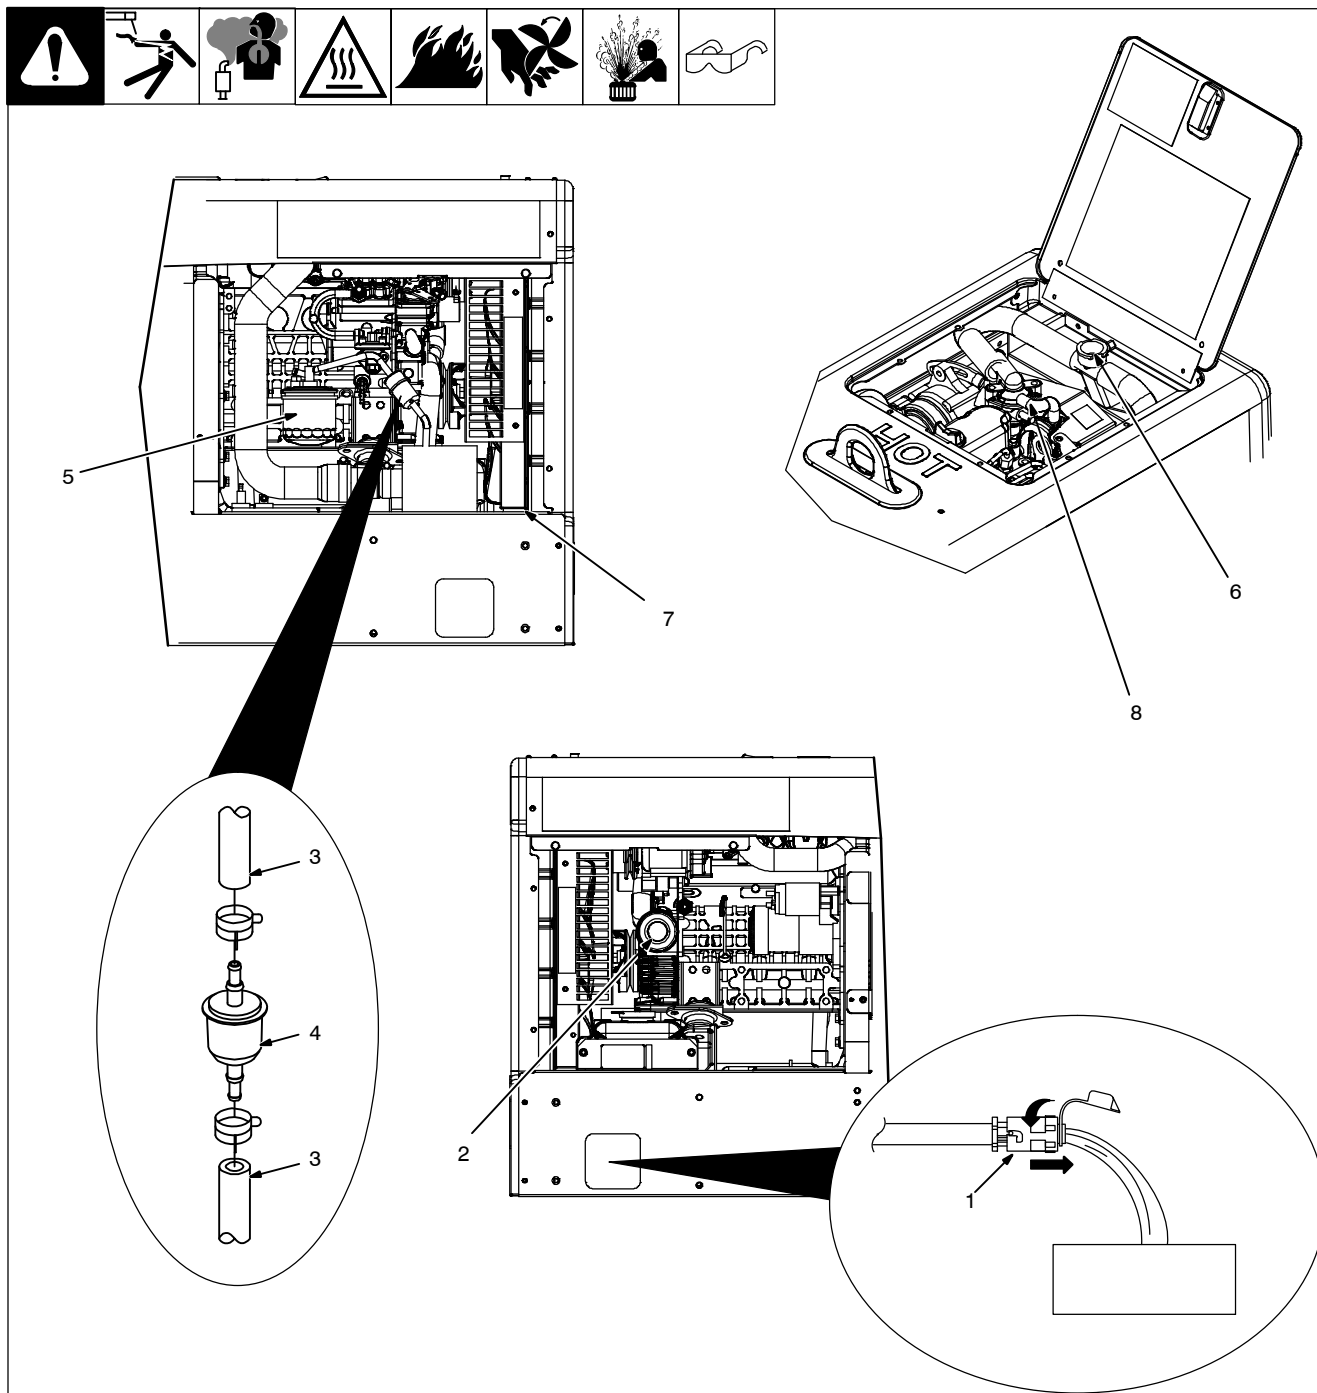

⚠ Stop engine and let cool.

Oil And Fuel

1 Oil Drain Valve

2 Oil Filter

Change engine oil and filter according to engine manual.

NOTICE – Close valve and valve cap before adding oil and running engine.

Fill crankcase with new oil to full mark on dipstick (see Section 5-5).

3 Fuel Lines

Replace fuel lines if cracked or worn.

4 Inline Fuel Filter

Install new filter as shown.

5 Fuel Filter

Replace filter according to engine manual.

Wipe up any spilled fuel.

Start engine, and check for fuel leaks.

⚠ Stop engine, tighten connections as necessary, and wipe up fuel.

Coolant

6 Radiator Cap

7 Radiator Drain Cock (Located on bottom of radiator)

Drain engine coolant according to procedure in engine manual.

Add engine coolant as follows:

8 Water Bypass Hose

Remove water bypass hose. Add coolant to radiator until coolant trickles out of water bypass hose. This ensures all air is purged from the system.

Reinstall hose and radiator cap. Check coolant level in overflow bottle.

Engine coolant is a mixture of water and ethylene glycol base antifreeze. A solution of 50% antifreeze and 50% water must be used in this engine. Do not use 100% antifreeze or severe damage will occur.

TRAILBLAZER KUBOTA D902 ENGINE

See Engine Manual for complete engine care.
 Give Engine Specification and Serial Number when ordering parts.
 Vea el manual del motor para el cuidado completo del motor.
 Dé la especificación del motor y el número de serie cuando ordena partes o piezas.



**Check daily:
 Diamante.**



**To Drain Oil:
 Push And Turn COW**
 1/2 In. ID Hose
 PULL



**For Our Environment,
 Recycle Used Oil.**

Recommended Oil to meet or exceed
 API Service Classification CI-4
 Oil Change 200 hours
 Oil Filter Change 200 hours
 Aceite recomendado para alcanzar o exceder
 Clasificación de Servicio API CI-4
 Cambio de aceite 200 horas
 Cambio del filtro del aceite. 200 horas

Oil Filter	MILLER 187443	Kubota HH160-32430
	Hastings LF523	Fram PH3593A
Oil Capacity	3.75 qt (3.6L) or 4.00 qt (3.8L) with filter change	
Fuel Grade	2-D Cetane No. 45 min. (Use Ultra Low Sulfur Fuel Only)	
Fuel Pre-filter (in-line)	MILLER 213858	Hastings GF160
Change filter every 400 hours. /	Cambie el filtro cada 400 horas.	
Primary Fuel Filter Element (canister)	MILLER 259334	Kubota 15221-43170
Air Filter Element	MILLER 258349	Donaldson D045003
Air Filter Service	200 hours or less - see Owner's Manual	
Service del filtro de aire	200 horas o menos - vea el manual del dueño	
12 Volt Battery	BCI Group 58	Valve Clearance - Cold
Cranking Performance at 0° F (-18°C)	430 Amps	Espacio de despeje de válvula fría .0087 - .0072 In. .145 - .185 mm
Engine Speed	Not adjustable	



Valve Clearance - Cold
 Espacio de despeje de válvula fría
 .0087 - .0072 In.
 .145 - .185 mm

Engine Cooling
 A solution of 50% anti-freeze and 50% water must be used in this engine. Do not use 100% anti-freeze, or severe damage will occur.



Enfriamiento del motor
 Se debe usar una solución de 50% anticongelante con 50% de agua en este motor. No use 100% anticongelante, porque ocurrirá daño severo al motor.



Belt MILLER 259849
 Kubota 15393-72530

**Inspect slip rings and replace brushes every 1000 hours.
 Inspeccione los anillos colectores y reemplaze los cepillos (escobillas) cada 1000 horas.**

MAINTENANCE DISPLAYS

- **ENGINE HOURS:** With engine off, place Engine Control switch in RUN position.
- **OIL CHANGE INDICATOR:** With engine off, place Engine Control switch into the AUTO-SPEED position to see hours before next oil change. Oil hours start at 200 and count down to 0 (oil change due).
NOTE: Negative hours indicate when past recommended oil change interval.
TO RESET: Cycle Engine Control switch from the AUTO-SPEED to RUN position 3 times.
- **LOW FUEL SHUTDOWN:** Engine will shut off prior to running out of fuel to prevent loss of fuel in the system. Display will read: noFUEL. Turn the machine off, add fuel, and restart.
- **HIGH COOLANT TEMPERATURE SHUTDOWN:** Engine will shut off and display will read: HI H2O. See Owner's Manual for coolant information. Turn Engine Control switch OFF to reset shutdown.
- **LOW OIL PRESSURE SHUTDOWN:** Engine will shut off and display will read: LO OIL. Turn Engine Control switch OFF to reset shutdown.
- **ENGINE RPM's:** With engine running and the Process Selector switch in any Stick HOT position, cycle Engine Control switch from the AUTO-SPEED to RUN position 3 times and meters will display Engine RPM's. Use to check and set both idle and run speed RPM's. Accuracy is ±16 RPM's. Turn machine off to reset display.

PANTALLAS DE MANTENIMIENTO

- **HORAS DEL MOTOR:** Con el motor apagado, ponga el interruptor de control del motor en la posición "RUN" (marcha).
- **INDICADOR DE CAMBIO DE ACEITE:** Con el motor apagado, ponga el interruptor de control del motor en la posición "AUTO-SPEED" (Automático-Velocidad) para ver las horas que faltan para el próximo cambio de aceite. Las horas del aceite comienzan a 200 y disminuyen a 0 (momento del cambio de aceite).
NOTE: Horas negativas indican que el intervalo de cambio de aceite recomendado ha pasado.
PARA REARMAR: Haga ciclos en el interruptor de control del motor desde la posición "AUTO-SPEED" a "RUN" 3 veces.
- **APAGAMIENTO POR RAZÓN DE COMBUSTIBLE BAJO:** El motor se apagará antes de quedarse sin combustible para prevenir que no haya combustible en el sistema. La pantalla indicará: noFUEL (no combustible). Apague el motor, añada combustible, y vuelva a arrancarlo.
- **APAGAMIENTO POR TEMPERATURA ALTA DEL REFRIGERANTE:** El motor se apagará y la pantalla indicará: HI H2O. Vea el Manual del Dueño para la información sobre el líquido refrigerante. Use el interruptor de control del motor para APAGARLO (OFF) para rearmar el apagamiento.
- **APAGAMIENTO POR PRESIÓN BAJA DE ACEITE:** El motor se apagará y la pantalla indicará: LO OIL (aceite bajo). Use el interruptor de control del motor para APAGARLO (OFF) y rearmar el apagamiento.
- **RPM DEL MOTOR:** Con el motor funcionando y el interruptor de selección de proceso en cualquier posición "Stick HOT" (soldadura convencional CALIENTE), haga ciclo al interruptor de control del motor de la posición "AUTO-SPEED a RUN" 3 veces y los medidores mostrarán el RPM del motor. Use para verificar el RPM de ralentí y de marcha. La precisión es de ±16 RPM. Apague la máquina para rearmar la pantalla.

Glow Plugs . . . MILLER 187820 Kubota 16851-65512


Do not use ether for starting.
Note: Operation not required when above 50° F (10° C) or when engine is warm.
Never operate for more than 20 seconds continuous.
Use cold weather kit below 14° F (-10° C) Miller 307115.



No use éter para arrancar.
Note: No se requiere esta operación cuando esté arriba de 50° F (10° C), o cuando el motor esté caliente. Nunca las opere por más de 20 segundos continuamente.
Utilice juego de tiempo frío, bajo 14° F (-10° C) Miller 307115.

25899-C

8-3. Replacing Air Cleaner

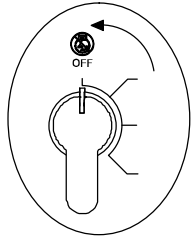


Stop engine.

NOTICE – Do not run engine without air cleaner or with dirty element. Engine damage caused by using a damaged element is not covered by the warranty.

- 1 Air Intake Tube
- 2 Hose Clamp
- 3 Air Cleaner

Loosen hose clamp, slide air cleaner towards rear of unit and remove. Slide new air cleaner onto intake tube and tighten clamp.


Replace air cleaner every 200 hours or less if used in severe conditions.

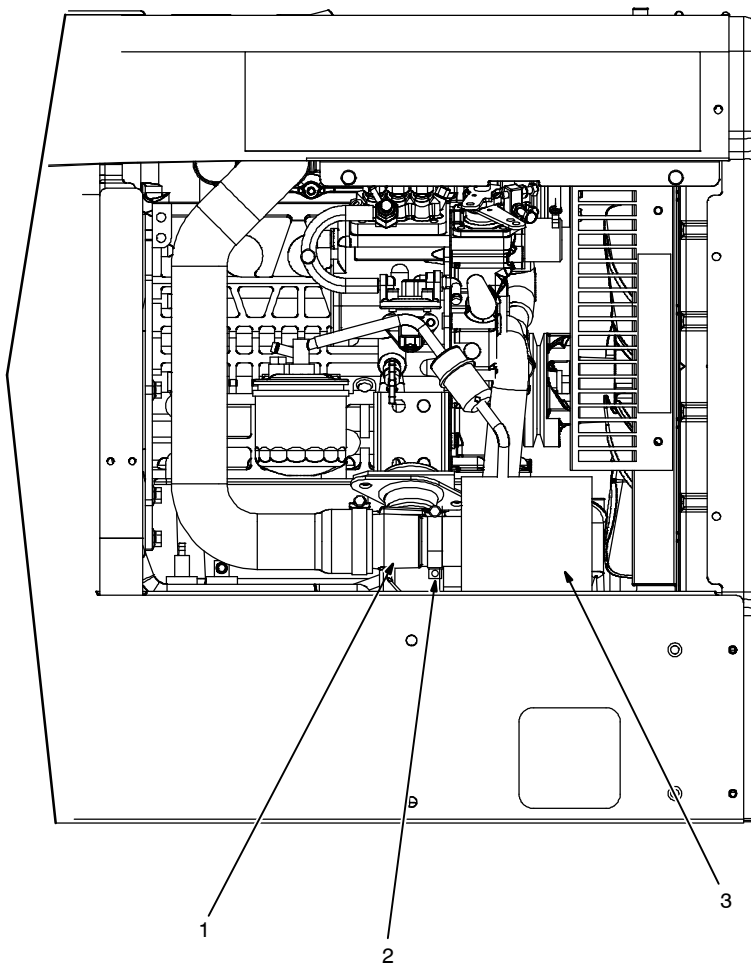


8-4. Adjusting Engine Speed

Engine speed is controlled by an electronic system that can only be adjusted by an engine Factory Authorized Service Station. Tampering with the electronic governor may void engine warranty.

8-5. Overload Protection

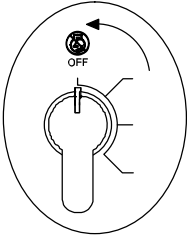

Tools Needed:



⚠ Stop engine.

When a circuit breaker or fuse opens, it usually indicates a more serious problem exists. Contact a Factory Authorized Service Agent.

1 Fuse F5

F5 protects the weld excitation winding from overload. If F5 opens, weld output stops or is low.

2 Supplementary Protector CB5

Protects optional Excel power windings from overload. If this opens, Excel power is not available at receptacle RC3.

Place switch in On position to reset.

3 Circuit Breaker CB7

CB7 protects the engine glow plug circuit. If CB7 opens, the glow plug will not heat. CB7 automatically resets when the fault is corrected.

4 Supplementary Protector CB8


CB8 protects the engine battery circuit. If CB8 opens, the engine will not crank. CB8 automatically resets when the fault is corrected.

Replace any open fuses. Close door and/or reinstall cover before operating unit.

5 Supplementary Protector CB4

CB4 protects the stator winding supplying 24 volt AC output to Remote receptacle RC4. If CB4 opens, 24 volt AC output to RC4 stops.

Press button to reset.

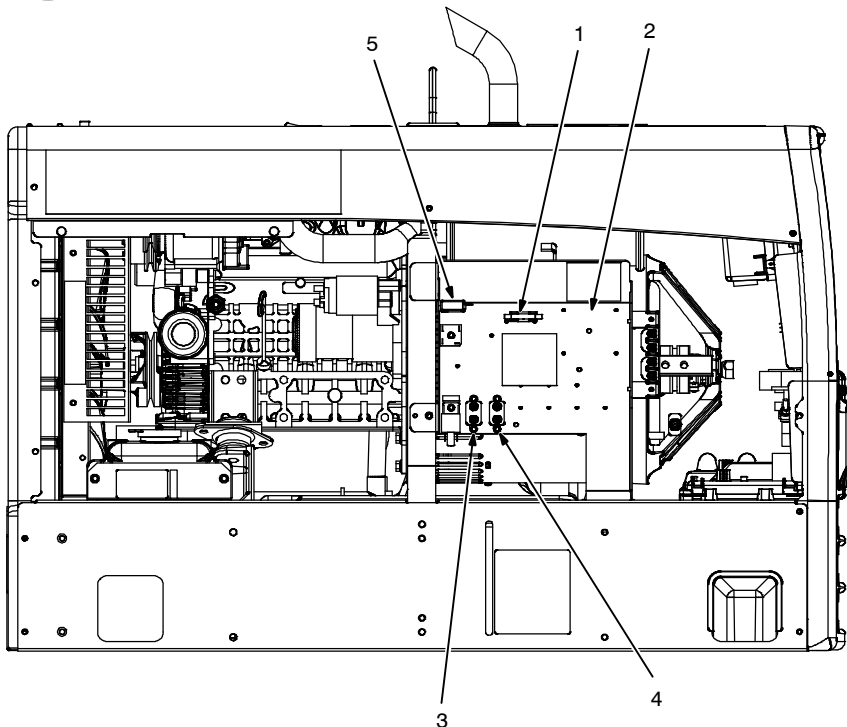

8-6. Voltmeter/Ammeter Error Displays



IGBT

TEMP

Display Example


Use the Voltmeter/Ammeter error displays to diagnose and correct fault conditions.

☞ When an error is displayed, normally weld output has stopped but generator power output may be okay.

☞ To reset error displays, stop unit and then restart. See below to reset CHEK REMT display.

Error Display	Description
CHEK REMT	Indicates a remote device connected to the Remote Receptacle may be faulty. CHEK REMT is also displayed whenever a remote device has been connected to the Remote Receptacle and then disconnected. Clear fault by stopping and restarting the unit, or by turning Process/Contactor switch to another position. If problem continues, have Factory Authorized Service agent check the remote device and main control board PC1.
IGBT 1SHT	Indicates the thermistor in IGBT module 1 has shorted. Have Factory Authorized Service Agent check unit.
IGBT 1OPN	Indicates the thermistor in IGBT module 1 is open. Have Factory Authorized Service Agent check unit.
IGBT 2SHT	Indicates the thermistor in IGBT module 2 has shorted. Have Factory Authorized Service Agent check unit.
IGBT 2OPN	Indicates the thermistor in IGBT module 2 is open. Have Factory Authorized Service Agent check unit.
IGBT TEMP	Indicates an IGBT module has overheated. If this display is shown, check generator cooling system and/or reduce duty cycle. Keep engine access door closed when running unit to maintain proper cooling airflow past module. Allow unit to cool before restarting. If problem continues, have Factory Authorized Service Agent check unit.
MAX POWR	Engine power limit exceeded, causing weld output to be temporarily reduced. Error clears after 5 seconds.
S/W ERR	Software version mismatch occurred. Reload software update. If error does not clear, have Factory Authorized Service Agent check unit.
S/W BLD	Software build mismatch occurred. Reload software update. If error does not clear, have Factory Authorized Service Agent check unit.

8-7. Troubleshooting Tables



A. Welding

Trouble	Remedy
Low or no weld output; generator power output okay at AC receptacles.	Check control settings and all connections.
	Check fuse F5 and replace if necessary (see Section 8-5).
	Have Factory Authorized Service Agent check brushes, slip rings, and main rectifiers SR1, SR2, and SR3.
No weld output or generator power output at AC receptacles.	Be sure all equipment is disconnected from receptacles when starting unit.
	Have Factory Authorized Service Agent check brushes and slip rings.
Low weld output.	Check control settings.
	Service air cleaner (see Section 8-2)
	Have Factory Authorized Service Agent check brushes and slip rings.
High weld output.	Check control settings.
Erratic weld output.	Check control settings.
	Tighten and clean connections to electrode and workpiece.
	Use dry, properly stored electrodes for Stick and TIG welding.
	Remove excessive coils from weld cables.
	Clean and tighten connections both inside and outside welder/generator.
	Have Factory Authorized Service Agent check brushes and slip rings.

B. Generator Power

Trouble	Remedy
No or low generator power output at AC receptacles; weld output okay.	Reset supplementary protectors (see Section 7-1).
	Press GFCI receptacle Reset button (see Section 7-2).
	Check engine ignition wiring connections.
	Have Factory Authorized Service Agent check brushes and slip rings.
No generator power or weld output.	Be sure all equipment is disconnected from receptacles when starting unit.
	Check engine ignition wiring connections.
	Have Factory Authorized Service Agent check brushes and slip rings.
Erratic power output at AC receptacles.	Check fuel level.
	Check receptacle wiring and connections.
	Have Factory Authorized Service Agent check brushes and slip rings.

C. Engine

Maintenance Display	Action
noFUEL	Place Engine Control switch in the Off position, refuel, and start engine.
HI H2O	Coolant temperature is too high. Allow engine to cool and check coolant level (see Section 8-2).
LO OIL	Oil pressure is too low. Allow engine to cool and check oil level (see Section 8-2).

Trouble	Remedy
Engine does not crank.	Supplementary protector CB8 may be open (see Section 8-5). Wait and retry.
	Check battery voltage.
	Check battery connections; clean and tighten if necessary.
	Check Engine Control switch and engine wiring harness connections.
	Have Factory Authorized Service Agent check circuit breaker CB8.
Engine cranks but does not start.	Check fuel level and front panel fault indicators (see Section 6-1).
	Glow plug circuit breaker CB7 may be open (see Section 8-5). Wait and retry.
	Service inline fuel strainer and fuel filter (see Section 8-2).
	Check battery and replace if necessary.
	Check engine charging system according to engine manual.
	Have Factory Authorized Service Agent check Engine Control Unit (ECU) fault codes.
	Have Factory Authorized Service Agent check glow plug switch S2, glow plug, and control relay CR1.
Engine starts but stops when Engine Control switch S1 returns to Auto-Speed position.	Check oil level (see Section 5-6) and front panel fault indicators (see Section 6-1). Engine will not start if oil pressure is too low.
	Check coolant level and fan belt (see Section 5-6 and engine manual), and check front panel fault indicators (see Section 6-1). Engine will not start if engine temperature is too high.
	Have Factory Authorized Service Agent check low oil pressure shutdown switch S3 and engine temperature switch S4.
Engine stopped during normal operation.	Check fuel level and front panel fault indicators (see Section 6-1).
	Check oil level (see Section 5-6) and front panel fault indicators (see Section 6-1). Engine will not start if oil pressure is too low.
	Check coolant level and fan belt (see Section 5-6 and engine manual), and check front panel fault indicators (see Section 6-1). Engine stops if engine temperature is too high.
	Have Factory Authorized Service Agent check low oil pressure shutdown switch S3 and engine temperature switch S4.
Battery discharges between uses.	Clean top of battery with baking soda and water solution; rinse with clear water.
	Periodically recharge battery (approximately every 3 months).
	Replace battery.
	Check alternator voltage according to engine manual.
Engine does not return to idle speed when load is removed with Engine Control switch in Auto-Speed position.	Remove all weld and generator power loads.
	Have engine Factory Authorized Service Agent check engine and wiring.
Engine does not remain at weld/power speed when power or weld load is applied with Engine Control switch in Auto-Speed position.	Have engine Factory Authorized Service Agent check engine and wiring.
Engine exhaust smoke black when unit is under load.	Replace air cleaner. Replace fuel filter.

SECTION 9 – PARTS LIST

9-1. Recommended Spare Parts

Dia. Mkgs.	Part No.	Description	Quantity
Recommended Spare Parts			
.....	276418	.. USB Flash Drive	1
.....	259935	.. Filter Kit, Kubota (Includes air cleaner element, fuel, oil filters)	1
.....	258349	.. Air Cleaner, Intake Dry Straight Outlet	1
.....	213858	.. Filter, Fuel In-line 5/16x5/16 Mic 125 -175	1
.....	259934	.. Filter, Fuel (Kubota)	1
.....	187443	.. Oil Filter	1
.....	259949	.. Belt, Fan	1
.....	GLOW PLUG . 187820	.. Glow Plug	1
.....	F5	012655 .. Fuse, Mintr Cer 10. Amp 250 Volt	1

Miller recommends

It's the tie that binds



Finding the right filler metal solution for your welding needs is critical in an industry that is about getting the job done right. Filler metals are more than just a component of welding — they are **the tie that binds science and people**. The right solutions. Solutions to make our world more secure. More dynamic. More of what you need.

Every day, every project, every weld is another opportunity for Hobart to earn and secure your trust by helping you find the right filler metal solution.

That kind of help and finding your welding solutions is our passion.

SCIENCE + PEOPLE

Visit HobartBrothers.com for more information.

Find Your Solution. Today.

SECTION 10 – ELECTRICAL DIAGRAMS


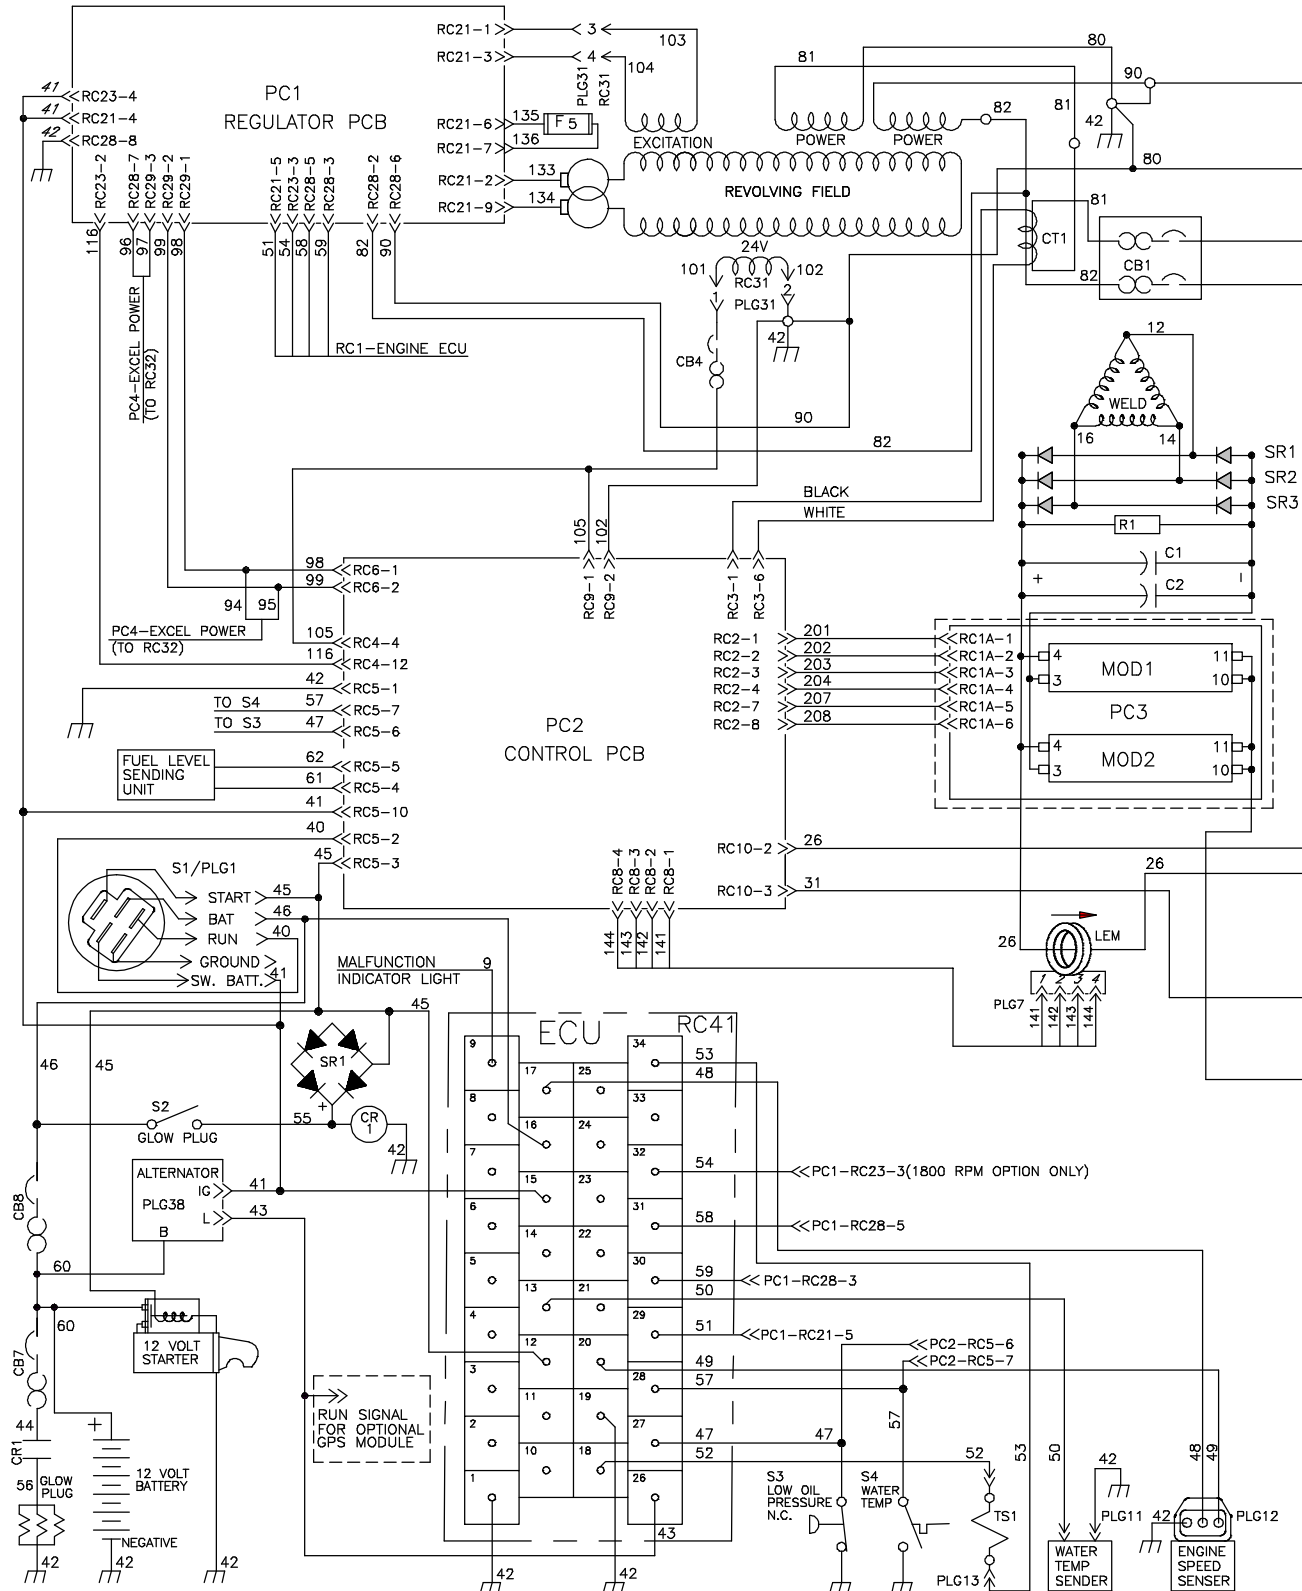





Figure 10-1. Circuit Diagram For Welder/Generator

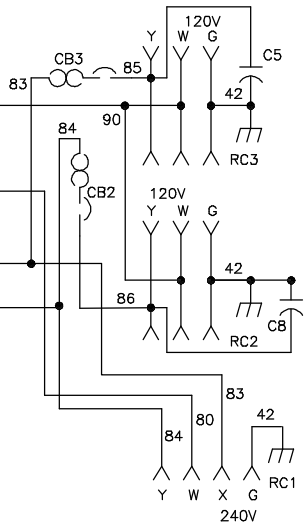

⚠ WARNING

ELECTRIC SHOCK HAZARD

- Do not touch live electrical parts.
- Disconnect input power or stop engine before servicing.
- Do not operate with covers removed.
- Have only qualified persons install, use, or service this unit.

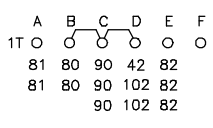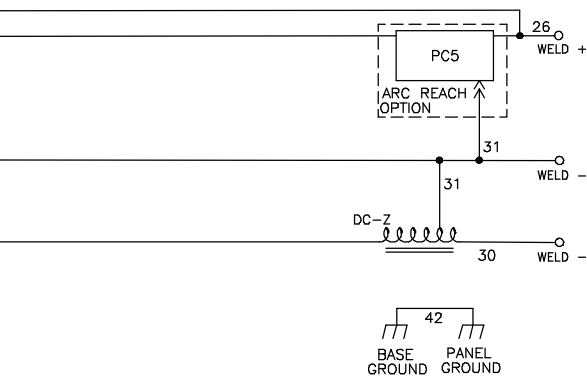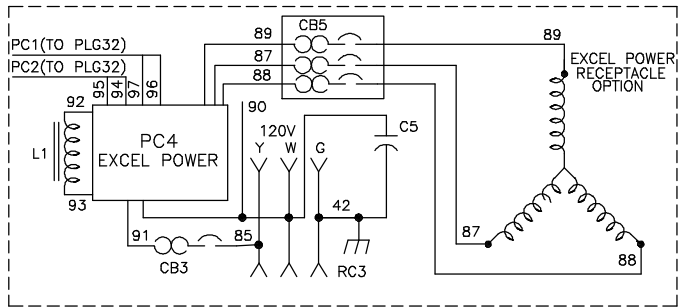

(POSITION)



(TERMINAL)	S1	OFF	RUN	AUTO SPEED	START
SW. BATT.		X	X	X	
RUN		0	X		
START					X
GROUND		0			


X = CLOSED TO BAT. TERMINAL
0 = CLOSED TO BASE GROUND

SECTION 11 – GENERATOR POWER GUIDELINES

The views in this section are intended to be representative of all engine-driven welder/generators. Your unit may differ from those shown.

11-1. Selecting Equipment



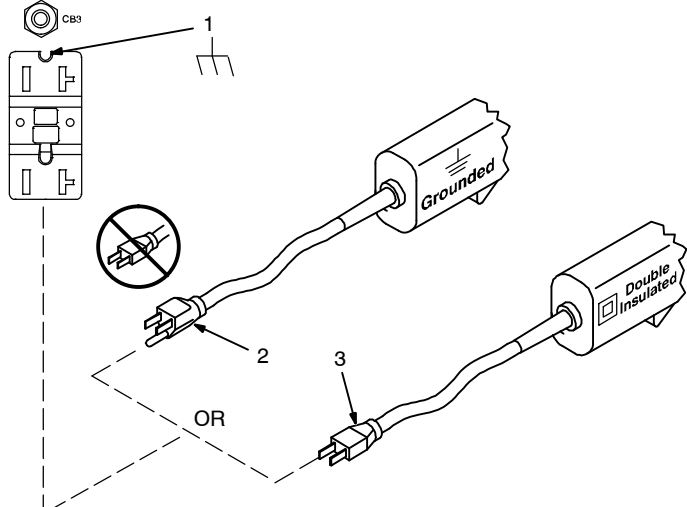

- 1 Generator Power Receptacles – Neutral Bonded To Frame
- 2 3-Prong Plug From Case Grounded Equipment
- 3 2-Prong Plug From Double Insulated Equipment


Be sure equipment has double insulated symbol and/or wording on it.

Do not use 2-prong plug unless equipment is double insulated.

gen_pwr 2017-01 – ST-800 577

11-2. Grounding Generator To Truck Or Trailer Frame

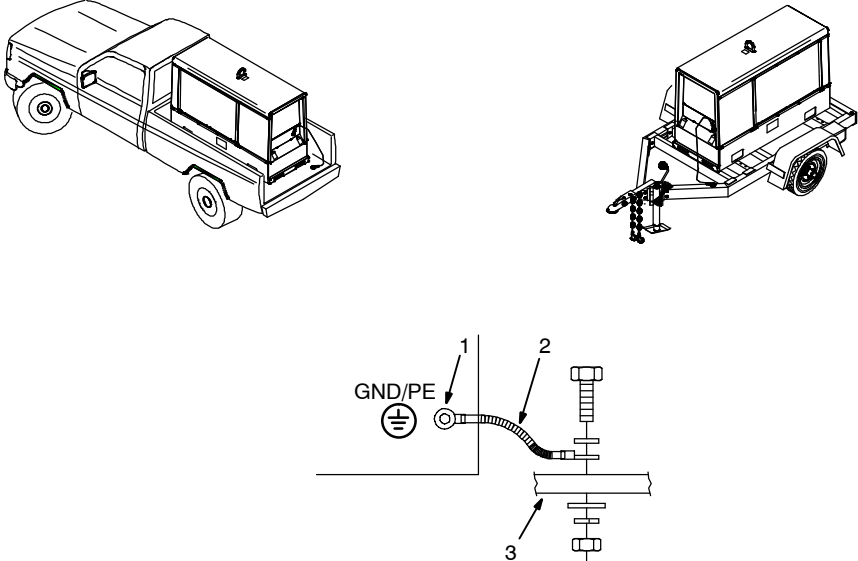

800 652-D

Always ground generator frame to vehicle frame to prevent electric shock and static electricity hazards.

Also see AWS Safety & Health Fact Sheet No. 29, Grounding of Portable And Vehicle Mounted Welding Generators.

- 1 Equipment Grounding Terminal (On Front Panel)
- 2 Grounding Cable (Not Supplied)

3 Metal Vehicle Frame

Connect cable from equipment ground terminal to metal vehicle frame. Use #8 AWG or larger insulated copper wire.


Electrically bond generator frame to vehicle frame by metal-to-metal contact.

Bed liners, shipping skids, and some running gear insulate the welder/generator from the vehicle

frame. Always connect a ground wire from the generator equipment grounding terminal to bare metal on the vehicle frame as shown.

Use GFCI protection when operating auxiliary equipment. If unit does not have GFCI receptacles, use GFCI-protected extension cord. Do not use GFCI receptacles to power life support equipment.

11-3. Grounding When Supplying Building Systems

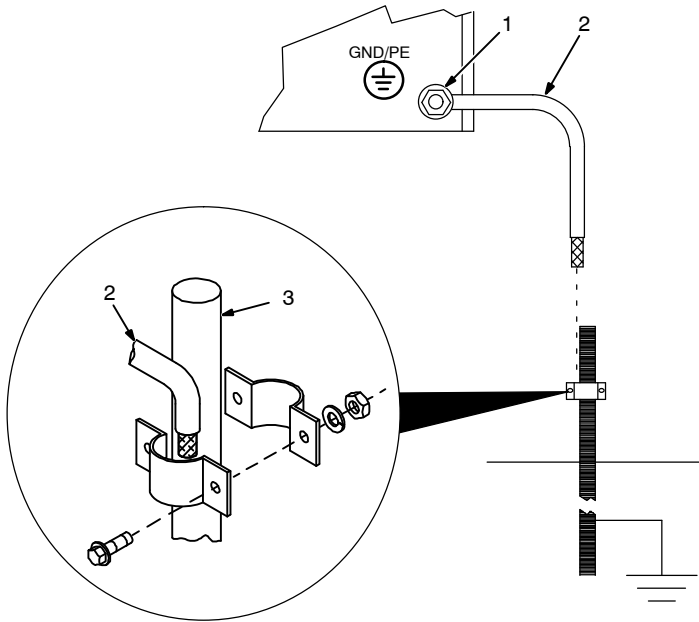

- 1 Equipment Grounding Terminal
 - 2 Grounding Cable
- Use #8 AWG or larger insulated copper wire.
- 3 Ground Device


Use ground device as stated in electrical codes.

Ground generator to system earth ground if supplying power to a premises (home, shop, farm) wiring system.

Also see AWS Safety & Health Fact Sheet No. 29, Grounding of Portable And Vehicle Mounted Welding Generators.

ST-800 576-B

11-4. How Much Power Does Equipment Require?

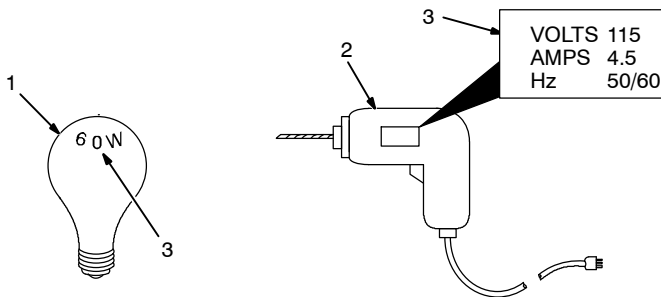

- 1 Resistive Load

A light bulb is a resistive load and requires a constant amount of power.

- 2 Non-Resistive Load

Equipment with a motor is a non-resistive load and requires approximately six times more power while starting the motor than when running (see Section 11-8).

- 3 Rating Data

Rating shows volts and amperes, or watts required to run equipment.

Amperes x Volts = Watts

Example 1: If a drill uses 4.5 amperes at 115 volts, calculate its running power requirement in watts.

$$4.5 \text{ A} \times 115 \text{ V} = 520 \text{ W}$$

The load applied by the drill is 520 watts.

Example 2: If three 200 watt flood lamps are used with the drill from Example 1, add the individual loads to calculate total load.

$$(3 \times 200\text{W}) + 520 \text{ W} = 1120 \text{ W}$$

The total load applied by the three flood lamps and drill is 1120 watts.

S-0623

11-5. Approximate Power Requirements For Industrial Motors

Industrial Motors	Rating	Starting Watts	Running Watts
Split Phase	1/8 HP	800	300
	1/6 HP	1225	500
	1/4 HP	1600	600
	1/3 HP	2100	700
	1/2 HP	3175	875
Capacitor Start-Induction Run	1/3 HP	2020	720
	1/2 HP	3075	975
	3/4 HP	4500	1400
	1 HP	6100	1600
	1-1/2 HP	8200	2200
	2 HP	10,550	2850
	3 HP	15,900	3900
	5 HP	23,300	6800
Capacitor Start-Capacitor Run	1-1/2 HP	8100	2000
	5 HP	23,300	6000
	7-1/2 HP	35,000	8000
	10 HP	46,700	10,700
Fan Duty	1/8 HP	1000	400
	1/6 HP	1400	550
	1/4 HP	1850	650
	1/3 HP	2400	800
	1/2 HP	3500	1100

11-6. Approximate Power Requirements For Farm/Home Equipment



Farm/Home Equipment	Rating	Starting Watts	Running Watts
Stock Tank De-Icer		1000	1000
Grain Cleaner	1/4 HP	1650	650
Portable Conveyor	1/2 HP	3400	1000
Grain Elevator	3/4 HP	4400	1400
Milk Cooler		2900	1100
Milker (Vacuum Pump)	2 HP	10,500	2800
Farm Duty Motors Std. (e.g. Conveyors, Feed Augers, Air Compressors)	1/3 HP	1720	720
	1/2 HP	2575	975
	3/4 HP	4500	1400
	1 HP	6100	1600
	1-1/2 HP	8200	2200
	2 HP	10,550	2850
	3 HP	15,900	3900
Farm Duty Motors High Torque (e.g. Barn Cleaners, Silo Unloaders, Silo Hoists, Bunk Feeders)	1-1/2 HP	8100	2000
	5 HP	23,300	6000
	7-1/2 HP	35,000	8000
	10 HP	46,700	10,700
3-1/2 cu. ft. Mixer	1/2 HP	3300	1000
High Pressure 1.8 Gal/Min	500 PSI	3150	950
Washer 2 gal/min	550 PSI	4500	1400
	700 PSI	6100	1600
Refrigerator or Freezer		3100	800
Shallow Well Pump	1/3 HP	2150	750
	1/2 HP	3100	1000
Sump Pump	1/3 HP	2100	800
	1/2 HP	3200	1050


11-7. Approximate Power Requirements For Contractor Equipment

Contractor Equipment	Rating	Starting Watts	Running Watts
Hand Drill	1/4 in.	350	350
	3/8 in.	400	400
	1/2 in.	600	600
Circular Saw	6-1/2 in.	500	500
	7-1/4 in.	900	900
	8-1/4 in.	1400	1400
Table Saw	9 in.	4500	1500
	10 in.	6300	1800
Band Saw	14 in.	2500	1100
Bench Grinder	6 in.	1720	720
	8 in.	3900	1400
	10 in.	5200	1600
Air Compressor	1/2 HP	3000	1000
	1 HP	6000	1500
	1-1/2 HP	8200	2200
	2 HP	10,500	2800
Electric Chain Saw	1-1/2 HP, 12 in.	1100	1100
	2 HP, 14 in.	1100	1100
Electric Trimmer	Standard 9 in.	350	350
	Heavy Duty 12 in.	500	500
Electric Cultivator	1/3 HP	2100	700
Elec. Hedge Trimmer	18 in.	400	400
Flood Lights	HID	125	100
	Metal Halide	313	250
	Mercury	1000	
	Sodium	1400	
	Vapor	1250	1000
Submersible Pump	400 GPH	600	200
Centrifugal Pump	900 GPH	900	500
Floor Polisher	3/4 HP, 16 in.	4500	1400
	1 HP, 20 in.	6100	1600
High Pressure Washer	1/2 HP	3150	950
	3/4 HP	4500	1400
	1 HP	6100	1600
55 gal Drum Mixer	1/4 HP	1900	700
Wet & Dry Vac	1.7 HP	900	900
	2-1/2 HP	1300	1300

11-8. Power Required To Start Motor

Single-Phase Induction Motor Starting Requirements								
Motor Start Code	G	H	J	K	L	M	N	P
KVA/HP	6.3	7.1	8.0	9.0	10.0	11.2	12.5	14.0

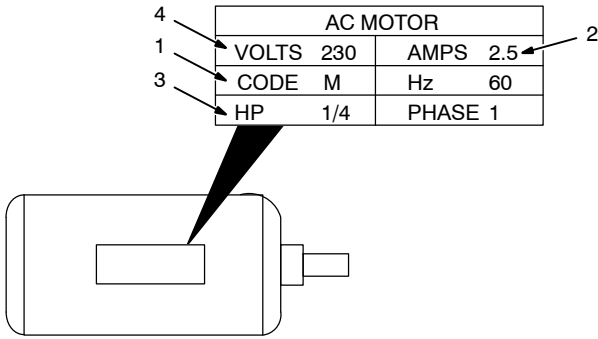

- 1 Motor Start Code
- 2 Running Amperage
- 3 Motor HP
- 4 Motor Voltage

To find starting amperage:

Step 1: Find code and use table to find kVA/HP. If code is not listed, multiply running amperage by six to find starting amperage.

Step 2: Find Motor HP and Volts.

Step 3: Determine starting amperage (see example).

Welder/generator amperage output must be at least twice the motor's running amperage.

(kVA/HP x HP x 1000) / Volts = Starting Amperage

Example: Calculate starting amperage required for a 230 V, 1/4 HP motor with a motor start code of M.



Volts = 230, HP = 1/4, kVA/HP = 11.2


$(11.2 \times 1/4 \times 1000) / 230 = 12.2A$

Starting the motor requires 12.2 amperes.

S-0624

11-9. How Much Power Can Generator Supply?

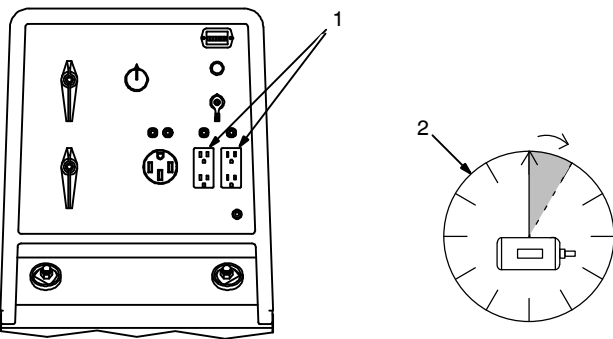

- 1 Limit Load To 90% Of Generator Output


Always start non-resistive (motor) loads in order from largest to smallest, and add resistive loads last.

- 2 5 Second Rule

If motor does not start within 5 seconds, turn off power to prevent motor damage. Motor requires more power than generator can supply.

Ref. ST-800 396-A / S-0625

11-10. Typical Connections To Supply Standby Power

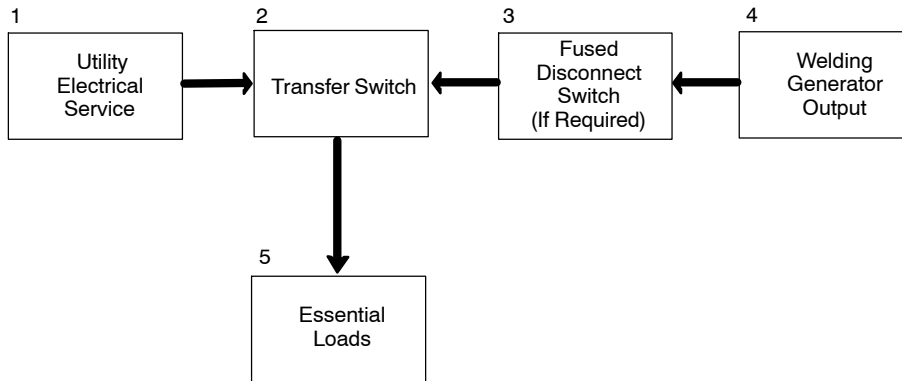

⚠ Have only qualified persons perform these connections according to all applicable codes and safety practices.

⚠ Properly install, ground, and operate this equipment according to its Owner's Manual and national, state, and local codes.

ℹ Customer-supplied equipment is required if generator will supply standby power during emergencies or power outages.

1 Utility Electrical Service

2 Transfer Switch (Double-Throw)

Switch transfers the electrical load from electric utility service to the generator. Transfer load back to electric utility when service is restored.

Install correct switch (customer-supplied). Switch rating must be same as or greater than the branch overcurrent protection.

3 Fused Disconnect Switch

Install correct switch (customer-supplied) if required by electrical code.

4 Welder/Generator Output

Generator output voltage and wiring must be consistent with regular (utility) system voltage and wiring.


Connect generator with temporary or permanent wiring suitable for the installation.

Turn off or unplug all equipment connected to generator before starting or stopping engine. When starting or stopping, the engine has low speed which causes low voltage and frequency.


5 Essential Loads

Generator output may not meet the electrical requirements of the premises. If generator does not produce enough output to meet all requirements, connect only essential loads (pumps, freezers, heaters, etc. – See Section 11-4).

11-11. Selecting Extension Cord (Use Shortest Cord Possible)

Cord Lengths for 120 Volt Loads							
							
⚠ Use GFCI protection when operating auxiliary equipment. If unit does not have GFCI receptacles, use GFCI-protected extension cord. Do not use GFCI receptacles to power life support equipment.							
Current (Amperes)	Load (Watts)	Maximum Allowable Cord Length In ft (m) for Conductor Size In AWG (mm ²)*					
		4 (25)	6 (16)	8 (10)	10 (6)	12 (4)	14 (2.5)
5	600			350 (106)	225 (68)	137 (42)	100 (30)
7	840		400 (122)	250 (76)	150 (46)	100 (30)	62 (19)
10	1200	400 (122)	275 (84)	175 (53)	112 (34)	62 (19)	50 (15)
15	1800	300 (91)	175 (53)	112 (34)	75 (23)	37 (11)	30 (9)
20	2400	225 (68)	137 (42)	87 (26)	50 (15)	30 (9)	
25	3000	175 (53)	112 (34)	62 (19)	37 (11)		
30	3600	150 (46)	87 (26)	50 (15)	37 (11)		
35	4200	125 (38)	75 (23)	50 (15)			
40	4800	112 (34)	62 (19)	37 (11)			
45	5400	100 (30)	62 (19)				
50	6000	87 (26)	50 (15)				

*Conductor size is based on maximum 2% voltage drop

Cord Lengths for 240 Volt Loads							
							
⚠ Use GFCI protection when operating auxiliary equipment. If unit does not have GFCI receptacles, use GFCI-protected extension cord. Do not use GFCI receptacles to power life support equipment.							
Current (Amperes)	Load (Watts)	Maximum Allowable Cord Length In ft (m) for Conductor Size In AWG (mm ²)*					
		4 (25)	6 (16)	8 (10)	10 (6)	12 (4)	14 (2.5)
5	1200			700 (213)	450 (137)	225 (84)	200 (61)
7	1680		800 (244)	500 (152)	300 (91)	200 (61)	125 (38)
10	2400	800 (244)	550 (168)	350 (107)	225 (69)	125 (38)	100 (31)
15	3600	600 (183)	350 (107)	225 (69)	150 (46)	75 (23)	60 (18)
20	4800	450 (137)	275 (84)	175 (53)	100 (31)	60 (18)	
25	6000	350 (107)	225 (69)	125 (38)	75 (23)		
30	7000	300 (91)	175 (53)	100 (31)	75 (23)		
35	8400	250 (76)	150 (46)	100 (31)			
40	9600	225 (69)	125 (38)	75 (23)			
45	10,800	200 (61)	125 (38)				
50	12,000	175 (53)	100 (31)				

*Conductor size is based on maximum 2% voltage drop

TRUE BLUE[®]

WARRANTY

Effective January 1, 2017

(Equipment with a serial number preface of MH or newer)

This limited warranty supersedes all previous Miller warranties and is exclusive with no other guarantees or warranties expressed or implied.

Warranty Questions?

Call
1-800-4-A-MILLER
for your local
Miller distributor.

Your distributor also gives
you ...

Service

You always get the fast,
reliable response you
need. Most replacement
parts can be in your
hands in 24 hours.

Support

Need fast answers to the
tough welding questions?
Contact your distributor.
The expertise of the
distributor and Miller is
there to help you, every
step of the way.

LIMITED WARRANTY – Subject to the terms and conditions below, Miller Electric Mfg. Co., Appleton, Wisconsin, warrants to its original retail purchaser that new Miller equipment sold after the effective date of this limited warranty is free of defects in material and workmanship at the time it is shipped by Miller. THIS WARRANTY IS EXPRESSLY IN LIEU OF ALL OTHER WARRANTIES, EXPRESS OR IMPLIED, INCLUDING THE WARRANTIES OF MERCHANTABILITY AND FITNESS.

Within the warranty periods listed below, Miller will repair or replace any warranted parts or components that fail due to such defects in material or workmanship. Miller must be notified in writing within thirty (30) days of such defect or failure, at which time Miller will provide instructions on the warranty claim procedures to be followed. If notification is submitted as an online warranty claim, the claim must include a detailed description of the fault and the troubleshooting steps taken to identify failed components and the cause of their failure.

Miller shall honor warranty claims on warranted equipment listed below in the event of such a failure within the warranty time periods. All warranty time periods start on the delivery date of the equipment to the original end-user purchaser, and not to exceed twelve months after the equipment is shipped to a North American distributor or eighteen months after the equipment is shipped to an International distributor.

1. 5 Years Parts — 3 Years Labor
 - * Original Main Power Rectifiers Only to Include SCRs, Diodes, and Discrete Rectifier Modules
2. 3 Years — Parts and Labor
 - * Auto-Darkening Helmet Lenses (Except Classic Series) (No Labor)
 - * Engine Driven Welder/Generators
(NOTE: Engines are Warranted Separately by the Engine Manufacturer.)
 - * Inverter Power Sources (Unless Otherwise Stated)
 - * Plasma Arc Cutting Power Sources
 - * Process Controllers
 - * Semi-Automatic and Automatic Wire Feeders
 - * Transformer/Rectifier Power Sources
3. 2 Years — Parts and Labor
 - * Auto-Darkening Helmet Lenses – Classic Series Only (No Labor)
 - * Fume Extractors – Capture 5, Filtair 400 and Industrial Collector Series
4. 1 Year — Parts and Labor Unless Specified
 - * AugmentedArc and LiveArc Welding Systems
 - * Automatic Motion Devices
 - * Bernard BTB Air-Cooled MIG Guns (No Labor)
 - * CoolBelt and CoolBand Blower Unit (No Labor)
 - * Desiccant Air Dryer System
 - * External Monitoring Equipment and Sensors
 - * Field Options
(NOTE: Field options are covered for the remaining warranty period of the product they are installed in, or for a minimum of one year — whichever is greater.)
 - * RFCS Foot Controls (Except RFCS-RJ45)
 - * Fume Extractors – Filtair 130, MWX and SWX Series
 - * HF Units
 - * ICE/XT Plasma Cutting Torches (No Labor)
 - * Induction Heating Power Sources, Coolers
(NOTE: Digital Recorders are Warranted Separately by the Manufacturer.)
 - * Load Banks
 - * Motor-Driven Guns (except Spoolmate Spoolguns)
 - * PAPR Blower Unit (No Labor)
 - * Positioners and Controllers
 - * Racks
 - * Running Gear/Trailers
 - * Spot Welders
 - * Subarc Wire Drive Assemblies
 - * TIG Torches (No Labor)
 - * Tregaskiss Guns (No Labor)
 - * Water Cooling Systems
 - * Wireless Remote Foot/Hand Controls and Receivers
 - * Work Stations/Weld Tables (No Labor)

5. 6 Months — Parts
 - * Batteries
6. 90 Days — Parts
 - * Accessory (Kits)
 - * Canvas Covers
 - * Induction Heating Coils and Blankets, Cables, and Non-Electronic Controls
 - * M-Guns
 - * MIG Guns, Subarc (SAW) Torches, and External Cladding Heads
 - * Remote Controls and RFCS-RJ45
 - * Replacement Parts (No labor)
 - * Spoolmate Spoolguns

Miller's True Blue[®] Limited Warranty shall not apply to:

1. **Consumable components; such as contact tips, cutting nozzles, contactors, brushes, relays, work station table tops and welding curtains, or parts that fail due to normal wear. (Exception: brushes and relays are covered on all engine-driven products.)**
2. Items furnished by Miller, but manufactured by others, such as engines or trade accessories. These items are covered by the manufacturer's warranty, if any.
3. Equipment that has been modified by any party other than Miller, or equipment that has been improperly installed, improperly operated or misused based upon industry standards, or equipment which has not had reasonable and necessary maintenance, or equipment which has been used for operation outside of the specifications for the equipment.

MILLER PRODUCTS ARE INTENDED FOR PURCHASE AND USE BY COMMERCIAL/INDUSTRIAL USERS AND PERSONS TRAINED AND EXPERIENCED IN THE USE AND MAINTENANCE OF WELDING EQUIPMENT.

In the event of a warranty claim covered by this warranty, the exclusive remedies shall be, at Miller's option: (1) repair; or (2) replacement; or, where authorized in writing by Miller in appropriate cases, (3) the reasonable cost of repair or replacement at an authorized Miller service station; or (4) payment of or credit for the purchase price (less reasonable depreciation based upon actual use) upon return of the goods at customer's risk and expense. Miller's option of repair or replacement will be F.O.B., Factory at Appleton, Wisconsin, or F.O.B. at a Miller authorized service facility as determined by Miller. Therefore no compensation or reimbursement for transportation costs of any kind will be allowed.

TO THE EXTENT PERMITTED BY LAW, THE REMEDIES PROVIDED HEREIN ARE THE SOLE AND EXCLUSIVE REMEDIES. IN NO EVENT SHALL MILLER BE LIABLE FOR DIRECT, INDIRECT, SPECIAL, INCIDENTAL OR CONSEQUENTIAL DAMAGES (INCLUDING LOSS OF PROFIT), WHETHER BASED ON CONTRACT, TORT OR ANY OTHER LEGAL THEORY.

ANY EXPRESS WARRANTY NOT PROVIDED HEREIN AND ANY IMPLIED WARRANTY, GUARANTY OR REPRESENTATION AS TO PERFORMANCE, AND ANY REMEDY FOR BREACH OF CONTRACT TORT OR ANY OTHER LEGAL THEORY WHICH, BUT FOR THIS PROVISION, MIGHT ARISE BY IMPLICATION, OPERATION OF LAW, CUSTOM OF TRADE OR COURSE OF DEALING, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR PARTICULAR PURPOSE, WITH RESPECT TO ANY AND ALL EQUIPMENT FURNISHED BY MILLER IS EXCLUDED AND DISCLAIMED BY MILLER.

Some states in the U.S.A. do not allow limitations of how long an implied warranty lasts, or the exclusion of incidental, indirect, special or consequential damages, so the above limitation or exclusion may not apply to you. This warranty provides specific legal rights, and other rights may be available, but may vary from state to state.

In Canada, legislation in some provinces provides for certain additional warranties or remedies other than as stated herein, and to the extent that they may not be waived, the limitations and exclusions set out above may not apply. This Limited Warranty provides specific legal rights, and other rights may be available, but may vary from province to province.





Owner's Record

Please complete and retain with your personal records.

Model Name

Serial/Style Number

Purchase Date

(Date which equipment was delivered to original customer.)

Distributor

Address

City

State

Zip



For Service

Contact a DISTRIBUTOR or SERVICE AGENCY near you.

Always provide Model Name and Serial/Style Number.

Contact your Distributor for:

Welding Supplies and Consumables

Options and Accessories

Personal Safety Equipment

Service and Repair

Replacement Parts

Training (Schools, Videos, Books)

Technical Manuals (Servicing Information and Parts)

Circuit Diagrams

Welding Process Handbooks

To locate a Distributor or Service Agency visit www.millerwelds.com or call 1-800-4-A-Miller

Contact the Delivering Carrier to:

File a claim for loss or damage during shipment.

For assistance in filing or settling claims, contact your distributor and/or equipment manufacturer's Transportation Department.

Miller Electric Mfg. Co.

An Illinois Tool Works Company
1635 West Spencer Street
Appleton, WI 54914 USA

International Headquarters—USA

USA Phone: 920-735-4505 Auto-Attended
USA & Canada FAX: 920-735-4134
International FAX: 920-735-4125

For International Locations Visit
www.MillerWelds.com

